



Technical Service Bulletin

Technical Service Bulletin: tsb101518

Released Date: 06-Oct-2004

New Fan Idler Dust Shields

New Fan Idler Dust Shields

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents


This Service/Parts Topic supersedes topic 04T8-6. Replace 04T8-6 with this topic.

This Service/Parts Topic announces a fan idler bearing dust shield, Part Number 3635105, for the QSK45 and QSK60 engines and updates Procedure 008-030, Fan Drive Idler Pulley Assembly.

The dust shield reduces the possibility of fan belt tensioner issues due to dust ingress to the fan idler bearing.

The component went into production at the Daventry Engine Plant in July, 2003.

The engine serial number first is 33154312.

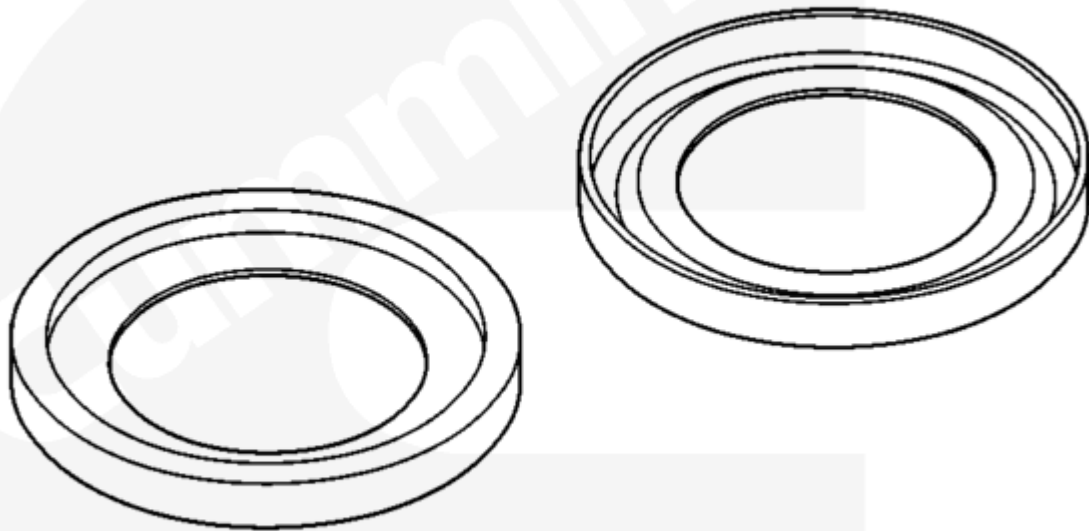


08600527

Dust Shield, Part Number 3635105.

Note : This is a product improvement, not subject to campaign.


Note : This does not apply to Komatsu WA1200 front-end loaders equipped with a QSK60 engine with fan drive option FA 6165-06. The fan belt pulley and bearings on WA1200 are not the same as on other industrial QSK60 engines, and therefore can not use the dust shields Part Number 3635105.

The new dust shields are installed on either side of the idler pulley as part of the Pivot Arm Assembly (1).

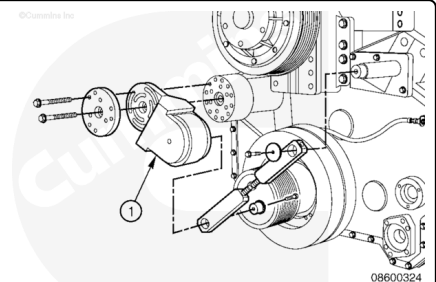

Note : When using dust shields with pivot arm assembly, Part Number 4066540, the use of the key shaft is not required. Fan idler bearings should be replaced with Part Number 4016800.

The bearings (4) mount on the idler shaft (1). The two dust shields (3), packed with grease, mount to the bearings; one at the spacer (6) side, and the other at the shaft shoulder (1) side.

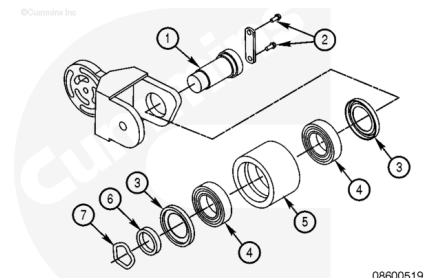

Pivot Arm Assembly Parts Matrix		
Item Number	Description	Part Number
1	Idler shaft	4066386
5	Idler pulley	4001566
4	Idler bearing	4016800
3	Dust shield	3635105
6	Spacer ring	4001568
7	Spring	3171146

Related Procedures

56-008-030-tr (/qs3/pubsys2/xml/en/procedures/56/56-008-030-tr.html)	Fan Drive Idler Pulley Assembly (/qs3/pubsys2/xml/en/procedures/56/56-008-030-tr.html)
---	---

Last Modified: 06-Oct-2004