



Technical Service Bulletin

Technical Service Bulletin: tsb103980

Released Date: 11-Nov-2009

New Alternator and Accessory Drive Seal

New Alternator and Accessory Drive Seal

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Service/Parts Topic replaces Service/Parts Topic 01T9-4. Replace Service/Parts Topic 01T9-4 with this Topic.

This Service/Parts Topic introduces new accessory and alternator drive seal and pulleys for the QSK45 and QSK60 engines. The new accessory and alternator drive seal, Part Number 4080404, replaces the old accessory drive seal, Part Number 3171909. The new accessory drive seal will be included in Service Kit, Part Number 4085931. The service kit contains the items listed in Table 1.

Table 1, Service Kit, Part Number 4085931, Contents

4080404	Seal, Accessory Drive
4080395	Washer
4085923	Spacer, Mounting

The new accessory and alternator drive seal is **not** a direct replacement for the old accessory and alternator drive seal. As a result, modification of the old pulley or installation of a new pulley is required. Refer to Table 2, Accessory and Alternator Drive Seal Matrix, below.


Accessory and Alternator Drive Seal Service Procedure Matrix

If replacing the accessory and alternator drive seal, Part Number 4080404, the seal is a direct replacement. For installation instructions, use the Troubleshooting and Repair Manual, QSK45 and QSK60 Engines, Bulletin 3666261.

If replacing the old accessory and alternator drive seal, Part Number 3171909, the following information applies. Refer to Table 2 for the correct procedure.

Table 2, Accessory and Alternator Drive Seal Matrix


Pulley Part Number	Factory Option Part Number	Associated Procedure
3171728	PU6704	Alternator Drive Seal Procedure 001-001
3332188	PU6701	Alternator Drive Seal Procedure 001-001
3332203	PU6703	Alternator Drive Seal Procedure 001-001
4001382	PU6705	Alternator Drive Seal Procedure 001-001
4017444	AD6020	Accessory Drive Seal Procedure 001-003
4017445	AD6022	Accessory Drive Seal Procedure 001-003
4017446	AD6019	Accessory Drive Seal Procedure 001-003
4017447	AD6021	Accessory Drive Seal Procedure 001-003
4017448	AD6023	Accessory Drive Seal Procedure 001-003

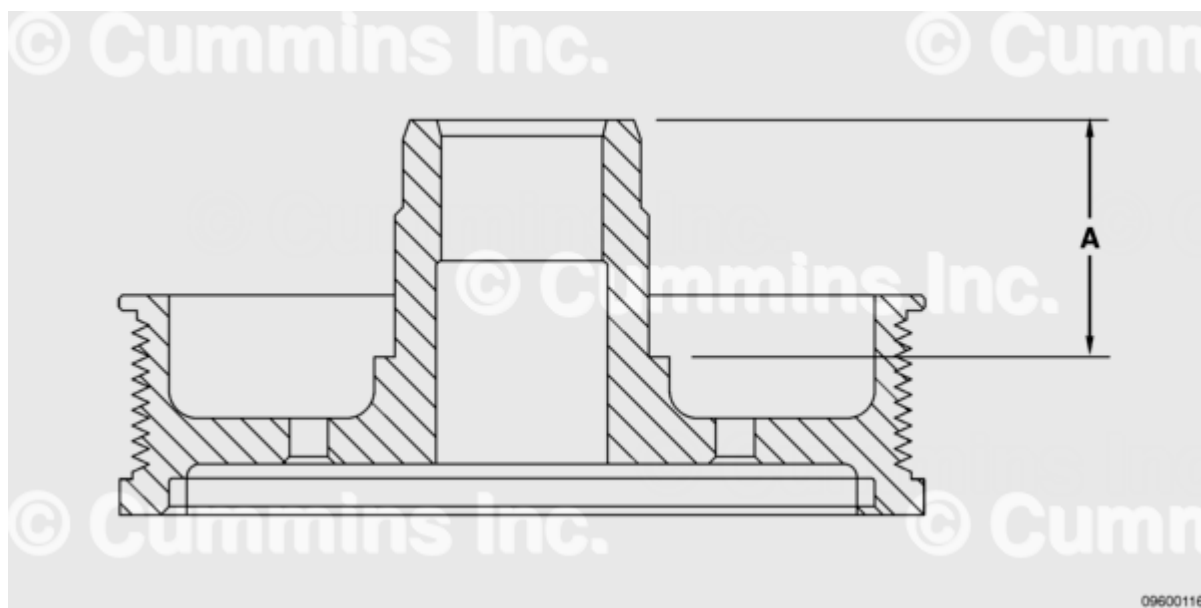**Alternator Drive Seal, Right Bank**

Remove the alternator drive pulley and perform one of the following:

1. Machine 2.1 mm [0.08 in] From the length A of the pulley or
2. Purchase a new pulley. See Table 3 for the correct new pulley part number.

Table 3, Alternator Drive Pulley Part Numbers, Right Bank	
Old Drive Pulley Part Number	New Drive Pulley Part Number
3171728	4080396
3332188	4080397
3332203	4080398
4001382	4080399

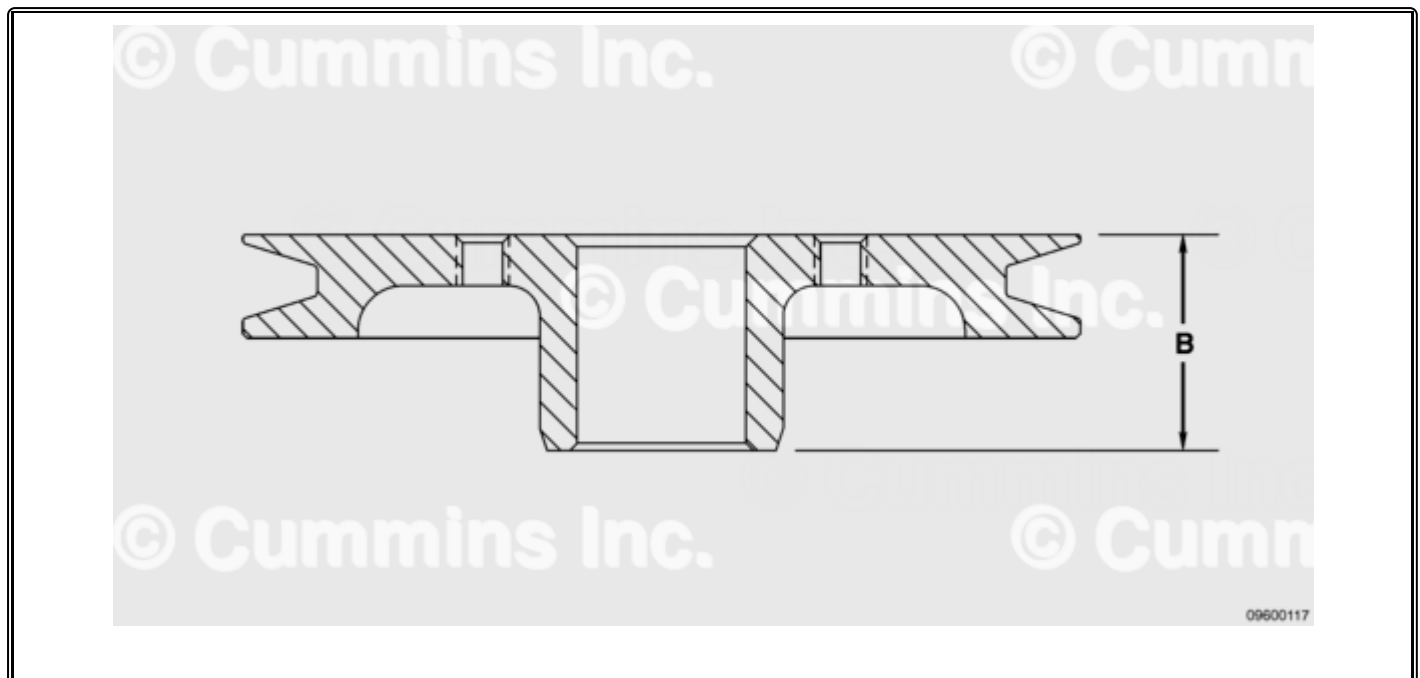

Accessory Drive Seal, Left Bank

Remove the accessory drive pulley and perform one of the following:

- Reuse the old pulley by installing the spacer, to increase the distance (B), provided in the seal service kit or
- Purchase a new pulley. See Table 4 for the correct new pulley part number.

Table 4, Accessory Drive Pulley Part Numbers, Left Bank	
Old Drive Pulley Part Number	New Drive Pulley Part Number
4017444	4080400
4017445	4080401
4017446	4080425
4017447	4080402
4017448	4080403

Related Procedures

56-001-001 (/qs3/pubsys2/xml/en/procedures/56/56-001-001.html)	Alternator Drive Seal (/qs3/pubsys2/xml/en/procedures/56/56-001-001.html)
56-001-003-tr (/qs3/pubsys2/xml/en/procedures/56/56-001-003-tr.html)	Accessory Drive Seal (/qs3/pubsys2/xml/en/procedures/56/56-001-003-tr.html)

Last Modified: 11-Nov-2009
