



Technical Service Bulletin

Technical Service Bulletin: TSB120225

Released Date: 18-Jul-2012

Low Temperature Aftercooler (LTA) Water Pump Option Upgrade For QSK45 and QSK60 Engines With HPI Fuel System and QSK60G Engines.

Low Temperature Aftercooler (LTA) Water Pump Option Upgrade For QSK45 and QSK60 Engines With HPI Fuel System and QSK60G Engines.

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document informs the field about a possibility to upgrade the greased bearing LTA water pump, Part Number 4085944, to the oil supplied bearing LTA water pump, Part Number 3640492, during a pump replacement service event or an engine rebuild process the for use in QSK45 and QSK60 engines with HPI fuel system and QSK60G.

On factory built engines, if a new oil supplied bearing LTA water pump, Part Number 3640492, is to be installed in place of an old greased bearing LTA water pump, Part Number 4085922, the following additional parts are required:

Additional Part Numbers Required		
Part Number	Quantity	Part Description
3638095	1	Flexible Hose
3963982	2	Sealing Washer
68152	2	Clip
3682701	1	Male Union Elbow
3638094	1	Banjo Connection Screw

A service kit, Part Number 4955807, has been released which contains LTA water pump, Part Number 3640492, and all the above components.

- For installation and removal information on QSK45 and QSK60 engines, refer to Procedure 008-109 in the QSK45 and QSK60 Service Manual, Bulletin 4021530.
- For installation and removal information on QSK60 Gas engines, refer to Procedure 008-109 in the QSK60 Gas Service Manual, Bulletin 4021383.

The greased bearing LTA water pump will still be available for KV engines.

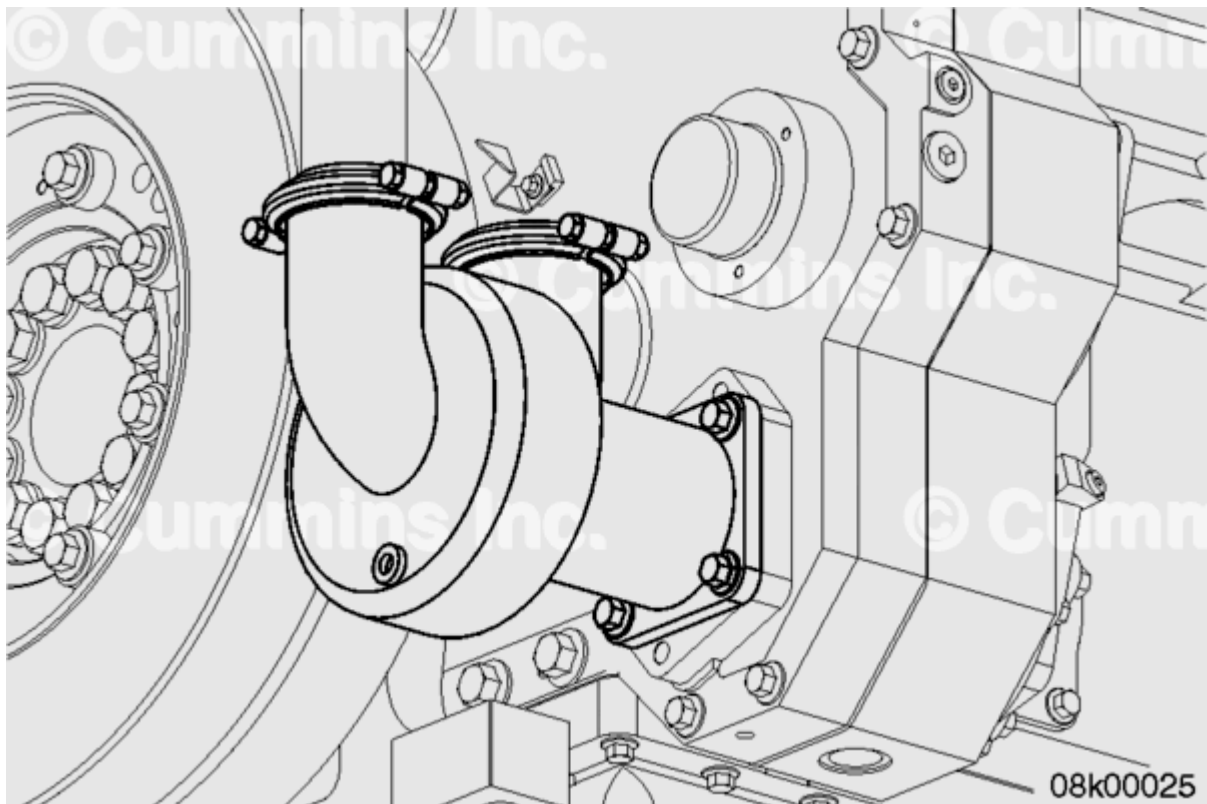


Figure 1, Greased bearing LTA water pump.

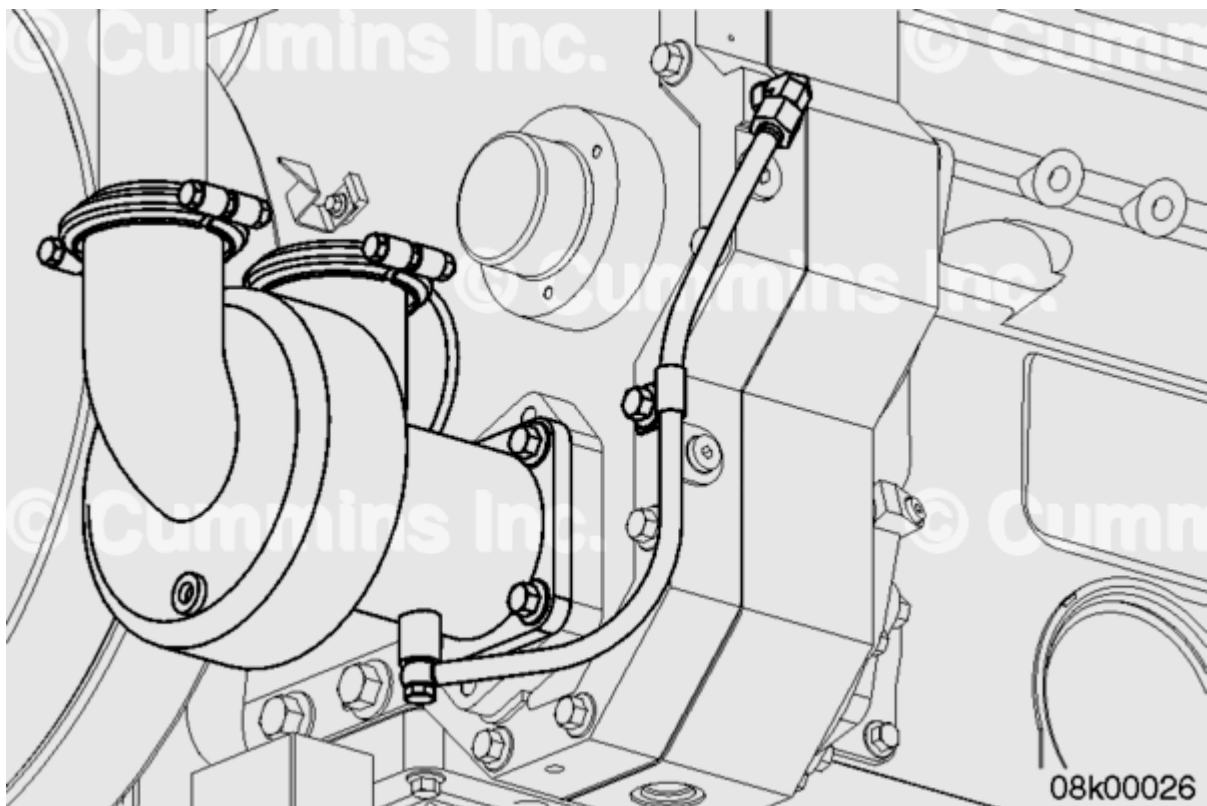


Figure 2, Oil supplied bearing LTA water pump.

Document History

Date	Details
2012-7-11	Module Created

Last Modified: 18-Jul-2012
