



Technical Service Bulletin

Technical Service Bulletin: TSB170095

Released Date: 08-Aug-2018

New Blowby Pressure Sensor

New Blowby Pressure Sensor

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- K38 (All Versions)
- K50 (All Versions)
- QSK45 CM500
- QSK45 G
- QSK60 CM2250 K112
- QSK60 CM500
- QSK60 G
- QSK78 CM2250 K104
- QSK78 CM500
- QSK78PG CM500 and CM850
- QST30 CM552

Description of Change

- A new blowby pressure sensor is available. New blowby pressure sensor has a total of eight capscrews on upper housing of sensor body.
- Existing blowby pressure sensor has six capscrews on upper housing of sensor body.

Reason for Change


Moisture or dirt ingress into sensor internals can occur as existing blowby pressure sensor has insufficient clamping of internal environmental and bezel seals. New design prevents loss of compression sealing on blowby pressure sensor upper housing.


Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Sensor, Blowby Flow	3867561	Yes	Yes	5461522

Part Identification

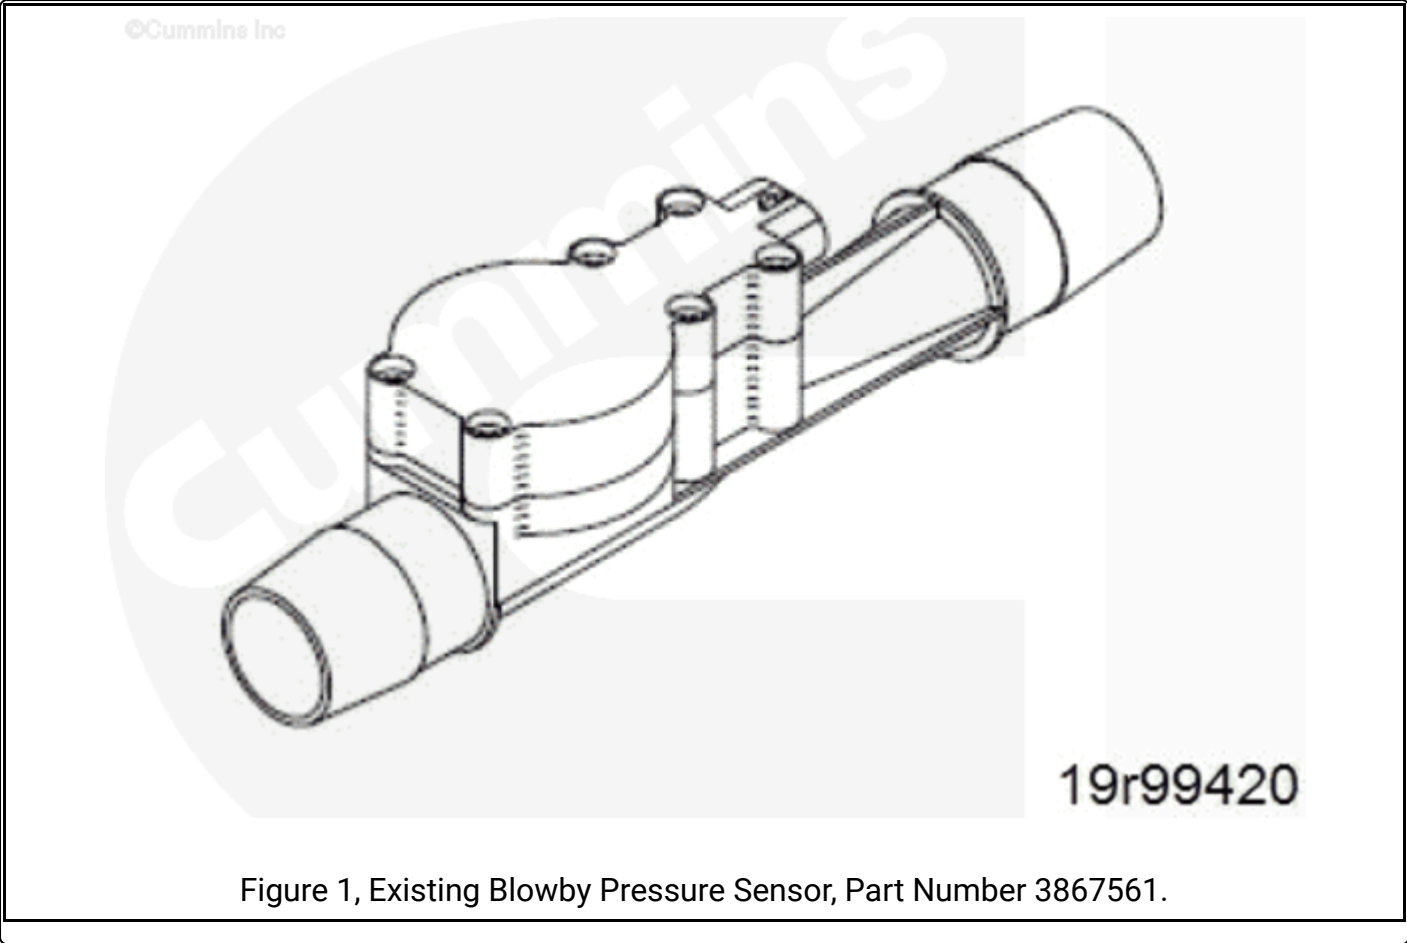

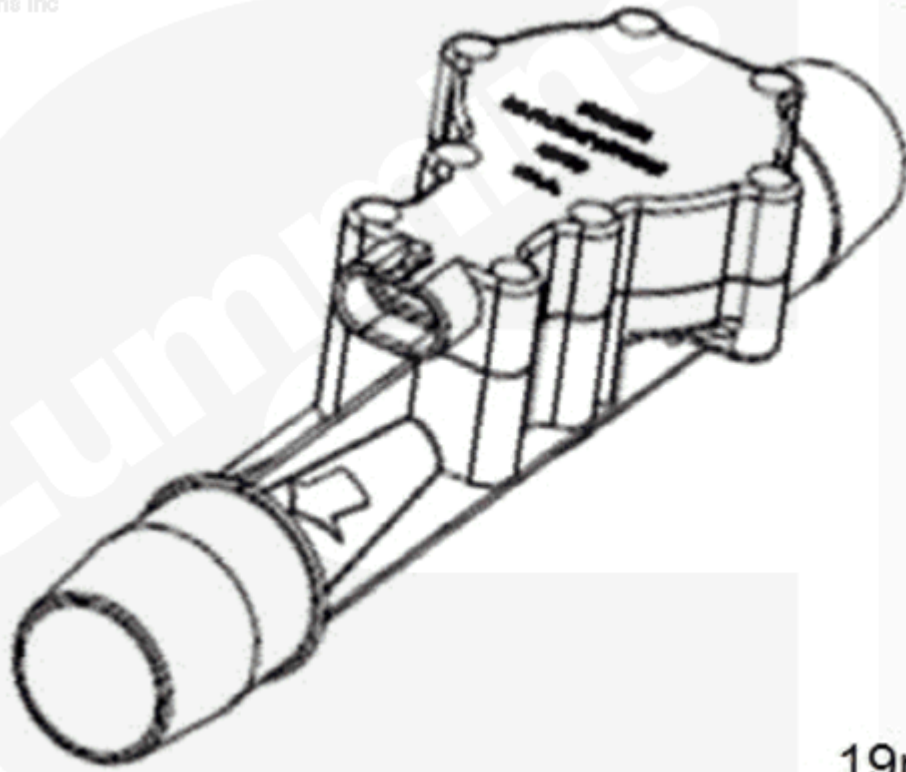

19r99421

New Blowby Pressure Sensor, Part Number 5461522.

Production Status

Implemented for production. See Table 2.

Table 2, Production Information

Product	Engine Serial Number (ESN) First	Build Date ¹	Engine Plant
QSK78 CM2250 K104	66304432	14-August-2017	Daventry Engine Plant
QSK60 CM2250 K112	33210815	14-August-2017	Daventry Engine Plant

¹Engine build date can be found on engine dataplate.

Document History

Date	Details
2017-8-31	Module Created

