



Technical Service Bulletin

Technical Service Bulletin: TSB180091

Released Date: 24-Feb-2022

New Camshaft Thrust Bearings

New Camshaft Thrust Bearings

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK45 CM500
- QSK60 CM500
- QSK60 CM850
- QSK60 CM2150

Issue

Symptom:

- Fault Code 1376
- Engine runs rough

Root Cause:

- Camshaft thrust bearing may wear excessively, causing camshaft speed sensor to be out of operating range.

Resolution

A new camshaft thrust bearing has been released.

Description of Change

New camshaft thrust bearing is made from a more robust material. New camshaft thrust bearing also incorporates a ramp and pad design on the thrust surface, creating an oil film between camshaft thrust bearing and camshaft.

Part Identification

New part has 12 oil grooves, existing part has 6 oil grooves. See Figure 1.

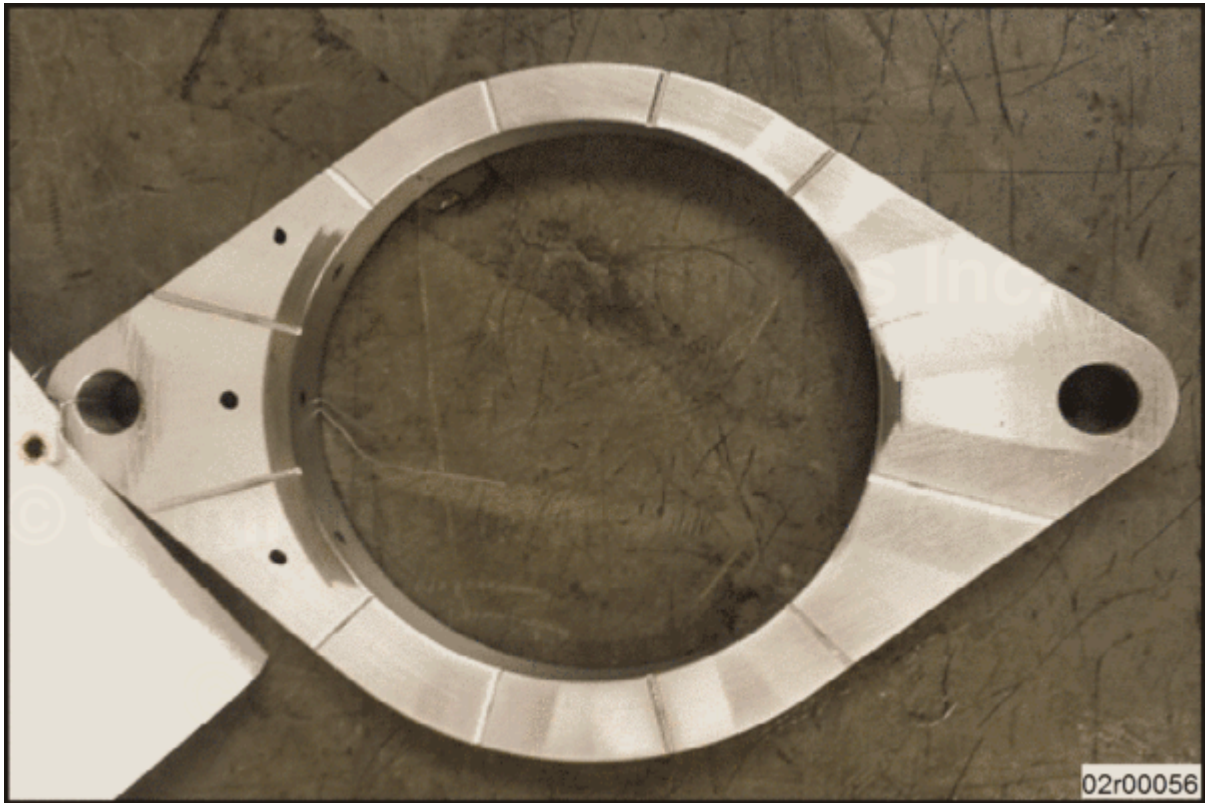


Figure 1, New Cam Thrust Bearing.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Camshaft Thrust Bearing	3082437	Yes	Yes	5374098

Document History

Date	Details
2018-7-11	Module Created
2018-7-13	Corrected Part Number 5374098.
2022-2-23	Removed QSK78 CM500.

