



Technical Service Bulletin

Technical Service Bulletin: TSB200223

Released Date: 28-Mar-2022

New Intercooler Transfer Tube Connection

New Intercooler Transfer Tube Connection

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK60 CM500
- QSK60 CM2150
- QSK78 CM2250 K104
- QSK78 CM2350 K126
- QSK78 CM2350 K137
- QSK78 CM500

Description of Change

This TSB is to announce the new intercooler transfer tube connection with a Double O ring flange design. The new design includes the addition of a second O ring and an all in one water and air seal grommet. The Double O ring flange will hold the air seal.

Reason for Change

The changes made to the flange design aim to improve contact area and sealing capability of the joint.

Service Instructions

Use of P80 lubrication, Part Number 3824878, during O ring installation is recommended for ease of assembly.

Service Parts Availability

Service parts are available.

Table 1, Service Parts						
Part Description	Option Number	Existing Part Number	Obsolete	Superseded	New Part Number	Quantity
Water Transfer Tube (QSK78 HPI)	WA6714	4006969	Yes	Yes	5540991	1
		4006971	Yes	Yes	5540990	1
		4007336	Yes	Yes	5541093	2
Water Transfer Tube (QSK78 MCRC)	TB67156	5372635	Yes	Yes	5541167	1
		5372636	Yes	Yes	5541170	1
		5372634	Yes	Yes	5541173	2
O ring	WA6714	3035026	Yes	Yes	5610899	2
Water Transfer Tube (QSK60 HPI and MCRC)	WA6734	4927478	Yes	Yes	5541159	1
		3635720			5541161	
		3635718			5541163	
		4927488			5541165	

Part Identification

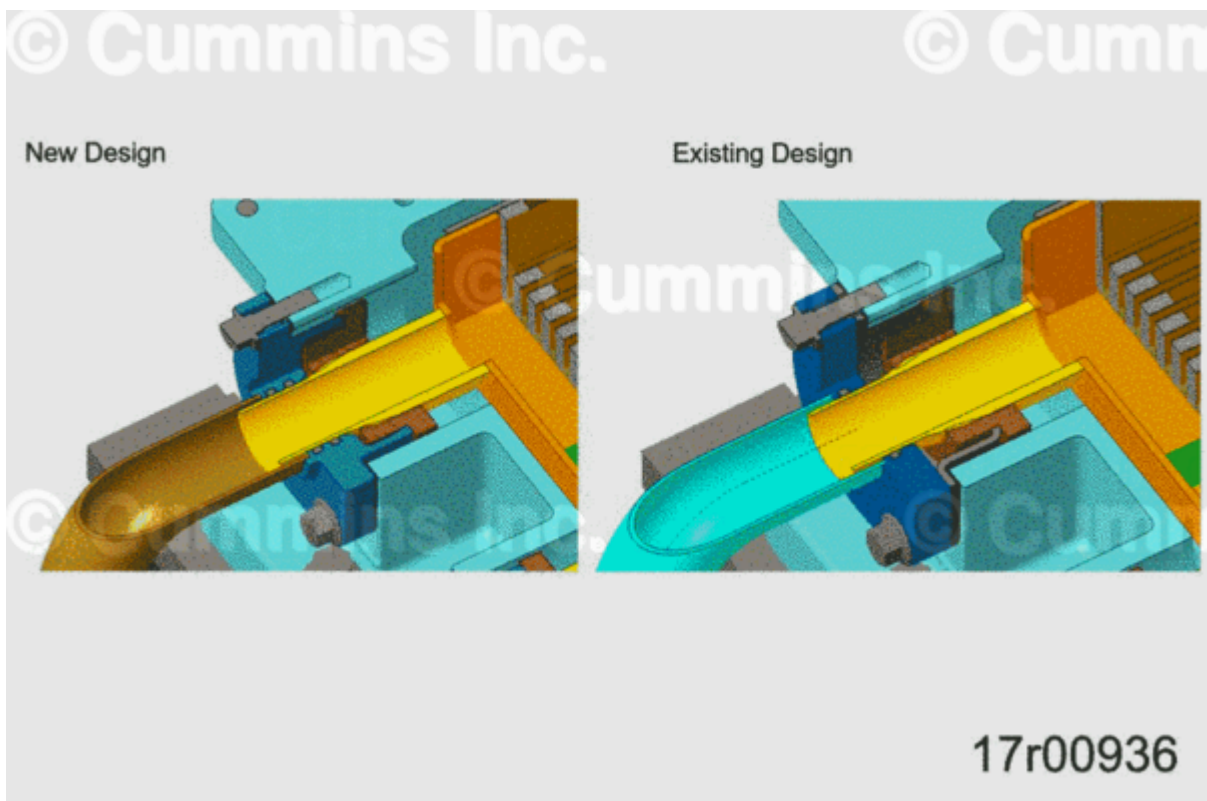


Figure 1, New Water Transfer Tube Versus Existing Water Transfer Tube



Figure 2, Cross Section of New Flange with Double O-Ring Groove.

Use existing part number inventory before using the new part number.

Production Status

Implemented for production.

Table 2, Production Information

ESN First	Build Date ¹	Plant
66306022 (QSK78 HPI)	11 September 2020	Daventry
66306096 (QSK78 MCRS)	26 January 2021	Daventry
33227757 (QSK60)	21 March 2022	Daventry
¹ Engine build date can be found on the engine dataplate.		

Publications Affected/Associated Publications

Table 3, Publications Affected

Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Troubleshooting and Repair Manual	QSK78	3666727	Air Intake System	010-083	10

Document History

Date	Details
2020-11-19	Module Created
2021-1-27	Non-Product Problem Solving (PPS)
2022-3-25	Added new engines. Updated Table 1 and Table 2.

Last Modified: 28-Mar-2022
