



Technical Service Bulletin

Technical Service Bulletin: TSB210009

Released Date: 12-Jan-2021

New Cylinder Block to Reduce MCRS Fuel Pump Malfunction

New Cylinder Block to Reduce MCRS Fuel Pump Malfunction

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK60 CM500
- QSK60 CM850
- QSK60 CM2150
- QSK60 CM2150 K132M
- QSK60 CM2250 K112
- QSK60 CM2350 K116
- QSK60 CM2350 K117
- QSK60 CM2350 K121
- QSK60 CM2350 K135
- QSK60 CM2350 K136
- QSK60 CM2350 K133
- QSK60 CM2350 K149M

Issue

Malfunctions of the MCRS fuel pump, caused by low oil supply pressure have been identified.

Resolution

- To increase the oil supply pressure to the MCRS fuel pump, a new cylinder block has been released with a new drilling on the left bank side of the cylinder block. The drilling provides a location for a dedicated high-pressure oil supply line to be linked to the MCRS fuel pump. This drilling will be utilized by Daventry production line to install this supply line once available.
- All service orders of this new cylinder block **must** block off this hole with the blanking plate provided. See Table 1 below for part numbers.

A field upfit high pressure line is being developed and will be available in 2021.

Service Instructions

The Service Manual procedure has been updated with instructions on how to fit the blanking plate. See corresponding Service Manual. Reference Procedure 001-136 in Section 1

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Cylinder Block	3642910	Yes	Yes	5538921
Block-off Plate	-	No	No	5633372

Part Compatibility

The new cylinder block is compatible with all older designs if the blanking plate is fitted.

Part Identification

The new cylinder block part number can be identified by the hole drilled in the side of the left bank of the cylinder block. See Figure 1 below.

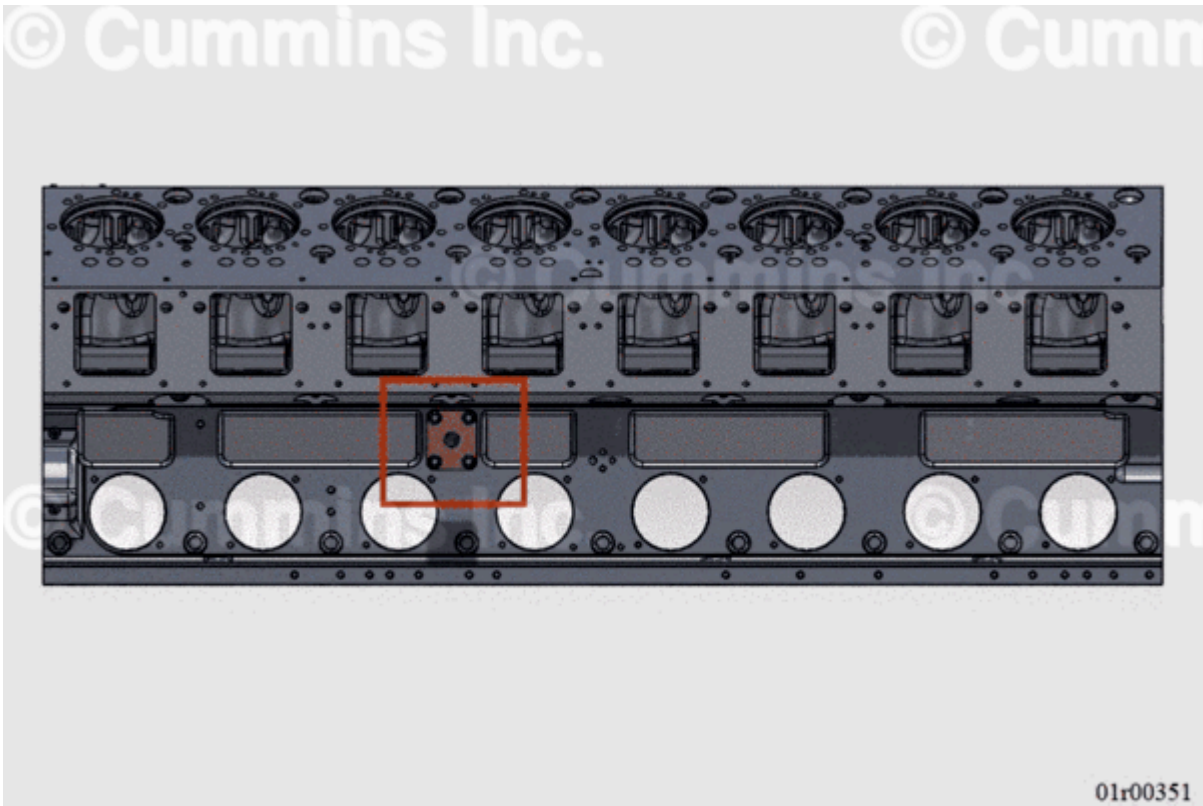


Figure 1, Location of New Drilling in Left Bank of New Cylinder Block Part Number.

Part Inventory Action

Use existing part number inventory before using the new part number.

Production Status

Implemented for production. See Table 2.

Table 2, Production Information

ESN First	Build Date ¹	Plant
33222964	02 October 2020	Daventry

¹Engine build date can be found on the engine dataplate.

Document History

Date	Details
2021-1-12	Module Created
2021-1-12	Quick Fix application:

Last Modified: 12-Jan-2021
