



Technical Service Bulletin

Technical Service Bulletin: TSB210188

Released Date: 16-Dec-2021

New Accessory Drive Seal: Lubricating Oil Leaks

New Accessory Drive Seal: Lubricating Oil Leaks

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK45 CM500
- QSK60 CM2150
- QSK60 CM2150 K132M
- QSK60 CM2350 K116
- QSK60 CM2350 K117
- QSK60 CM2350 K121
- QSK60 CM2350 K135
- QSK60 CM2350 K136
- QSK60 CM500
- QSK60 CM850
- QSK78 CM2250 K104
- QSK78 CM2350 K126
- QSK78 CM2350 K137
- QSK78 CM500

Description of Change

A new accessory drive seal has been released which utilizes a press fit in to the gear cover rather than a three-bolt design.

Reason for Change

There has been reports of lubricating oil leaks from the accessory drive seals.

Service Instructions

- The new accessory drive seal utilizes a press fit design. A new seal installation tool kit **must** be purchased. See Table 1 below for part numbers.
- If an accessory drive seal is being replaced and changing from the three-bolt design to the press fit design, a new pulley **must** also be purchased. The existing pulleys have an extra step in the casting which damages the new accessory drive seal during installation.

Service Parts Availability

Service parts are available. See Table 1 below for part numbers.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Accessory drive seal	4080404	No	Yes	5538007
Seal installation tool kit	-	No	No	5573436
Accessory drive pulley	3638841	Yes	Yes	5580863
Accessory drive pulley	3643531	Yes	Yes	5580858
Accessory drive pulley	3643861	Yes	Yes	5580859
Accessory drive pulley	4080396	Yes	Yes	5580810
Accessory drive pulley	4080397	Yes	Yes	5580811
Accessory drive pulley	4080398	Yes	Yes	5580812
Accessory drive pulley	4080400	Yes	Yes	5580860
Accessory drive pulley	4080401	Yes	Yes	5580861
Accessory drive pulley	4381170	Yes	Yes	5580813
Accessory drive pulley	4080403	Yes	Yes	5580862

Part Compatibility

Existing pulleys fitted to engines are **not** compatible with new design accessory drive seal. If a new accessory drive seal is purchased a new pulley **must** also be purchased.

Part Identification

- The existing design can be identified by the three capscrew fitment as shown in Figure 1 below.
- The new design can be identified by the press fitment as shown in Figure 2 below.



Figure 1, Existing Accessory Drive Seal Design.

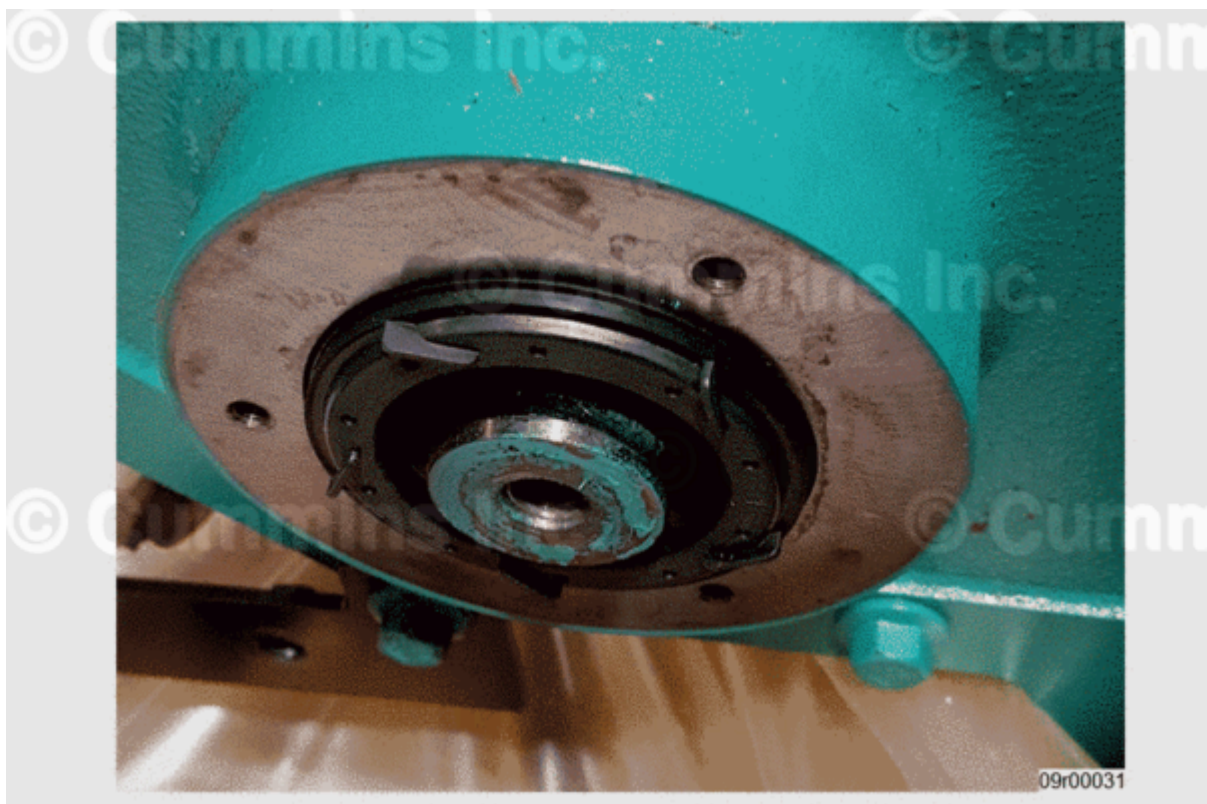


Figure 2, New Accessory Drive Seal Design.

Part Inventory Action

The existing accessory drive seals are **not** to be used on QSK60 and QSK78 application but is still in use for the QSK95 engines.

Production Status

Implemented for production. See Table 2 below.

Table 2, Production Information

Part number	Product	ESN First	Build Date	Plant
5580863	QSK78	66306277	20-July-2021	Daventry
	QSK60	33225566	21-July-2021	
5580810	QSK78	66306277	20-July-2021	
	QSK60	33225537	19-July-2021	
5580859	QSK60	33225608	26-July-2021	Daventry
5580811	QSK60	33225607	26-July-2021	Daventry
5580812	QSK60	33225599	23-July-2021	Daventry

Publications Affected**Table 3, Publications Affected**

Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Service Manual	QSK45 and QSK60 CM500,850,2150	4021530	Accessory drive seal	Refer to Procedure 001-003 (/qs3/pubsy s2/xml/en/pr ocedures/56 /56-001-003.html)	1
Service Manual	QSK60 CM2350 K116	4367444	Accessory drive seal	Refer to Procedure 001-003 (/qs3/pubsy s2/xml/en/pr ocedures/35 9/359-001-003.html)	1
Service Manual	QSK60 CM2350 K117	4367449	Accessory drive seal	Refer to Procedure 001-003 (/qs3/pubsy s2/xml/en/pr ocedures/35 9/359-001-003.html)	1

Table 3, Publications Affected					
Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Service Manual	QSK60 CM2350 K121	4388645	Accessory drive Seal	Refer to Procedure 001-003 (/qs3/pubsys2/xml/en/procedures/359/359-001-003.html)	1
Service Manual	QSK60 CM2350 K135	5504626	Accessory drive Seal	Refer to Procedure 001-003 (/qs3/pubsys2/xml/en/procedures/587/587-001-003.html)	1
Service Manual	QSK60 CM2350 K136	5504626	Accessory drive seal	Refer to Procedure 001-003 (/qs3/pubsys2/xml/en/procedures/587/587-001-003.html)	1

Document History

Date	Details
2021-8-26	Module Created
2021-9-9	Updated Table 2.
2021-11-5	Added QSK45 CM500.

