



Technical Service Bulletin

Technical Service Bulletin: tsb100872

Released Date: 23-Oct-2009

New Lubricating Oil Pumps

New Lubricating Oil Pumps

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin announces the release of new lubricating oil pumps for use on QSK45, QSK60 and QSK78 series engines.

The new lubricating oil pumps have had the internal oil passages revised to allow the lubricating oil pump idler gear bushing to be supplied with filtered oil, increasing the durability of the pump. The new lubricating oil pump part numbers are shown in Table 1.

The effective date of implementation into production for the QSK45, QSK60, and QSK78 engines are shown in Table 2.

Tables 3 and 4 list all the common parts available for rebuild and repair of lubricating oil pumps for the QSK45, QSK60, and QSK78 engines.

Table 1: New Oil, Pump Parts Listing

Engine	Old Part Number	New Part Number
QSK45	3638986	3642280
QSK60	3638987	3642281
QSK78	4007417	3642282

Table 2: Implementation Dates


Engine	Date	ESN First
QSK45	3-Oct-2009	33179177
QSK60	29-Sept-2009	33179178
QSK78	15-Oct-2009	66301359

Table 3: QSK45 and QSK60 Lubricating Oil Pump Rebuild Parts			
Part Number	Description	Quantity	Item Number
3903990	Capscrew (guard)	4	1
4016946	Ring dowel (idler)	1	2
3911678	Ring dowel	1	3
3635132	Suction head to housing gasket	1	4
3635141	Pressure regulator valve	1	5
3635142	Pressure regulator spring	1	6
3635139	Plug	1	7
3635133	Capscrew (Nylock)	6	8
3635134	Capscrew (Nylock)	4	9
3900634	Capscrew	2	10
4065666	High pressure relief valve spring	1	11
4066874	High pressure relief valve	1	12
4001283	Diamond dowel	1	13
4066547	Idler shaft kit	1	14
3026233	Gear retainer	1	15
3900635	Capscrew	3	16
4016829	Ball bearing	1	17

Table 4: QSK78 Lubricating Oil Pump Rebuild Parts			
Part Number	Description	Quantity	Item Number
3903990	Capscrew (guard)	4	1
4016946	Ring dowel (idler)	1	2
3911678	Ring dowel	1	3
4066876	Suction head to housing gasket	1	4
3635141	Pressure regulator valve	1	5
3635142	Pressure regulator spring	1	6
4066878	Plug	1	7
4066879	Capscrew (Nylock)	6	8

Table 4: QSK78 Lubricating Oil Pump Rebuild Parts

Part Number	Description	Quantity	Item Number
3635134	Capscrew (Nylock)	4	9
3900634	Capscrew	2	10
4065666	High pressure relief valve spring	1	11
4066874	High pressure relief valve	1	12
4001283	Diamond dowel	1	13
4066547	Idler shaft kit	1	14
3026233	Gear retainer	1	15
3900635	Capscrew	3	16
4066872	Ball bearing	1	17

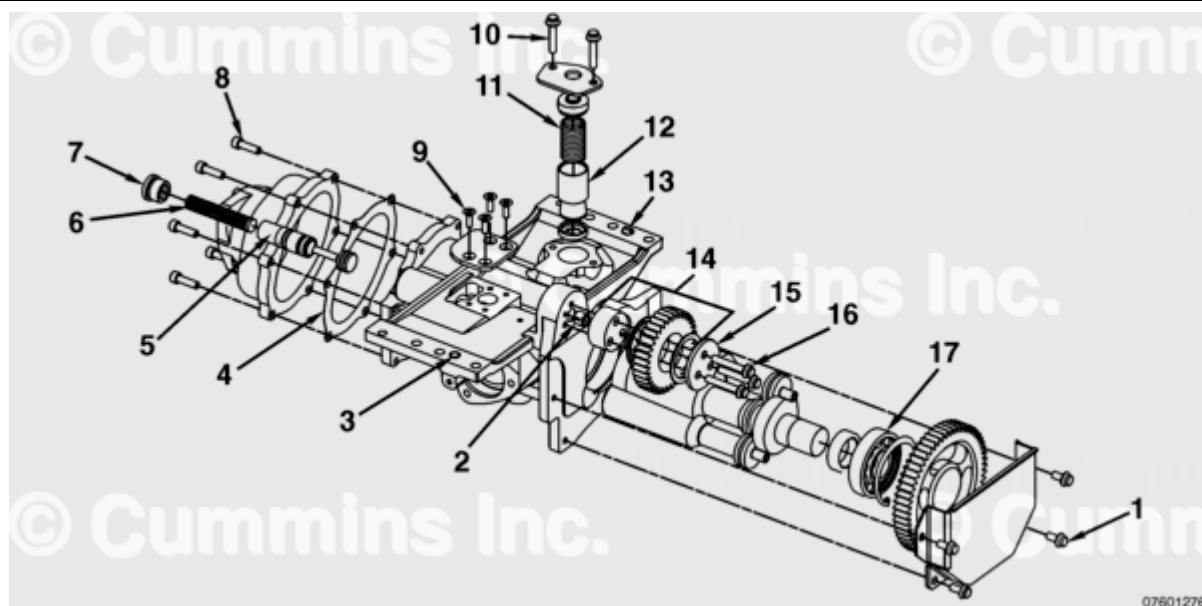

Some QSK45 and QSK60 engines were built with lubricating oil pumps similar to the one shown above, but which did **not** contain a high pressure relief valve. The lubricating oil pumps which did **not** contain high pressure relief valves are, Part Numbers 4100710 (QSK45) and 4100711 (QSK60). All parts, except for the high pressure relief valve components, used in these pumps are the same as those shown in Table 3.

If an engine has a pump that does **not** have a high pressure relief valve, it is recommended that the pump be replaced with one that does.

For further information on removal, disassembly, inspect for reuse, assembly and installation of these pumps, go to the procedures listed below in the QSK45 and QSK60 Service Manual, Bulletin 4021530 and the QSK78 Series Engine Troubleshooting and Repair Manual, Bulletin, 3666727.

- Procedure 007-021 (Lubricating Oil High Pressure Relief Valve)
- Procedure 007-029 (Lubricating Oil Pressure Regulator (Main Rifle))

- Procedure 007-031 (Lubricating Oil Pump).

Last Modified: 23-Oct-2009
