



Technical Service Bulletin

Technical Service Bulletin: TSB110149

Released Date: 12-May-2011

Rocker Lever Changes (T1106)

Rocker Lever Changes (T1106)

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document was originally released between 1994 and 2001. It has been added to QSOL for informational purposes


This document introduces changes to the QSK19/45/60 rocker levers.

To increase long-term sealing capabilities, improved sealing mechanisms were required for QSK 19/45/60 valve and injector rocker lever oil drillings. Isolated reports from the field that rivets had separated from the parent bore in the levers led to concerns that oil pressure would **not** be maintained through the speed curve if oil were allowed to drain out through the levers. There have not been no failures due to any number of rivets falling out.

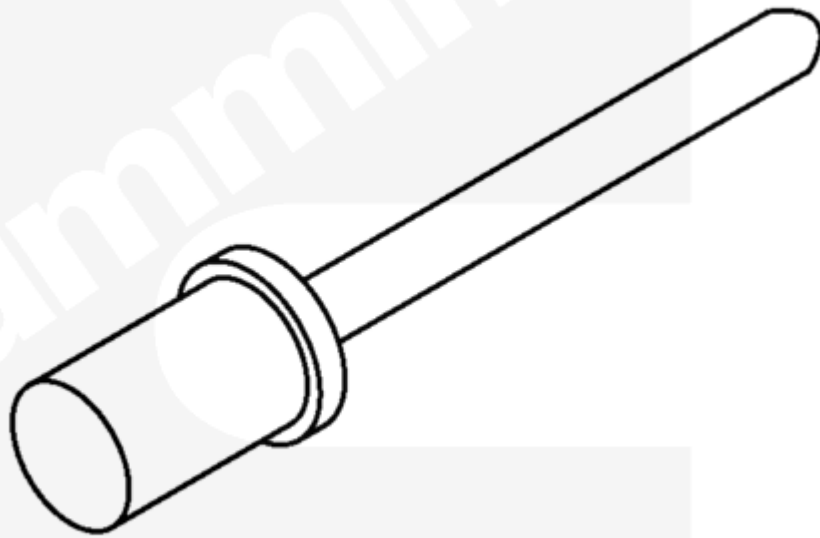

03400068


Fig. 1, Rivet

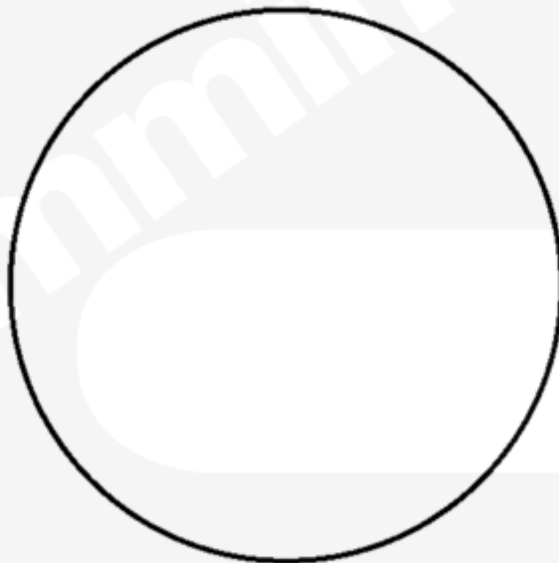

03400069

Fig. 2, Ball Plug

The intake and exhaust rocker levers have used rivets, Part Number 208084, to seal the oil drilling since the beginning of the Quantum™ program. As reports from the field came in, the rocker lever oil drilling diameter was changed in June 2000 (for the QSK19) and July 2000 (for the QSK45 and QSK60) to accept pressed-in steel balls, Part Number 3067941, as the short-term fix.

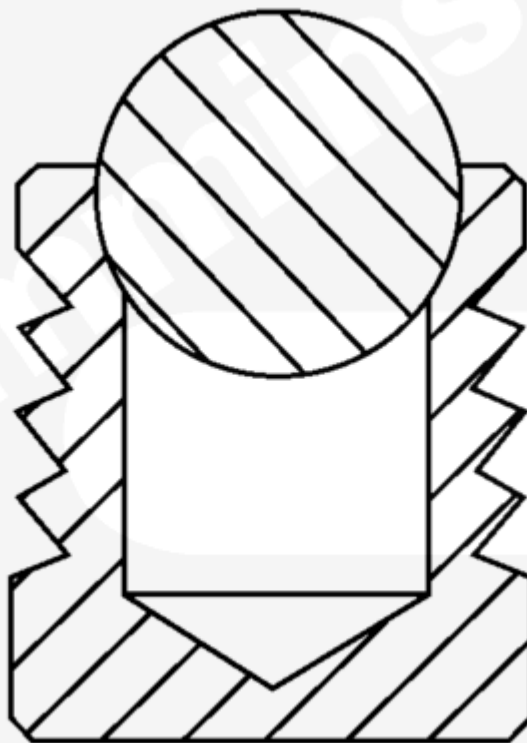

03400070

Fig. 3, Drive Plug

In November 2000 (for the QSK45 and QSK60) and January 2001 (for the QSK19), the change was made from the steel balls to a drive plug, Part Number 4065627.

The injector rocker levers have used pressed-in steel balls to seal the oil drilling since the beginning of the Quantum™ program. The move from the steel balls, Part Number 3067941, to the drive plug, Part Number 4065627, sealing mechanism was made at the same time as the intake and exhaust rocker lever changes for the QSK19.

The following table lists each rocker lever part number, along with the original (production) oil drilling sealing mechanism, approximate engine serial number range, and service sealing replacement mechanism part number. The ball plug, Part Number 3067941, should be used to replace any failed rivet or ball plug. The drive plug, Part Number 4065627, should be used to replace a failed drive plug.

Table 1, QSK19/45/60 Rocker Lever Changes

Rocker Lever	Part Number	Production Part-Oil Drilling Sealing Mechanism	QSK19 Approximate ESN Range	QSK45/60 Approximate ESN Range	Service-Sealing Replacement Part	Sealing Replacement Part Number
Intake/Exhaust	3090005/3090006	Rivet	37151256 - 37194196	3314074 - 33146310	Ball plug	3067941

Table 1, QSK19/45/60 Rocker Lever Changes

Intake/Exhaust	4065772/4065773	Ball plug	37194202 - 37196571	33146311 - 33147719	Ball plug	3067941
Intake/Exhaust	4065633/4065636	Drive plug	37196591 - Present	33147720 - Present	Drive plug	4065627
Injector	3331693	Ball plug	37151256 - 37196571	N/A	Ball plug	3067941
Injector	4065630	Drive plug	37196591 - Present	N/A	Drive plug	4065627

The parts are completely compatible and can be mixed in an engine.

Note : This is a product improvement and is not subject to a campaign.

Document History

Date	Details
2011-5-12	Module Created

Last Modified: 12-May-2011
