



# Technical Service Bulletin

Technical Service Bulletin: TSB110180

Released Date: 11-Jul-2011

New Lubrication Oil Pumps for QSK45, QSK60, QSK60 Gas, and QSK78 Engines

## New Lubrication Oil Pumps for QSK45, QSK60, QSK60 Gas, and QSK78 Engines

### Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

### Contents

This document announces new lubrication oil pumps for QSK45, QSK60, QSK60 Gas, and QSK78 engines. The idler rotors of these new pumps are manufactured with a revised heat treatment process.

| Engine Model    | Description          | New Part Number | Old Part Number |
|-----------------|----------------------|-----------------|-----------------|
| QSK45           | Lubrication Oil Pump | 3644520         | 3642280         |
| QSK60<br>QSK60G | Lubrication Oil Pump | 3644518         | 3642281         |
| QSK78           | Lubrication Oil Pump | 3644516         | 3642282         |

An additional change being introduced is the deletion of the pump outlet port sleeve (See Fig 1, item 1, Part Number 4916879). This sleeve was previously installed to match the lubrication oil pump outlet port diameter to the oil supply tube diameter. The outlet port in the pump body has been modified to be the same diameter as the oil supply tube, making the sleeve obsolete. The sleeve will remain available for service on the old part number pumps.

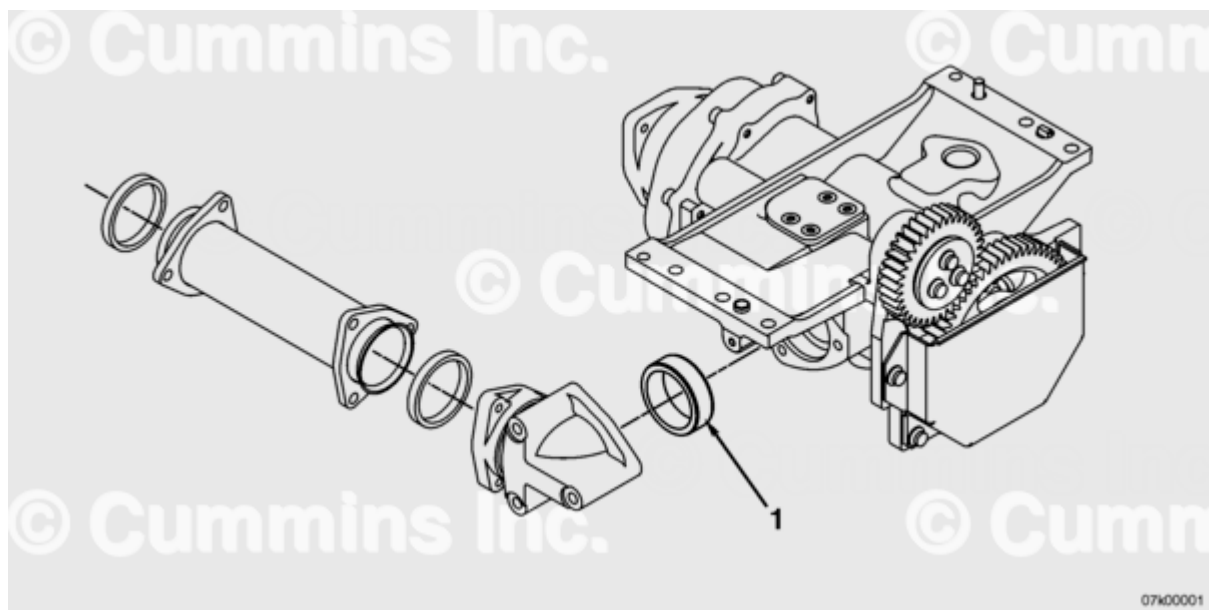


Figure 1

1. Lubrication Oil Pump Outlet Port Sleeve.

These new lubrication oil pumps have been introduced into production at Daventry as follows:

| Engine Model    | Engine Serial Number (ESN) | Production Date |
|-----------------|----------------------------|-----------------|
| QSK45           | 33187280                   | 06-Jun-2011     |
| QSK60<br>QSK60G | 33187380                   | 13-Jul-2011     |
| QSK78           | 66301815                   | 24-Jun-2011     |

## Document History

| Date      | Details                                                                                      |
|-----------|----------------------------------------------------------------------------------------------|
| 2011-6-14 | Module Created                                                                               |
| 2011-7-11 | QSOL Quick Fix Reason: Incorrect Part Number Notes: Engine serial number was left out by OE. |

Last Modified: 11-Jul-2011