



Technical Service Bulletin: TSB150067

Released Date: 18-May-2016

Change of Turbocharger Oil Supply Line and Routing

Change of Turbocharger Oil Supply Line and Routing

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK60 CM850 MCRS (2 Stage Versions)
- QSK60 CM2150 MCRS (2 Stage Versions)

Description of Change

This document announces a change to the turbocharger oil supply line routing and turbocharger coolant hose routing. The revised turbocharger oil supply line and turbocharger coolant hose use additional hardware.

Reason for Change

Improved clearance of the turbocharger oil supply line and turbocharger coolant hose from surrounding components.


Customer Communication

This product improvement is recommended for both banks of the engine.

Service Instructions

See Figure 1 and 2 for left bank installation. See Figure 3 and 4 for right bank installation.


All capscrews **must** be tightened to 45 Nm [33 ft-lb].

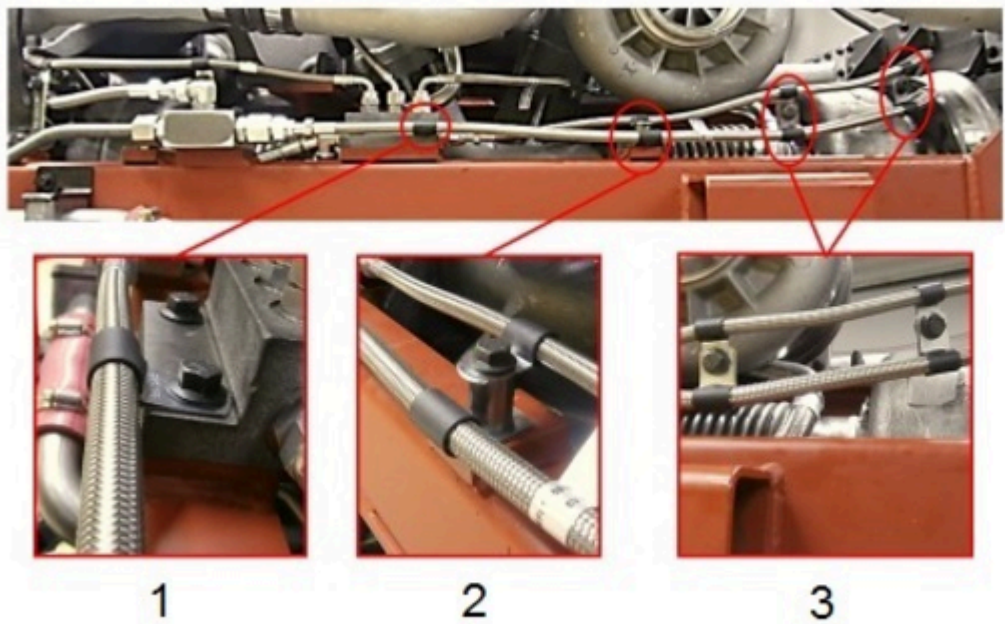


10r00115

Figure 1, Left Bank

Table 1, Figure 1 Callouts			
Callout	Quantity	Part Number	Part Description
1	1	68152B	Clip
2	1	68152B	Clip
	1	3629452	Clip
	1	3889232	Screw
	1	64709	Spacer
3	2	68152B	Clip
	2	3629452	Clip
	2	3903990	Screw
	2	3093828	Nut

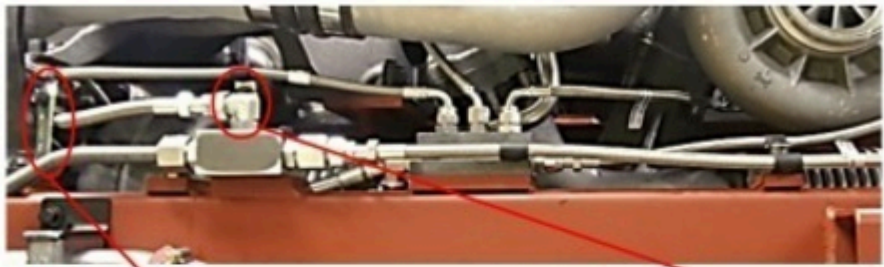

4

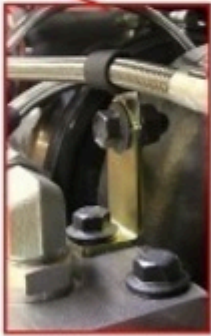

5

10r00116

Figure 2, Left Bank

Table 2, Figure 2 Callouts

Callout	Quantity	Part Number	Part Description
4	1	3629452	Clip
	1	68152B	Clip
	1	3903990	Screw
	1	3093828	Nut
	1	3628554	Brace
	1	3043477	Washer
5	1	3629452	Clip
	1	3903990	Screw
	1	3093828	Nut
	1	3628585	Brace

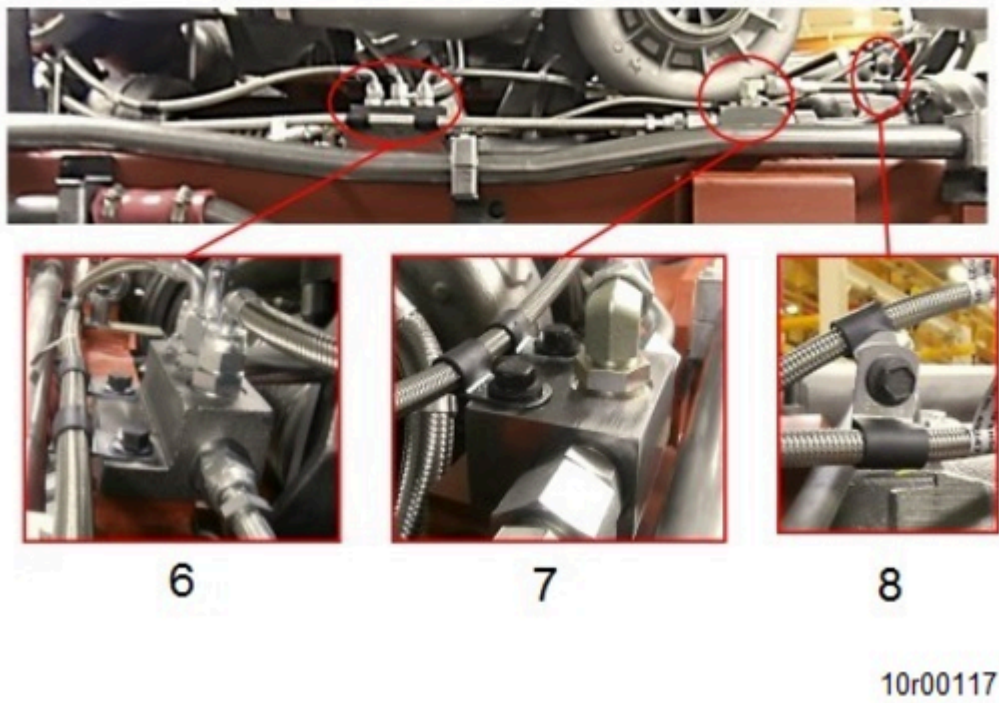


Figure 3, Right Bank

Table 3, Figure 3 Callouts			
Callout	Quantity	Part Number	Part Description
6	2	68152B	Clip
7	2	3629452	Clip
8	1	68152B	Clip
	1	3629452	Clip
	1	3903990	Screw
	1	3093828	Nut

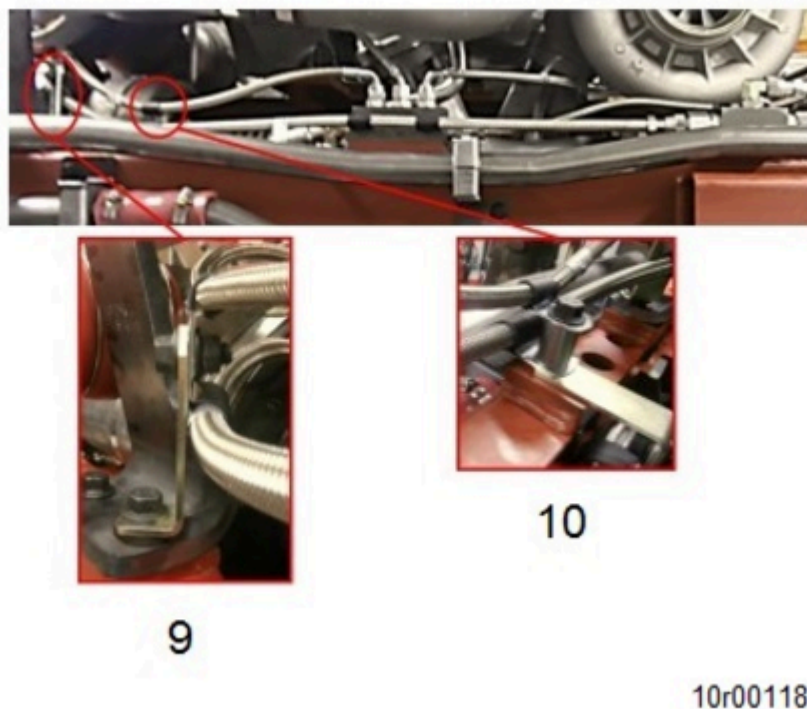


Figure 4, Right Bank

Table 4, Figure 4 Callouts

Callout	Quantity	Part Number	Part Description
9	1	3629452	Clip
	1	68152B	Clip
	1	3903990	Screw
	1	3093828	Nut
	1	3628554	Brace
	1	3043477	Washer
10	1	68152B	Clip
	1	3629452	Clip
	1	3889232	Screw
	1	64709	Spacer

Service Parts Availability

Table 5 outlines all of the parts needed to upfit to the revised turbocharger oil supply line routing and turbocharger coolant hose routing.

Table 5, Upfit Parts

Part Description	Part Number	Increased Quantity Per Engine	Quantity Per Engine
Spacer, Mounting	64709	1	2

Table 5, Upfit Parts			
Part Description	Part Number	Increased Quantity Per Engine	Quantity Per Engine
Spacer, Mounting	66747		2
O ring	216187		8
Washer, plain	3043477	2	2
Hex flange head capscrew	3089232	2	2
Gasket connection	3089955		8
Union, Male	3090400	2	14
Nut Hex Flange	3093828	2	6
Hex flange head capscrew	3093957		12
Union, Male	3171818		2
Union, Male	3171830		2
Nut, Tube	3331855		2
Elbow, Male union	3331872		2
Reducer, tube fitting	3331881		2
Hose, Flexible	3411021		2
Hose, Flexible	3411023		2
Elbow, Male union	3411129		2
Brace, Tube	3628553	2	2
Brace, Tube	3628554		6
Brace, Tube	3628585		1
Clip	3629451	5	10
Clip	3629452		10
Tube, lube oil transfer	3636390		1
Tube, lube oil transfer	3636392		1
Hose, Flexible	3636394		1
Hose, Flexible	3636395		1
Hex flange head capscrew	3900635		2
Hex flange head capscrew	3900637		2
Hex flange head capscrew	3902460		16
Nut Hex Flange	3902662		10

Table 5, Upfit Parts			
Part Description	Part Number	Increased Quantity Per Engine	Quantity Per Engine
Hex flange head capscrew	3903112		4
Hex flange head capscrew	3903464		3
Hex flange head capscrew	3903990	5	12
Connection, oil Manifold	4017512		2
Hose, Flexible	4917836		2
Hose, Flexible	4917837		2
Clip	4917840		4
Clip	68152B		9
Hose, Flexible	4917843		2
Hose, Flexible	4917844		2
Hose, Flexible	4927591		2
Hose, Flexible	4927615		2

Production Status

Implemented for production. See Table 6.

Table 6, Production Information		
ESN First	Build Date ¹	Plant
33200181	Not Available	Daventry Engine Plant
¹ Engine build date can be found on the engine dataplate.		

Associated Publications

For turbocharger oil supply line installation, use the following procedure in QSK45 and QSK60 Service Manual, Bulletin 4021530. Refer to Procedure 010-046 in Section 10.

(/qs3/pubsys2/xml/en/procedures/56/56-010-046-tr.html)

For turbocharger coolant hose installation, use the following procedure in QSK45 and QSK60 Service Manual, Bulletin 4021530. Refer to Procedure 010-041 in Section 10.

(/qs3/pubsys2/xml/en/procedures/56/56-010-041.html)

Document History

Date	Details
2015-5-11	Module Created
2016-5-9	Part number 681528 corrected to 68152B.

Last Modified: 18-May-2016
