



Technical Service Bulletin: TSB160095

Released Date: 08-Oct-2018

New Exhaust Gas Temperature Sensor and Injector Quadrant Wiring Harness and Mounting Bracket

New Exhaust Gas Temperature Sensor and Injector Quadrant Wiring Harness and Mounting Bracket

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK60 CM850 MCRS
- QSK60 CM2150 MCRS

Issue

Symptom:

- Injector and/or exhaust gas temperature sensor Fault Codes: 1535, 1529, 2125, 2131, 623, 1117, 621, 628, 2137, 2134, 1532
- Physical engine wiring harness damage; engine wiring harness damage can be observed at the connections to either the main engine wiring harness or at the injector and exhaust gas temperature sensor wiring harness connections.

Root Cause:

- The engine wiring harness is incorrectly contacting the cylinder block, cylinder head, camshaft cover, or aftercooler housings.

Verification

- Inspect exhaust gas temperature sensor and injector wiring harness and connectors for physical damage or a loose connection and use INSITE™ electronic service tool to check for fault codes listed above.

Resolution

- A new engine wiring harness and bracket assembly including the new exhaust gas temperature sensor and injector wiring harness, and new cylinder head mounting bracket has been released.

- The new components reduce the likelihood of the wiring harness connectors coming loose during operation and reroute the wiring harness to prevent wiring harness fretting caused by incorrect contact with the cylinder block, cylinder head, camshaft cover, or aftercooler housing.

Service Instructions

Installation instructions are available. See Installation Instruction, New Exhaust Gas Temperature Sensor and Injector Quadrant Wiring Harness and Mounting Bracket Installation Instructions, Bulletin 5414606.

Service Parts Availability

Service parts are available. See Table 1.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Harness, Engine Control Module Wiring Left Bank	4382041	Yes	Yes	5373047
Harness, Engine Control Module Wiring Right Bank	4382042	Yes	Yes	5373048

Part Compatibility

The new part numbers can be mixed with existing part numbers, but Cummins Inc. recommends all engine quadrants have the new part numbers installed if a malfunction of one engine quadrant is experienced.

Part Identification

The new wiring harness incorporates a mounting bracket that spans two cylinder heads. Each wiring harness consists of two mounting brackets in total, covering four cylinder heads. See Figure 1 below.

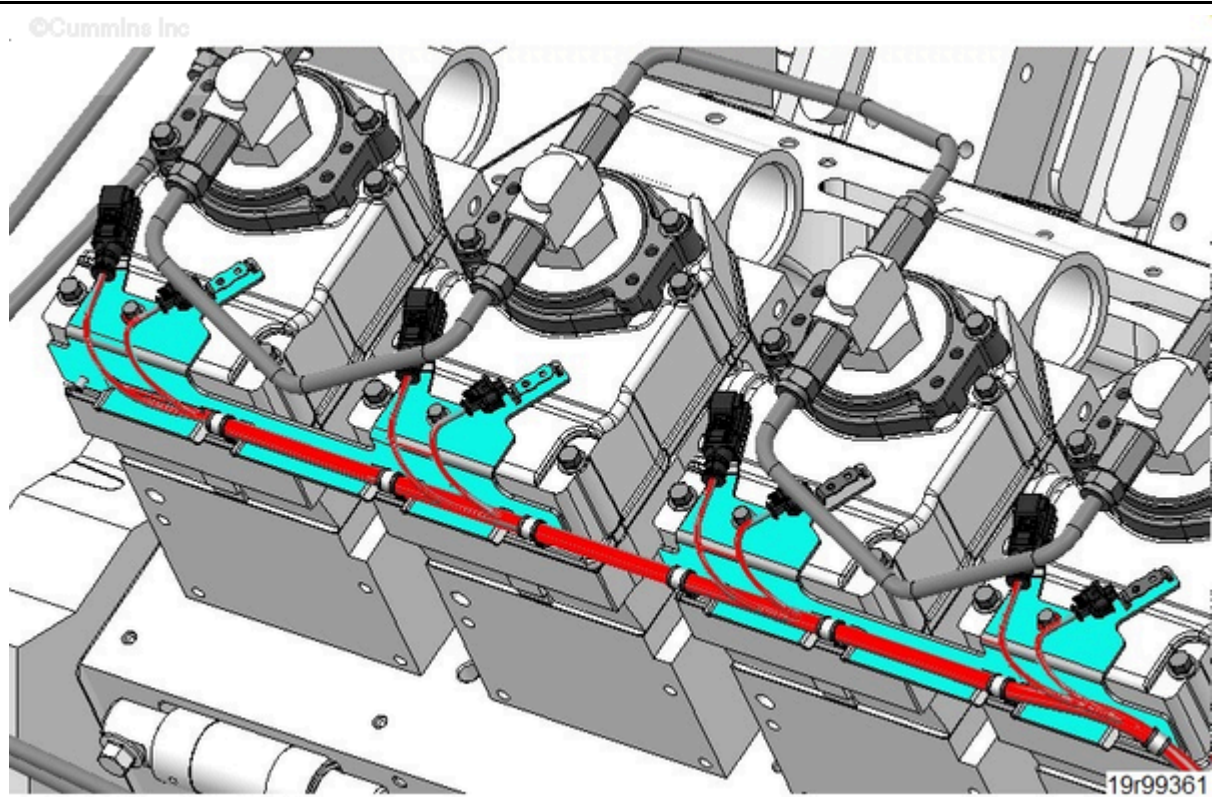


Figure 1, New Exhaust Gas Temperature Sensor and Injector Wiring Harness with Mounting Brackets.

Production Status

Implemented for production. See Table 2.

Table 2, Production Information

ESN First	Build Date ¹	Plant
33207728	5 July 16	Daventry Engine Plant

¹Engine build date can be found on the engine dataplate.

Document History

Date	Details
2016-9-2	Module Created
2017-3-23	Quick Fix application:
2017-8-24	Removed hyperlink for Bulletin 5414606.
2018-10-5	Updated Table 1.

