



Technical Service Bulletin: TSB190158

Released Date: 24-Sep-2019

Engine Cooling Fan Will Not Disengage: New Rockford Fan Clutch Solenoid

Engine Cooling Fan Will Not Disengage: New Rockford Fan Clutch Solenoid

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK45 CM500
- QSK60 CM500
- QSK60 CM850
- QSK60 CM2150
- QSK60 CM2350 K116
- QSK60 CM2350 K121
- QSK60 CM2350 K135
- QSK60 CM2350 K136

Issue

Symptom:

- Engine fan will **not** disengage
- Engine coolant temperature low

Root Cause:

- Rockford fan clutch solenoids malfunctioning caused by fan clutch solenoid coils burning out

Verification

- If measured resistance of fan clutch solenoid is less than 45 ohms, the fan clutch solenoid has malfunctioned.

Resolution

- A new rotated fan clutch solenoid part number has been released. The new fan clutch solenoid is mounted 180 degrees from the existing position, see Figures 1 and 2 below. See Table 1 below for part number.

- A new fan clutch solenoid mounting plate part number has been released to enable the rotated fan clutch solenoid to be mounted in the same location. See Table 1 below for part number.
- The new fan clutch new solenoid has the control and sump ports flipped compared to the existing fan clutch solenoid, so the flexible hoses do **not** need to be changed and remain on the same side when the fan clutch solenoid is rotated 180 degrees.
- The top right capscrew has also been changed. See Figure 3 below. Due to the removal of the need for the P-clip in this location, a shorter capscrew is now used in this location, and the washer removed; to avoid the capscrew bottoming out.
- For QSK60 CM500 engines **only**, a new p-clips are used to hold the fuel hose that runs underneath the fan clutch solenoid, see Figure 3 below.

Part Identification

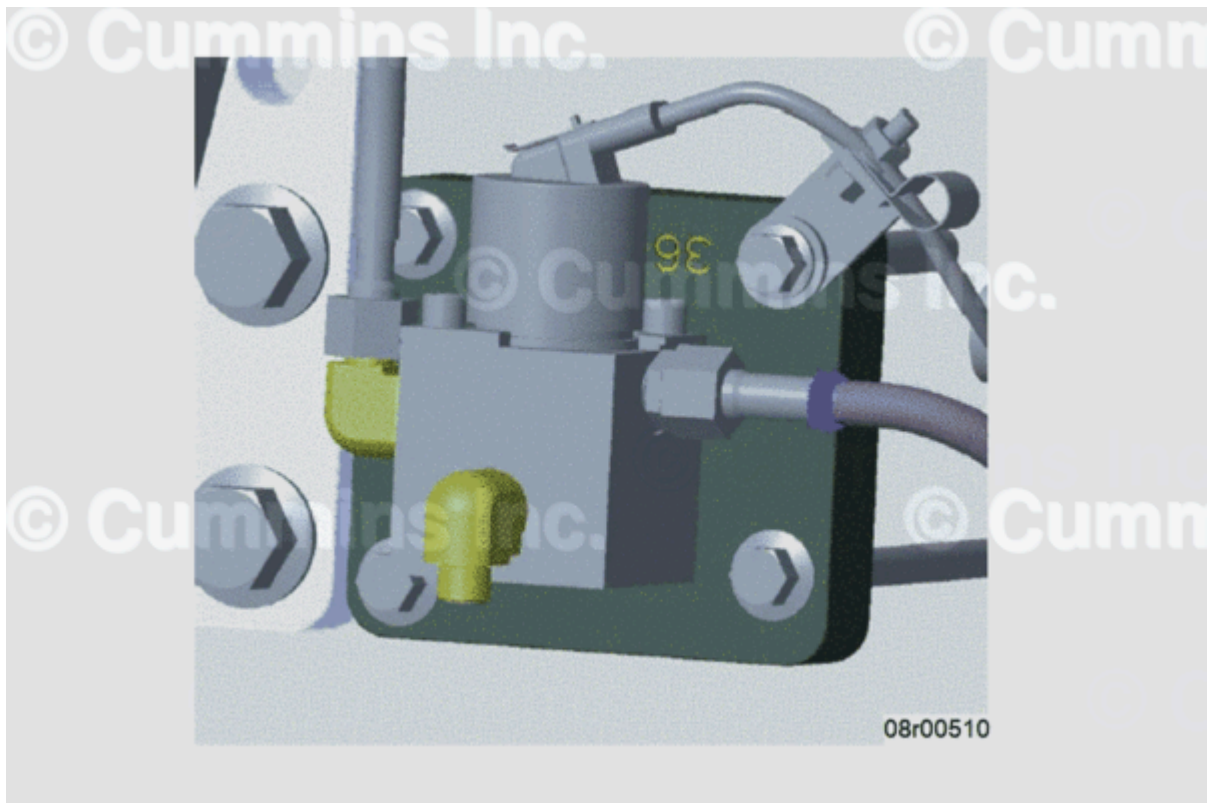


Figure 1, Existing Rockford Fan Clutch Solenoid.

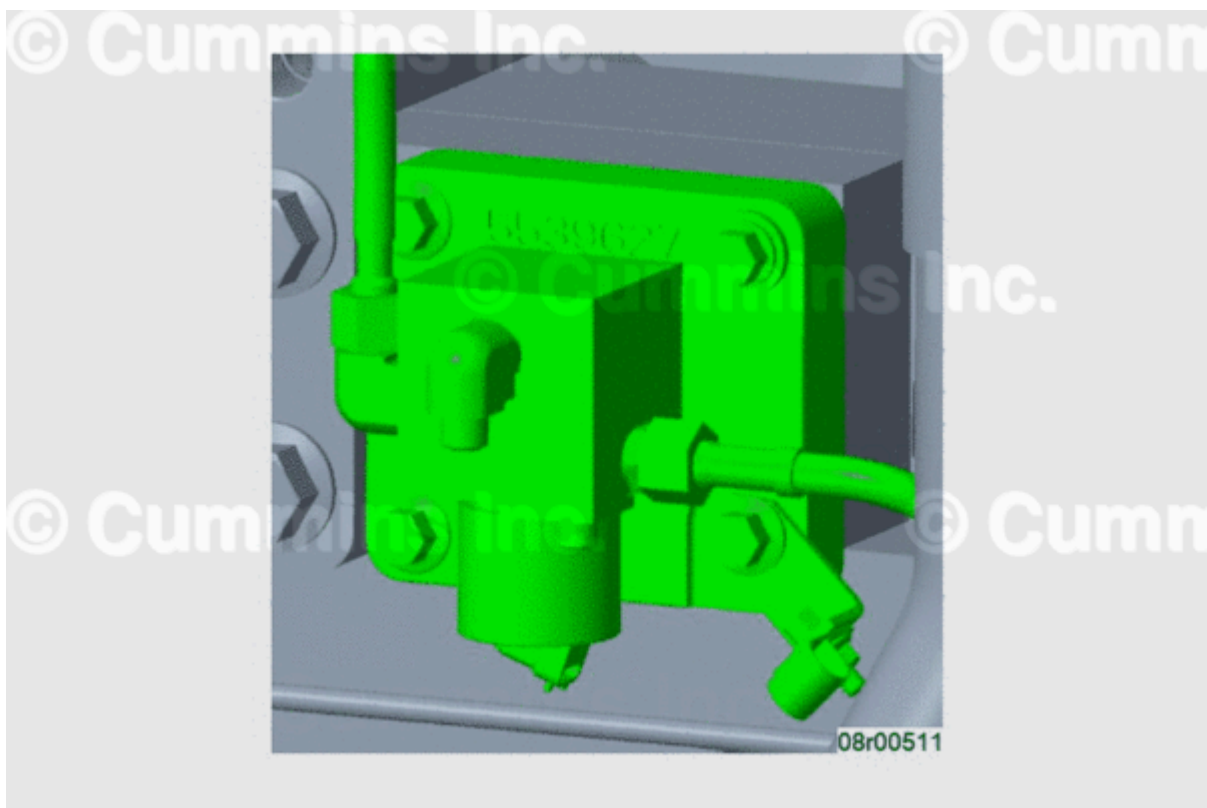


Figure 2, New Rockford Fan Clutch Solenoid.

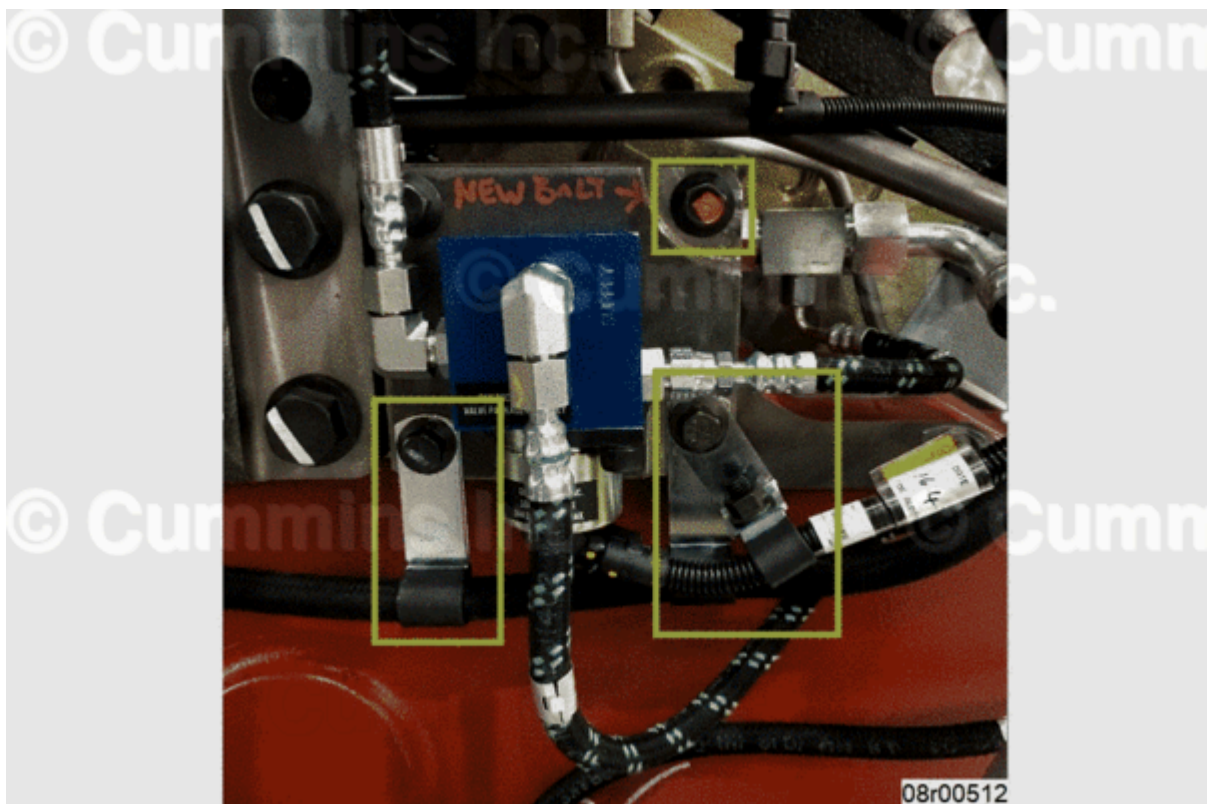


Figure 3, Location of New P-Clip and Shortened Capscrew.

Service Parts Availability

Service parts are available. See Table below 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Solenoid	3648606	No	No	5539600
Spacer, Mounting	4086160	No	No	5539627
Screw, Hex Head	-	-	-	3680437
P-Clip (QSK60 CM500 Only)	-	-	-	5539713
Part Inventory Action Use existing part number inventory before using new part number. Part Compatibility The rotated fan clutch solenoid must be used with the new mounting spacer.				

Document History

Date	Details
2019-9-9	Module Created