



Technical Service Bulletin

Technical Service Bulletin: TSB220008

Released Date: 14-Jan-2022

New Exhaust Muffler Bracket

New Exhaust Muffler Bracket

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK60 CM2150 MCRS

Description of Change

A new exhaust muffler bracket with a cutout for increased clearance for turbocharger oil drain line is now available.

Reason for Change

There is interference between the turbocharger support bracket and the turbocharger oil drain line. This contact can lead to fretting damage to the turbocharger oil drain line tubing.

Service Instructions

- Order existing or new part number to resolve clearance issues. All existing part number stock has been re-worked to match new part number and can still be used.
- If installing the new exhaust muffler bracket and a thicker spacer has been added to the turbocharger oil drain line at the turbocharger connecting joint, this can be removed and restored to the original factory design using correct cap screws and new gaskets.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Turbocharger Support Bracket	3641080	Yes	Yes	5542739

Part Identification

New part can be identified by part number stamping on the component and by the cutout as shown in Figure 2 below.



Figure 1, Existing Part Number 3641080.

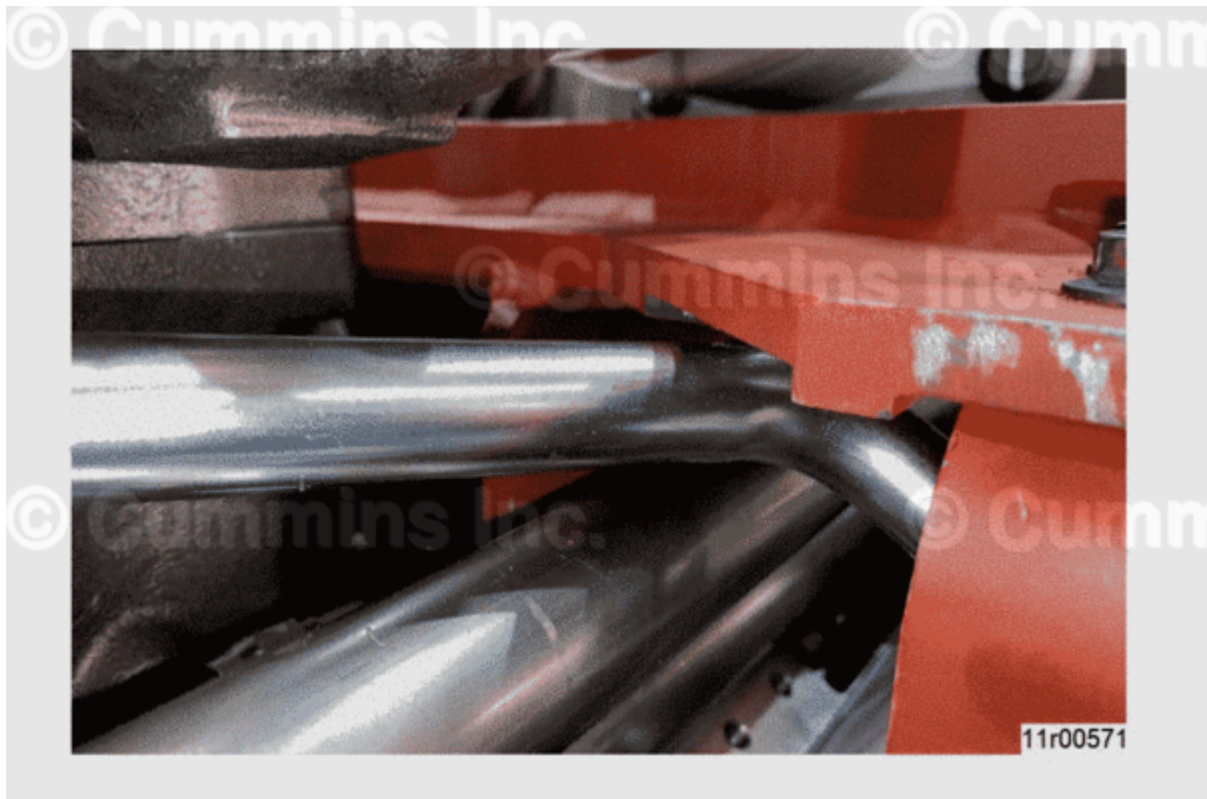


Figure 2, New Part Number 5542739.

Part Inventory Action

Use existing part number inventory before using the new part number.

Production Status

Implemented for production. See Table 2.

Table 2, Production Information

ESN Last	Build Date ¹	Plant
33226335	5 October 2021	Daventry

--

Document History

Date	Details
2022-1-13	Module Created