



Technical Service Bulletin

Technical Service Bulletin: TSB220146

Released Date: 19-Jul-2022

New Fuel Pump Oil Supply Line

New Fuel Pump Oil Supply Line

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK60 CM2150 MCRS
- QSK60 CM850 MCRS

Description of Change

A new oil supply line has been developed for the modular common rail system fuel pump. The new oil supply line increases the oil pressure available to the fuel pump and improves the reliability and component life.

Reason for Change

There have been reports of fuel pump fault codes relating to low oil and fuel pressure. To improve reliability, a new oil supply line has been released that increases the pressure of oil available to the fuel pump by feeding oil directly from the main oil rifle to the fuel pump accessory drive.

Service Instructions

- Installation and removal instructions have been added to the Service Manual. See Publications Affected section below for details.
- These parts are **only** compatible with engines manufactured after 02 October 2020 or are utilizing a new cylinder block. See Part Compatibility section below.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number	Quantity required	Figure 1 Item Number
Pressure Sensor	-	No	No	2872883	1	1

Table 1, Service Parts						
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number	Quantity required	Figure 1 Item Number
Screw, Hexagon Head	-	No	No	3087279	2	2
Screw, Hexagon Head	-	No	No	3093923	2	3
O-Ring Seal	-	No	No	3328463	2	4
Union	-	No	No	3331873	2	5
Retaining clamp	-	No	No	3636638	2	6
Tube Clamp	-	No	No	3647803	4	7
Threaded Plug	-	No	No	3678921	1	8
Screw, Hexagon Head	-	No	No	3900630	2	9
Screw, Hexagon Head	-	No	No	3900632	2	10
Screw, Hexagon Head	-	No	No	3902460	1	11
Screw. Hexagon Head	-	No	No	3916069	3	12
Dedicated Lubrication Filter	-	No	No	4323856	1	14
Oil Pressure Switch	-	No	No	4924925	1	15
Elbow Union	-	No	No	4967227	1	16
Lubricating Oil Tube	-	No	No	5539844	1	17

Table 1, Service Parts						
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number	Quantity required	Figure 1 Item Number
Mounting Bracket	-	No	No	5539846	2	18
Wiring Harness	-	No	No	5542339	1	19
Lubricating Filter Head	-	No	No	5544805	1	20

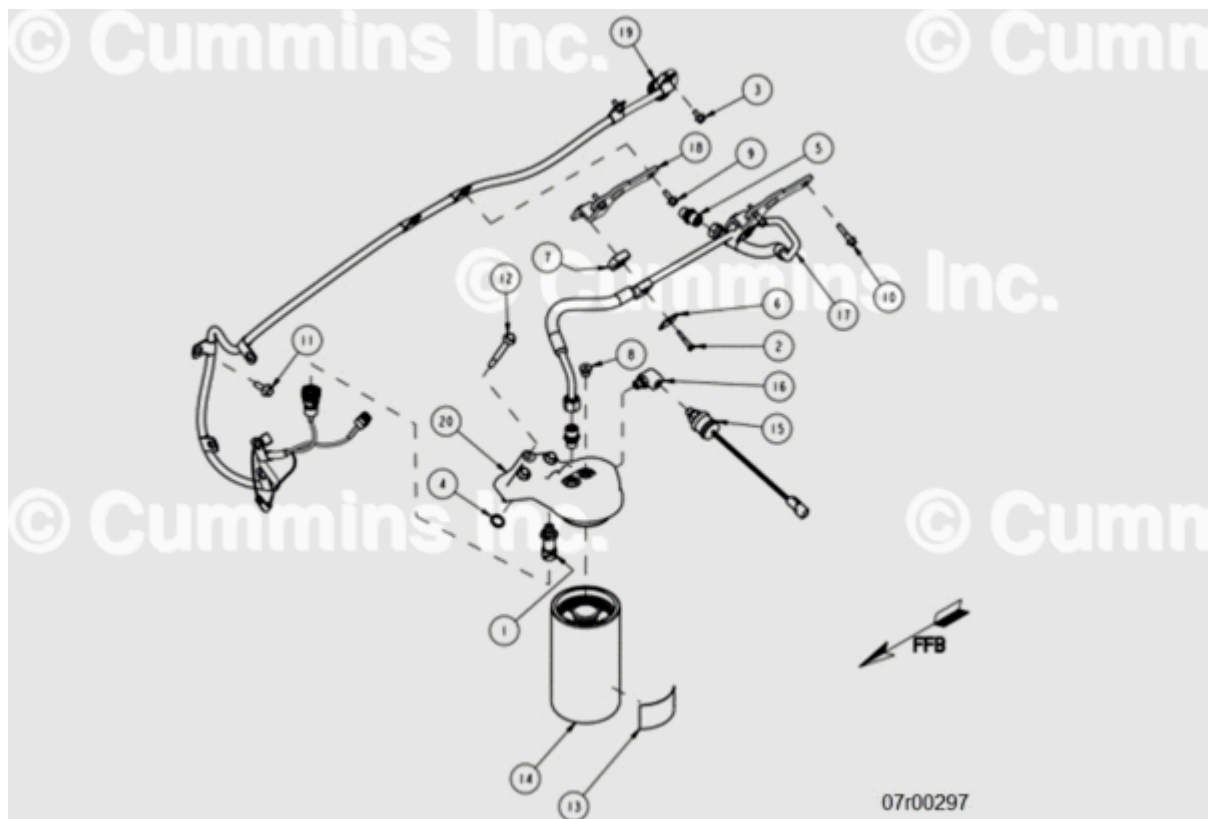


Figure 1, New Oil Supply Line Kit Parts Breakdown.

Part Compatibility

- The oil supply line kit is available on construction application engines built in Daventry. The oil supply line kit can **only** be installed on engines operating in the field if they are using a new cylinder block or were built after 02 October 2020. Following this date, a new cylinder block was introduced with the correct drilling utilized by the new oil pressure supply line. See Technical Service Bulletin, New Cylinder Block to Reduce MCRS Fuel Pump Malfunction, TSB210009.
- If the engine was built before 02 October 2020 and utilizes an existing cylinder block, there is an alternative supply line available that uses oil from the flywheel housing of the engine. See

Technical Service Bulletin, New Fuel Pump Oil Supply Line: Flywheel Supplied, TSB220042 for details.

Part Identification

The new cylinder block supplied oil supply line can be identified by the supply point being a main oil rifle connection. See Figure 2 below.

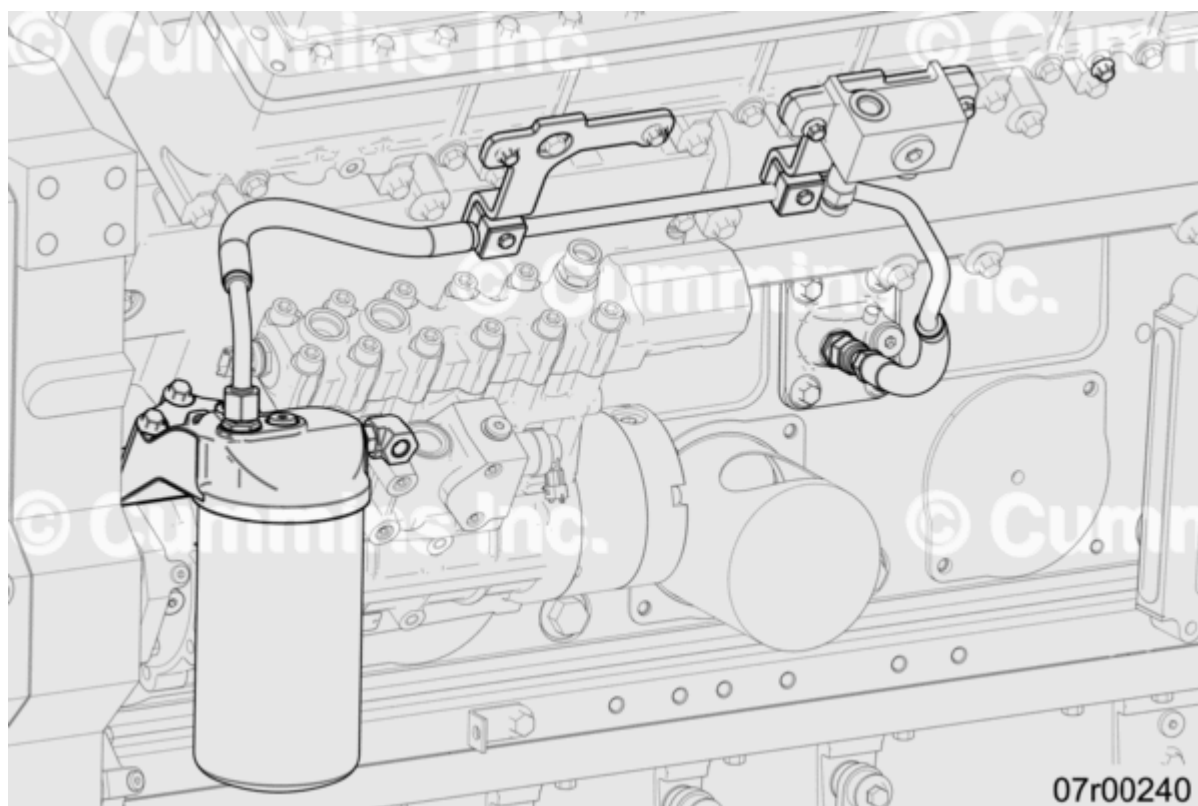


Figure 2, New Cylinder Block Supplied Oil Supply Line.

Production Status

Implemented for production. See Table 2.

Table 2, Production Information

ESN First	Build Date ¹	Plant
33226913	6 December 2021	Daventry

Publications Affected

Table 3, Publications Affected					
Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Service Manual	QSK60 CM2150 MCRS	4021530	Fuel Pump Drive Lubricating Oil Supply Line	Refer to Procedure 007-112 (/qs3/pubsys2/xml/en/procedures/56/56-007-112.html)	7

Document History

Date	Details
2022-7-14	Module Created