



Technical Service Bulletin

Technical Service Bulletin: TSB230007

Released Date: 20-Aug-2025

New Fuel Pump Accessory Drive and Electronic Chip Detector

New Fuel Pump Accessory Drive and Electronic Chip Detector

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK60 CM2150
- QSK60 CM2350 K116
- QSK60 CM2350 K117
- QSK60 CM2350 K121
- QSK60 CM2350 K135
- QSK60 CM2350 K136

Description of Change

- A new fuel pump accessory drive has been released.
- The new fuel pump accessory drive introduces an electronic chip detector in the fuel pump oil drain path to identify any metallic debris being created by a failing fuel pump.
- In the event metallic debris is detected by the electronic chip detector a signal will be sent to the engine control module (ECM) to take appropriate action to protect the engine and fuel pump.

Reason for Change

- Malfunctions of modular common rail system fuel pumps have been reported. The root cause of malfunction has been identified as debris in the fuel pump.
- The electronic chip detector system will detect metallic debris and flakes being generated by the fuel pump. The electronic chip detector system was designed as an early warning of fuel pump failure, minimizing the chance of other engine components becoming affected by the metallic flakes entering the engine lubricating oil system.

Service Instructions

To effectively utilize this new fuel pump accessory drive, the electronic chip detector **must** be connected to the engine wiring harness. Follow the installation instructions below.

Installation Instructions:

- Connect extension harness, Part number 5542339, to left bank main engine wiring harness as shown in Figure 1.
- Install two P clips as shown in Figure 1.

Torque Value: 33 n·m [24 ft-lb]

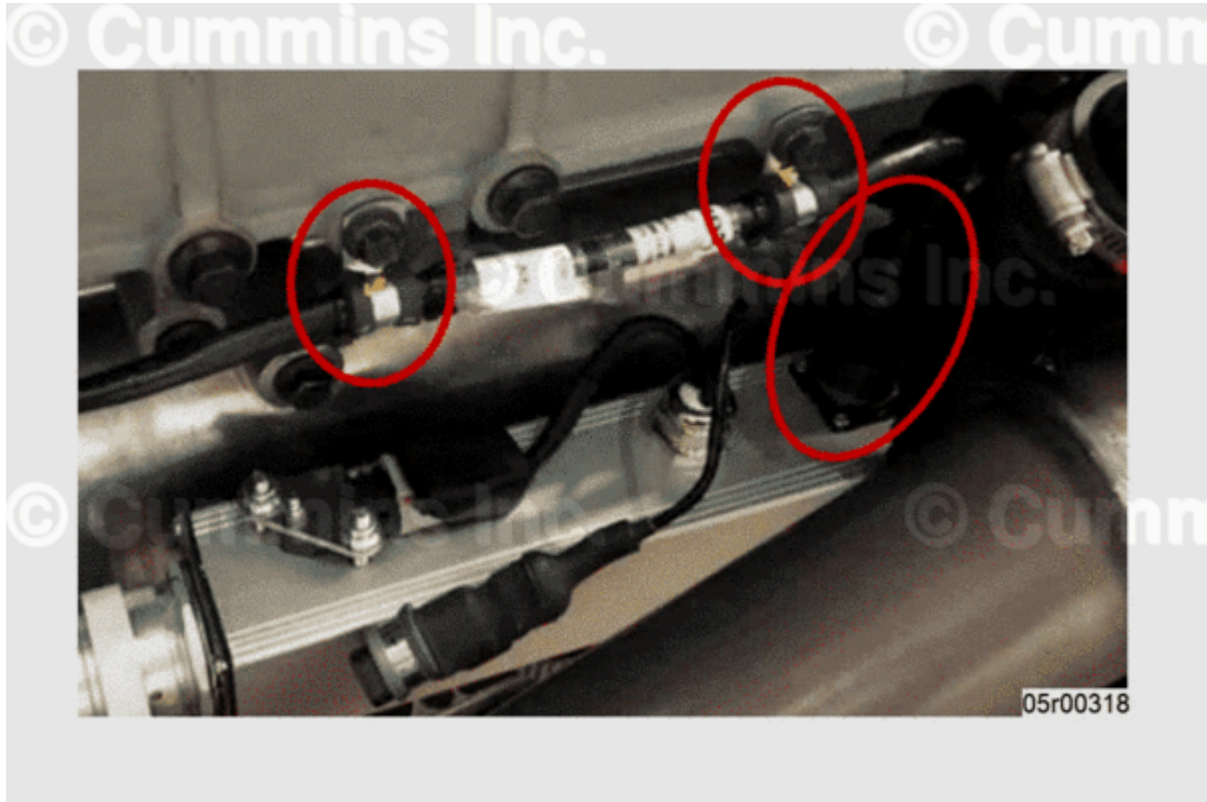


Figure 1, Wiring Harness Connection and P-clip Locations.

- Install two P-clips to aftercooler in an inboard orientation as shown in Figure 2.

Torque Value: 45 n·m [33 ft-lb]



Figure 2, P-clip Locations on Aftercooler.

- Install one P-clip to bottom aftercooler bolt as shown in Figure 3.

Torque Value: 45 n·m [33 ft-lb]



Figure 3, P-clip Location on Aftercooler.

- Install two P-clips to the fuel pump accessory drive as shown in Figure 4.

Torque Value: 45 n•m [33 ft-lb]

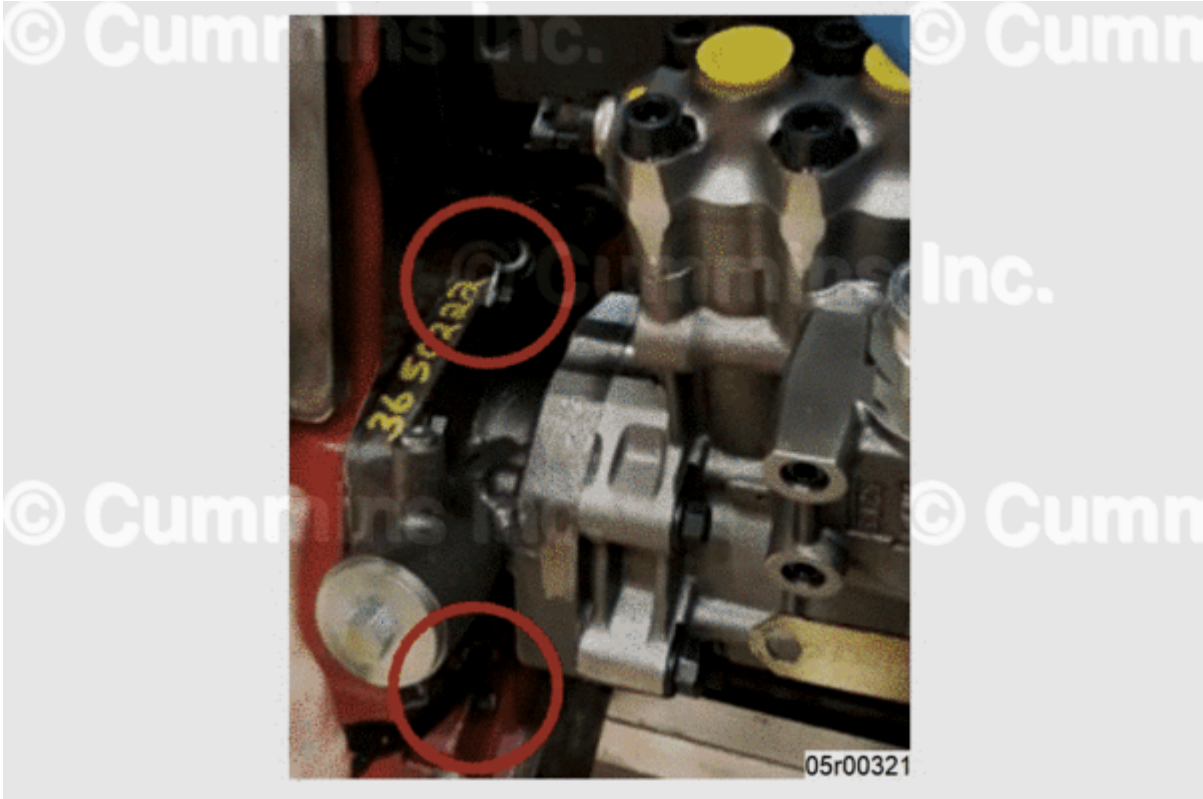


Figure 4, P-clip Location on Fuel Pump Accessory Drive.

- Connect wiring harness to electronic chip detector.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Accessory drive	5417132	Yes	Yes	5541365
Electronic Chip Detector	-	No	No	6372680
Extension Harness	-	No	No	5542339

Part Compatibility

- If the engine is equipped with existing thermistor style exhaust gas temperature sensors, the existing thermistor style exhaust gas temperature sensors **must** be replaced with thermocouple style exhaust gas temperature sensors. Reference TSB210002 for details.
- To utilize this electronic chip detector a change of main engine wiring harnesses is required to part numbers mentioned in TSB210002. This is required as prior part numbers do **not** contain the connection required for the electronic chip detector.

Part Identification

Parts can be identified by part number stamped on the fuel pump accessory drive and electronic chip detector. The extension wiring harness contains a tag with the part number.

Production Status

Implemented for production. See Table 2.

Table 2, Production Information		
ESN First	Build Date ¹	Plant
33230337	14 November 2022	Daventry

Document History

Date	Details
2023-1-4	Module Created
2023-1-31	Updated Part Compatibility section.
2025-8-20	Updated Reason for Change as per Salesforce ticket.