



Technical Service Bulletin: TSB240007

Released Date: 17-Dec-2024

Camshaft Thrust Plate Installation

Camshaft Thrust Plate Installation

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK45 CM500 (All Versions)
- QSK60 CM500 (All Versions)
- QSK60 CM850 (All Versions)
- QSK60 CM2150 (All Versions)
- QSK60 CM2350 (All Versions)
- QSK78 CM500 (All Versions)
- QSK78 CM2350 (All Versions)

Issue

Washer listed in Table 1 and Item B within Figure 1 **must** be used with the existing capscrews, and in the specified orientation, when installing new camshaft thrust plates.

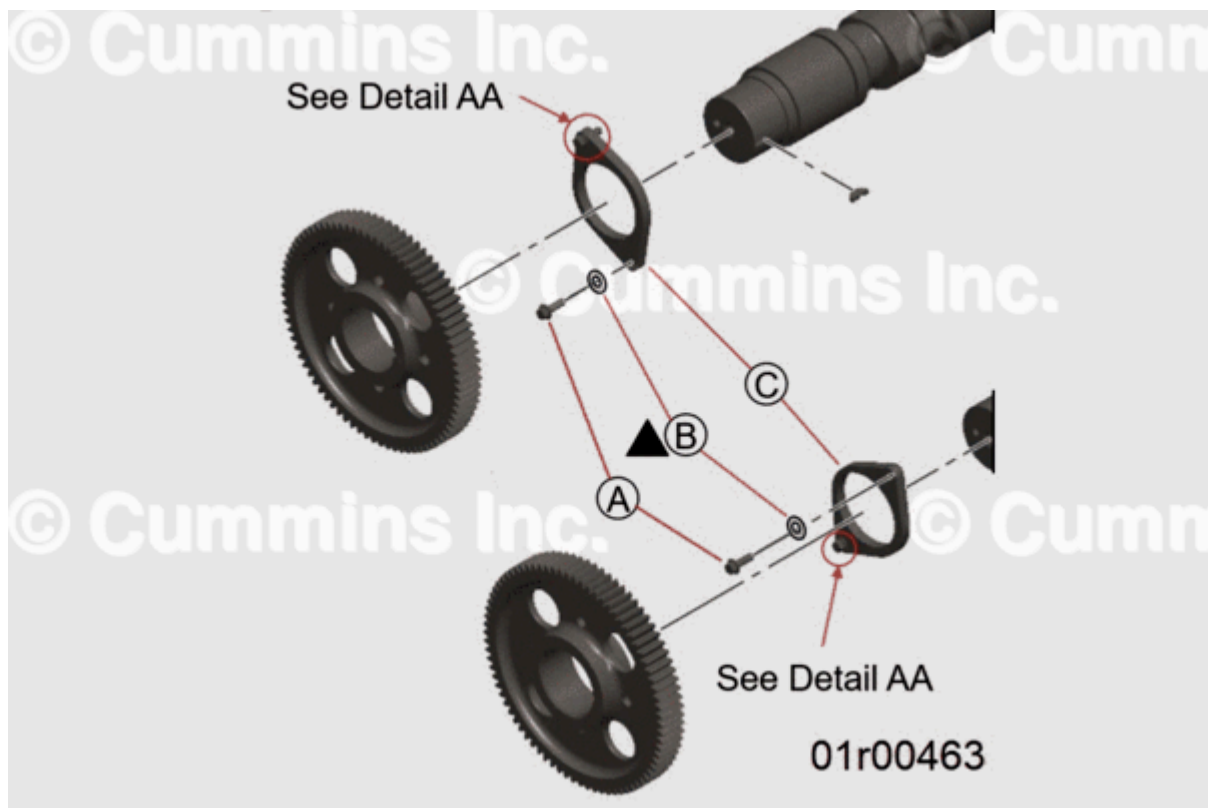


Figure 1, Factory Step 3 Exploded Diagram.

Reason for Change

Factory step 3 action has been implemented to address under head embedment of the bolts in the camshaft thrust plate material. Installation of the washers should be targeted in a fix as fail situation or at a scheduled rebuild interval.

Service Instructions

- The washer orientation is critical.
- There are two different faces to the washer; see Figure 2.
 - The pressed face edges will appear radiused or rounded in appearance.
 - The burr face edges will appear squarer in appearance.
- The burr face **must** be facing the camshaft thrust bearing plate during installation. Testing showed that incorrect orientation of the washer will result in a poor joint and embedment of a different form in the camshaft thrust plate material.

Table A, Accompanies Figures 1 and 2

Item	Quantity	Additional Part Number	Description
A	4	EXISTING	CAPSCREW
B	4	3176133	WASHER
C	2	EXISTING	CAMSHAFT THRUST BEARING

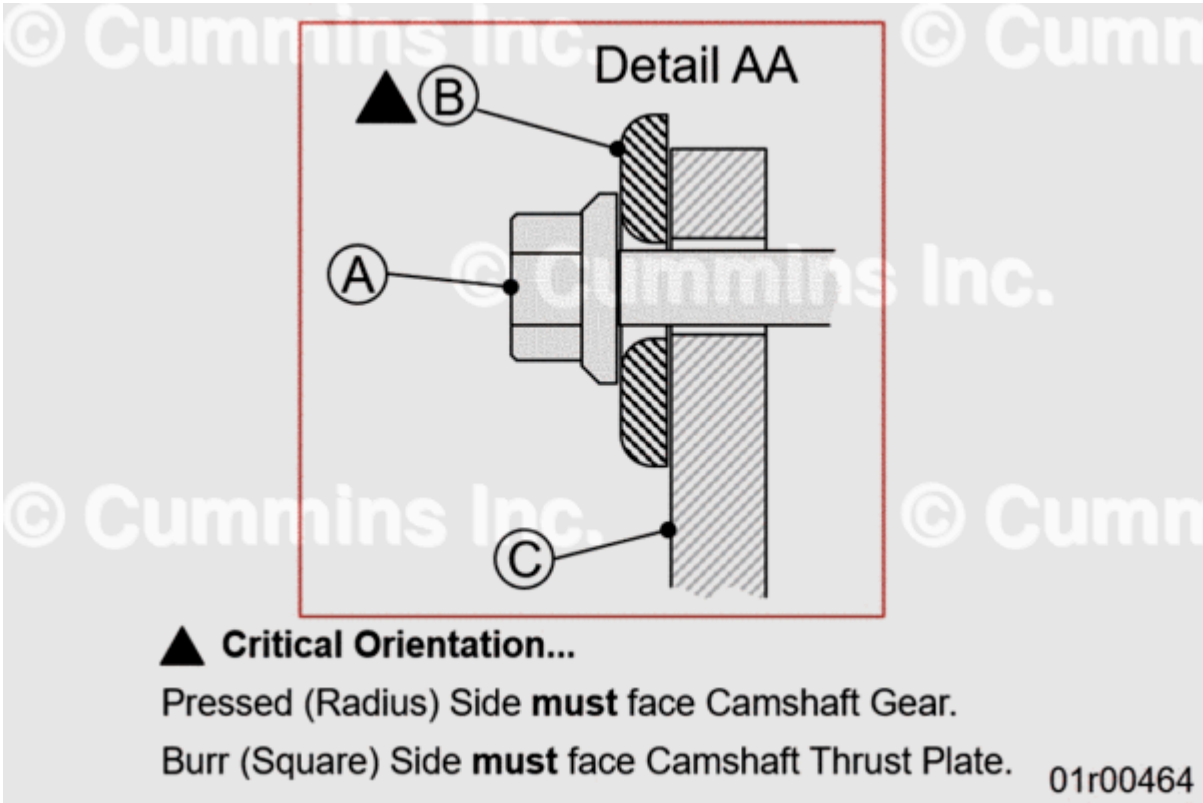


Figure 2, Detail AA Showing Correct Washer Orientation at Installation.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
WASHER	3176133	-	-	-

Production Status

Implemented for production. See Table 2.

Table 2, Production Information

ESN First	Build Date ¹	Plant
33234693	12 January 2024	Daventry
66307268	16 January 2024	Daventry

¹Engine build date can be found on the engine dataplate.

Document History

Date	Details
2024-1-5	Module Created
2024-12-17	Product Problem Solving (PPS) Step 3 Action

Last Modified: 17-Dec-2024
