



Technical Service Bulletin

Technical Service Bulletin: tsb100166

Released Date: 19-Jun-2002

New Cam Follower Shaft Dowel Rings

New Cam Follower Shaft Dowel Rings


Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin introduces a new ring dowel for the cam follower assemblies of the QST30 engine.

©Cummins Inc

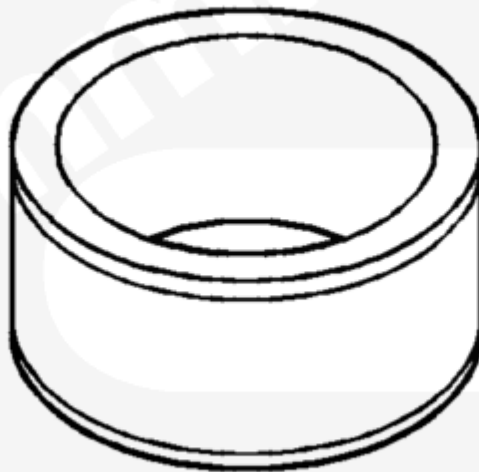

04a00021

The affected applications are all QST30 engines made prior to August 16, 2001 and prior to engine serial number 37199919. This change is implemented due to a possible assembly issue with the previous ring dowels. The old dowels were soft enough to mislocate and deform upon initial installation, thus possibly mislocating the cam follower shaft and causing capscrew clamp load problems. No stock of the old dowel is left in factory production, as of September 17, 2001

and the updates to the online catalog and price/parts lists have been made. Please replace all entries of Part Number 3092504, related to the cam follower assemblies, with Part Number 4067993 on hard copies of the QST30 Parts Catalogs.

Engine serial first for the new, hardened dowel rings is 37199919, built August 16, 2001. This new dowel ring, Part Number 4067993, supersedes Part Number 3092504 for the cam follower assemblies **only**.

Note : This is a product improvement and is not subject to campaign.

Last Modified: 19-Jun-2002
