



Technical Service Bulletin

Technical Service Bulletin: tsb100261

Released Date: 17-Mar-2004

Spacer Washer for the Harness Mounting

Spacer Washer for the Harness Mounting

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin announces the addition of a spacer washer under the two P-clips which support the Bosch® EHAB harness wire and the injector fuel return line. The clips are mounted on the left bank fuel pump mount on QST30 series engines.

The washer is needed because the fuel pump mount has a recessed spot face which will bend or fracture the bottom P-clip when the capscrew is torqued.

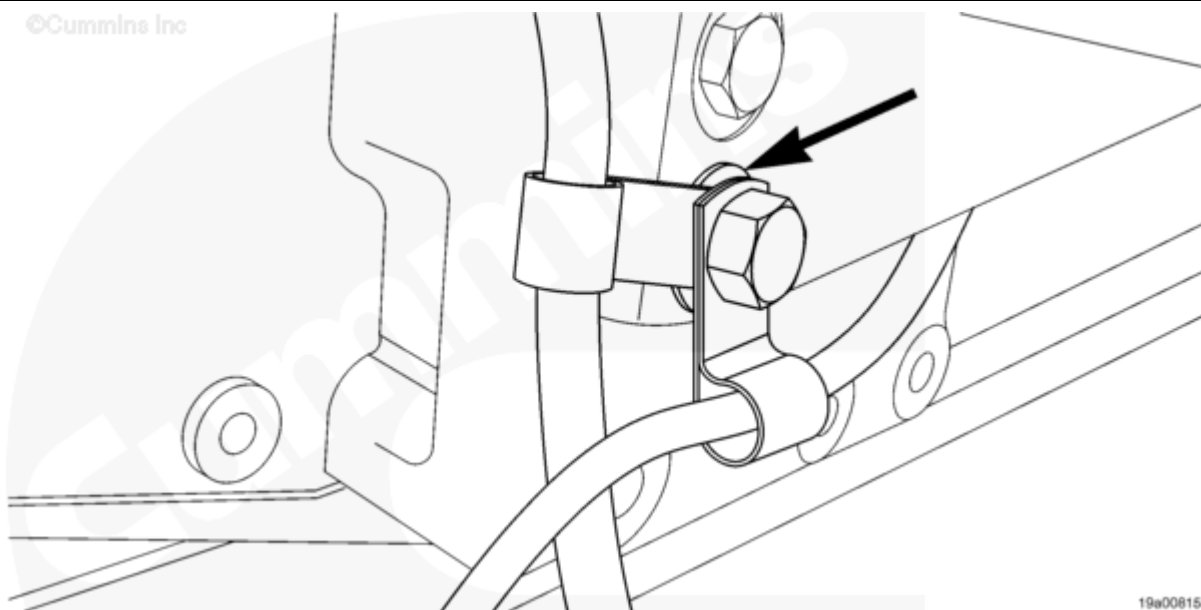


Figure 1, New Spacer Washer Installed

The washer, Part Number 3094024, will be added to options PH5723, PH5724 and PH5725.

Note : This is a product improvement not subject to campaign.

