



Technical Service Bulletin

Technical Service Bulletin: tsb100266

Released Date: 06-Apr-2004

Spacer for Turbocharger Oil Supply Line Bracket

Spacer for Turbocharger Oil Supply Line Bracket

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin announces the release of a turbocharger oil supply hose bracket spacer for the QST30 engine. The bracket spacer was implemented to reduce the possibility of contact between the turbocharger oil supply hose and the fuel return tube. The spacer, Part Number 3092334, is placed under the existing oil supply hose bracket mounted to the rocker lever housing. The new spacer requires a longer capscrew, Part Number 3094813, due to the addition of the spacer. This spacer and capscrew are used on both the left and right banks of the engine.

The illustration below shows the proper installation of the new spacer (1) and capscrew (2).

Note : The illustration shows a portion of the fuel return tube removed for clarity.

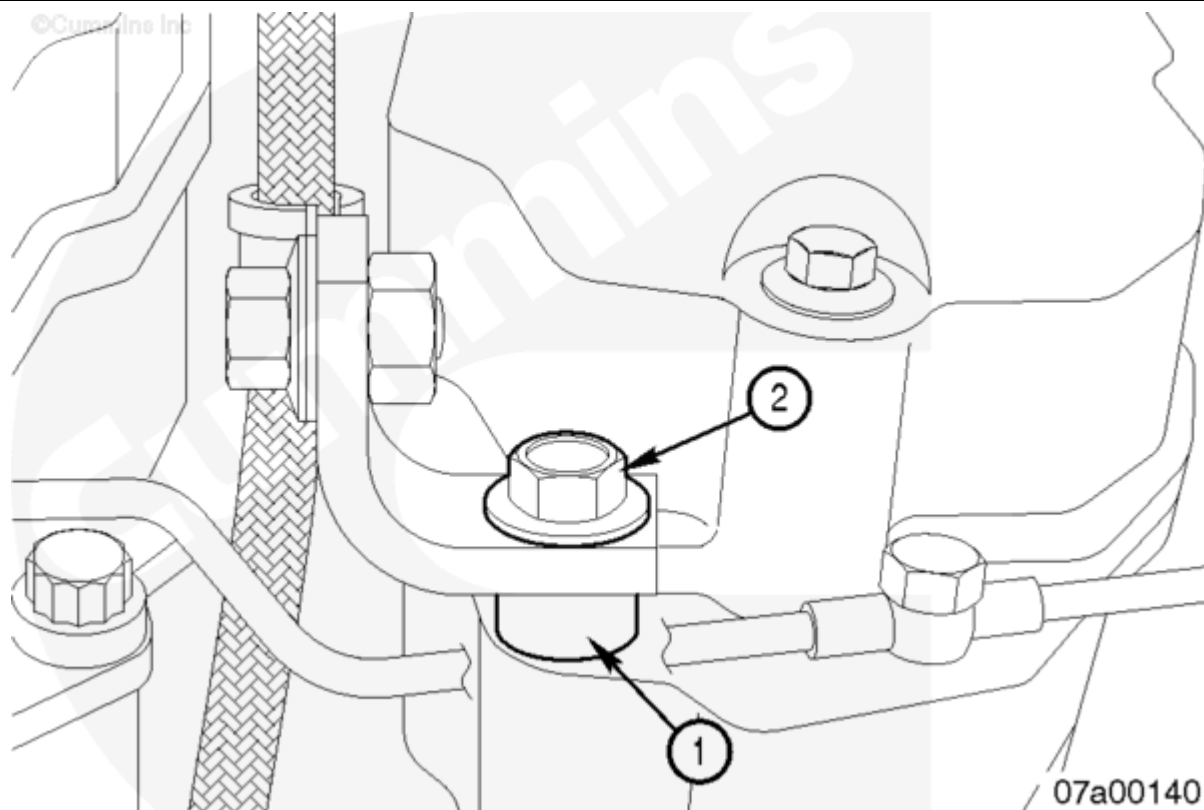

The new spacer and capscrew have been implemented into production on all QST30 engines starting August 14, 2003, with engine serial number first 37208615.

Note : This is a product improvement not subject to campaign.