



Technical Service Bulletin

Technical Service Bulletin: tsb100362

Released Date: 03-May-2005

Fuel Line Bracket

Fuel Line Bracket

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin announces an additional bracket to be placed on the right bank cylinder number 3 fuel line. Due to a large unbracketed span of the fuel line, the fuel line was able to vibrate and some have cracked due to high cycle fatigue.

The bracket components used have the same part numbers used on other fuel lines. No new components were needed or released. The parts will be added in production and are available to order for upfit.

Note : This is a product improvement and is not subject to campaign.

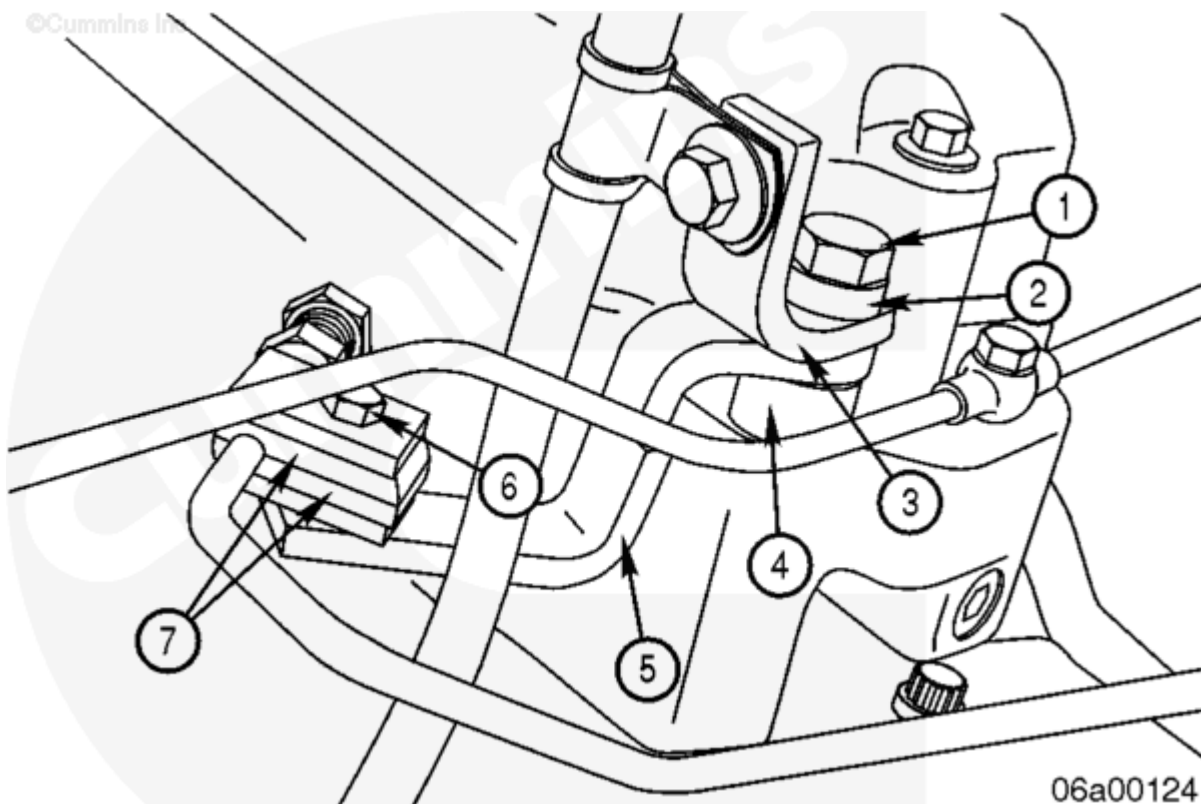

The bracket components are listed below:

Table 1, Fuel Line Bracket Components			
Item Number	Part Number	Description	Quantity
1	*3093764	Capscrew, hexagon head	1
2	68368B	Spacer, mounting	1
3	4068681	Bracket, fuel plumbing	1
4	3092334	Spacer, mounting	1
5	3093687	Bracket, fuel plumbing	1
6	3093734	Capscrew, hexagon head	1
7	3093624	Clamp, tube	2

***Remove existing part number:**

3094813	Capscrew, hexagon head flange (from rocker lever box location). This screw is replaced with part number 3093764.	1
---------	--	---

The Engine Serial Number (ESN) first for the additional bracket being installed in production is 37216997. The first build date was April 11, 2005.

There are no changes to the installation and removal procedures.