



Technical Service Bulletin

Technical Service Bulletin: tsb100884

Released Date: 06-Feb-2010

New Ignition Coil for Shielded Ignition Systems

New Ignition Coil for Shielded Ignition Systems


Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.


Contents

This Technical Service Bulletin introduces an improved ignition coil for shielded ignition systems on KTA19GC, KTA19GC CM558, and KTA38GC CM558 engines. The new ignition coil has a redesigned bracket to improve durability.

This new ignition coil, Part Number 2881178, replaces ignition coil, Part Number 4062756, for service and production on KTA38GC CM588 engines. The new ignition coil has a cradle shape bracket (see illustration). The old ignition coil has an omega shape bracket (see illustration).

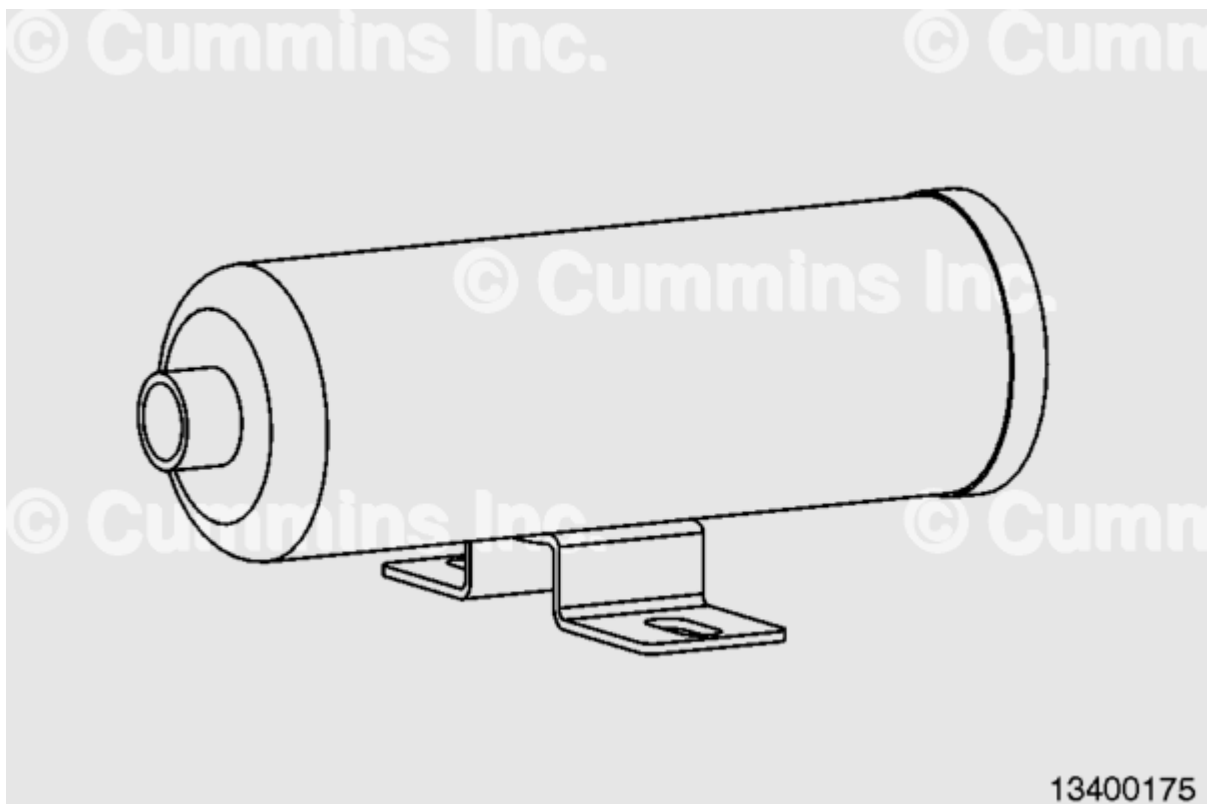


Cradle Shape Coil Bracket (New)

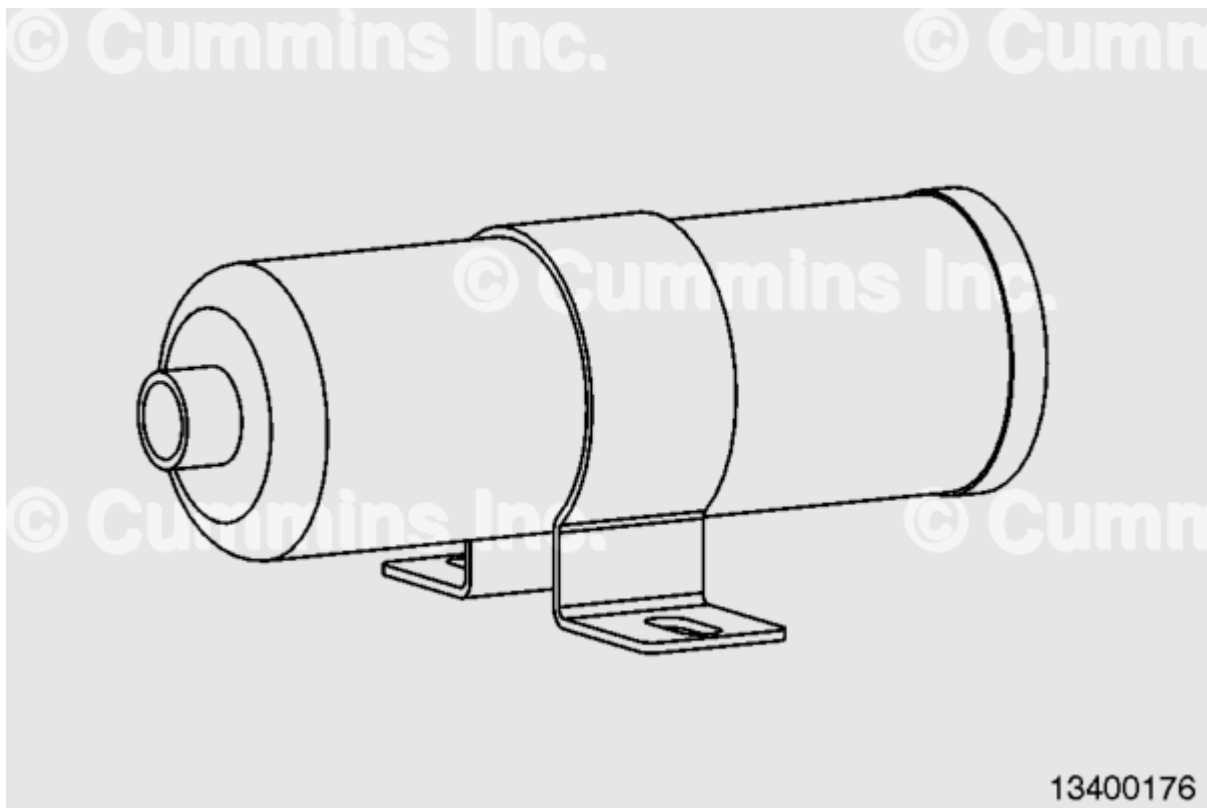


Omega Shape Coil Bracket (Old)

The new ignition coil, Part Number 2881178, obsoletes and supersedes the previous version of the cradle shape bracket ignition coil, Part Number 2867389, used on KTA19GC and KTA19GC CM558 engines with shielded ignition systems. The new ignition coil bracket has a revised welding pattern to improve manufacturing process control. The new ignition coil uses six weld points to attach the cradle shape coil bracket to the coil case while the previous design used five weld points. Existing parts inventory of the five weld point bracket ignition coil, Part Number 2867389, will be used to depletion prior to the use the new six weld point bracket ignition coil, Part Number 2881178.

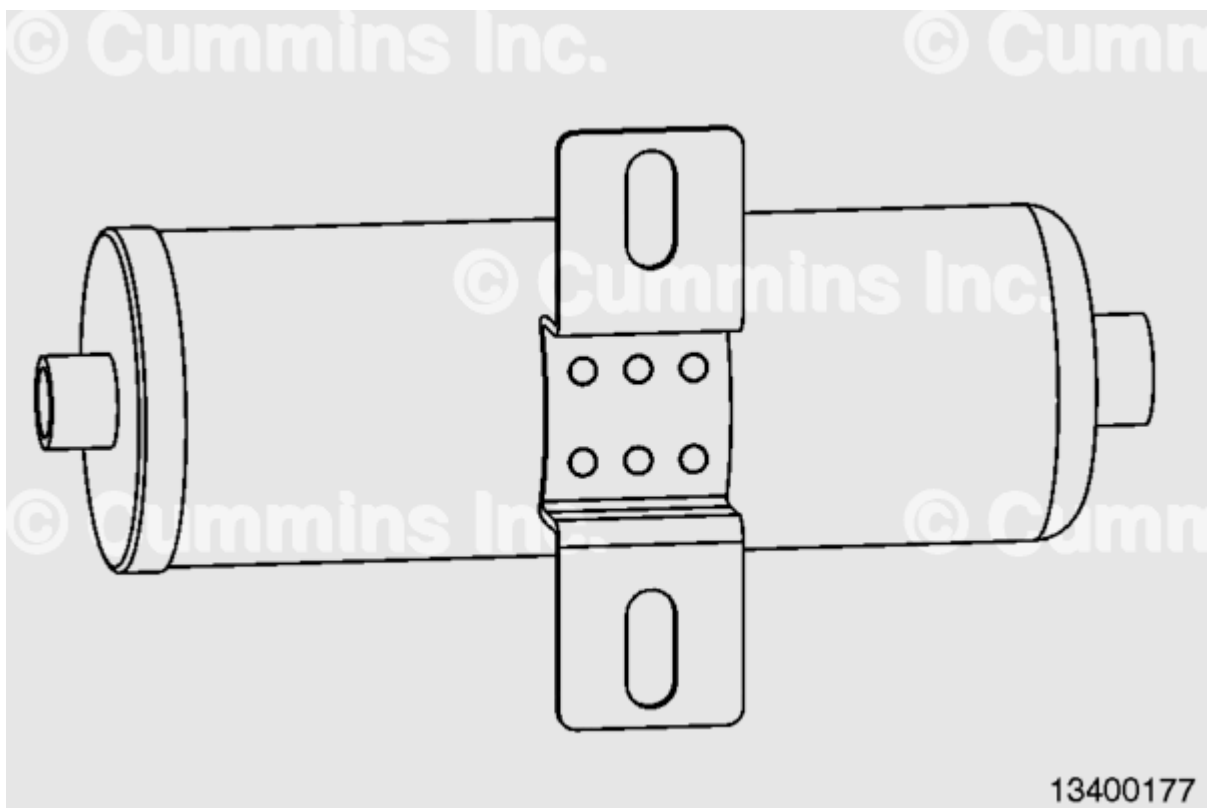

New Six weld point ignition cradle bracket.

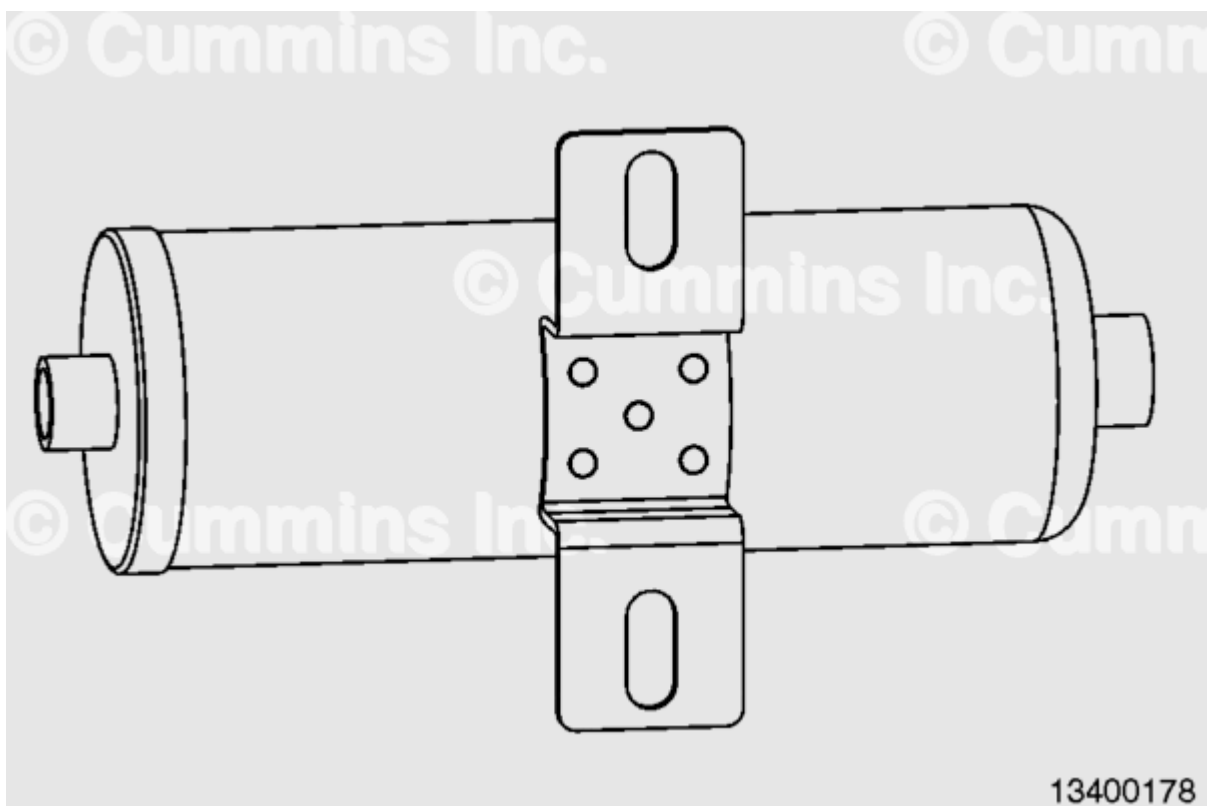

Old five weld point ignition coil cradle bracket.

Any of the three ignition coils (Part Number 2881178, Part Number 2867389, or Part Number 4062756) can be used on these engine with no adverse effects on engine performance.

When replacing an omega shape bracket ignition coil with a cradle shape bracket ignition coil, the mounting hardware needs to be upgraded. See Table 1 for details. The cradle shape bracket ignition coil with six weld points uses the same mounting hardware than the coil with five weld

points. Follow the instructions in Procedure 013-048 of the appropriate service manual for proper installation.

The new ignition coil will be installed on engines produced on or after 28 Jan 2010.

Table 1, Required cradle shaped bracket ignition coil mounting hardware

Engine	Description	Part Number	Comment
KTA19GC KTA38GC	Screw, Hexagon Head Cap	S102	Capscrew
	Washer, Plain	3042328	Upper plain washer, introduced with this configuration.
	Washer, Plain	109557	Bottom washer. Can be reutilized from omega shape bracket coil hardware.

Table 2, Ignition Coil

Engine	Old Part Number	New Part Number	Description
KTA19GC KTA19GC CM558	2867389	2881178	Coil, Ignition
KTA38GC CM558	4062756	2881178	Coil, Ignition