



Technical Service Bulletin

Technical Service Bulletin: TSB101121

Released Date: 06-Jan-2011

QST30 Only Runs on One Bank and Fault Code 166 is Active.

QST30 Only Runs on One Bank and Fault Code 166 is Active.

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Issue:

When starting a QST30 engine it will activate fault 166 and **only** run on one bank if a voltage spike from the CM552 ECM is detected. When this occurs, the engine commonly runs on the right bank **only**.

Verification / Confirmation:

Confirm that Fault Code 166 is active and that the engine is **only** running on one bank.

Resolution:

A resistor has been added to the left bank engine wiring harness to prevent Fault Code 166 from becoming active and the engine from running on one bank if a voltage spike from the CM552 ECM occurs.

Check to see if there is a resistor installed between the rack position common wire and ground on the bank that is **not** firing. See the attached figures for resistor locations. If a resistor is **not** found, install a resistor in the wiring harness or replace the wiring harness. Refer to the wiring diagram for the pin location identification. If a resistor is found, check the resistance.

- For power generation applications, use the following procedure in the QST30 CM850 Power Generation Interface Engine Electronic Control System Troubleshooting and Repair Manual, Bulletin 4021674. Refer to Procedure 019-043 in Section 19.
(/qs3/pubsys2/xml/en/procedures/60/60-019-043.html)
- For industrial applications, use the following procedure in the QST30 Industrial Electronic Control System Troubleshooting and Repair Manual, Bulletin 3666214 for resistance check instructions. Refer to Procedure 019-043 in Section 19.
(/qs3/pubsys2/xml/en/procedures/87/87-019-043.html)

The tables below summarize changes to the engine wiring harness:

QST30 CM552 Industrial One-Piece Harness Engines	Part Number	ESN First or Plant Implementation Date
One 2.2k Ohm Resistor (right bank only)	4975508	3-August-2009
Two 2.2k Ohm Resistors	4975755	37247268

QST30 CM850 Power Generation Interface Engines	Part Number	ESN First or Plant Implementation Date
One 2.2k Ohm Resistor (right bank only)	4975505	25-May-2009
Two 2.2k Ohm Resistors with 12 Volt Fuel Pump Relay	2881121	13-December-2009
Two 2.2k Ohm Resistors with 24 Volt Fuel Pump Relay	4975747	37245679
Two 1.3k Ohm Resistors with 24 Volt Fuel Pump Relay	4975760	37246974



Figure 1: Resistor Location for QST30 Industrial Left Bank

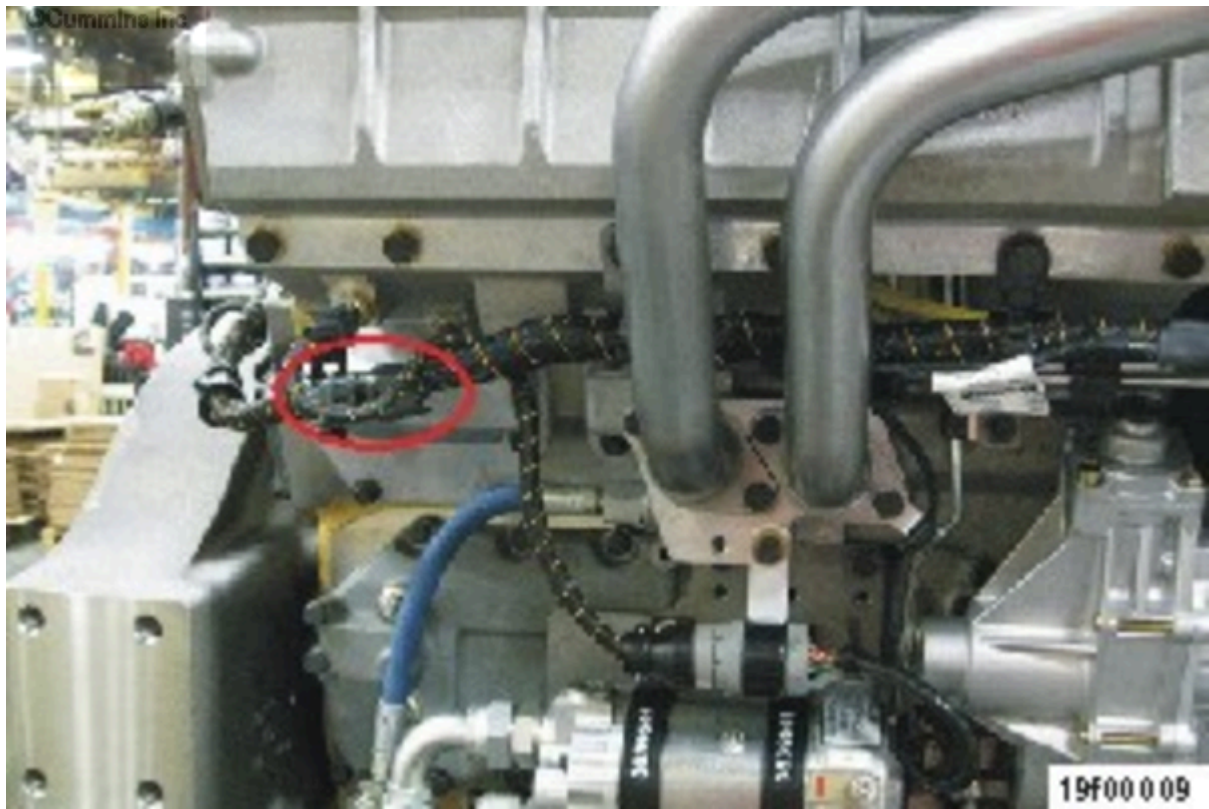


Figure 2: Resistor Location for QST30 Industrial Right Bank

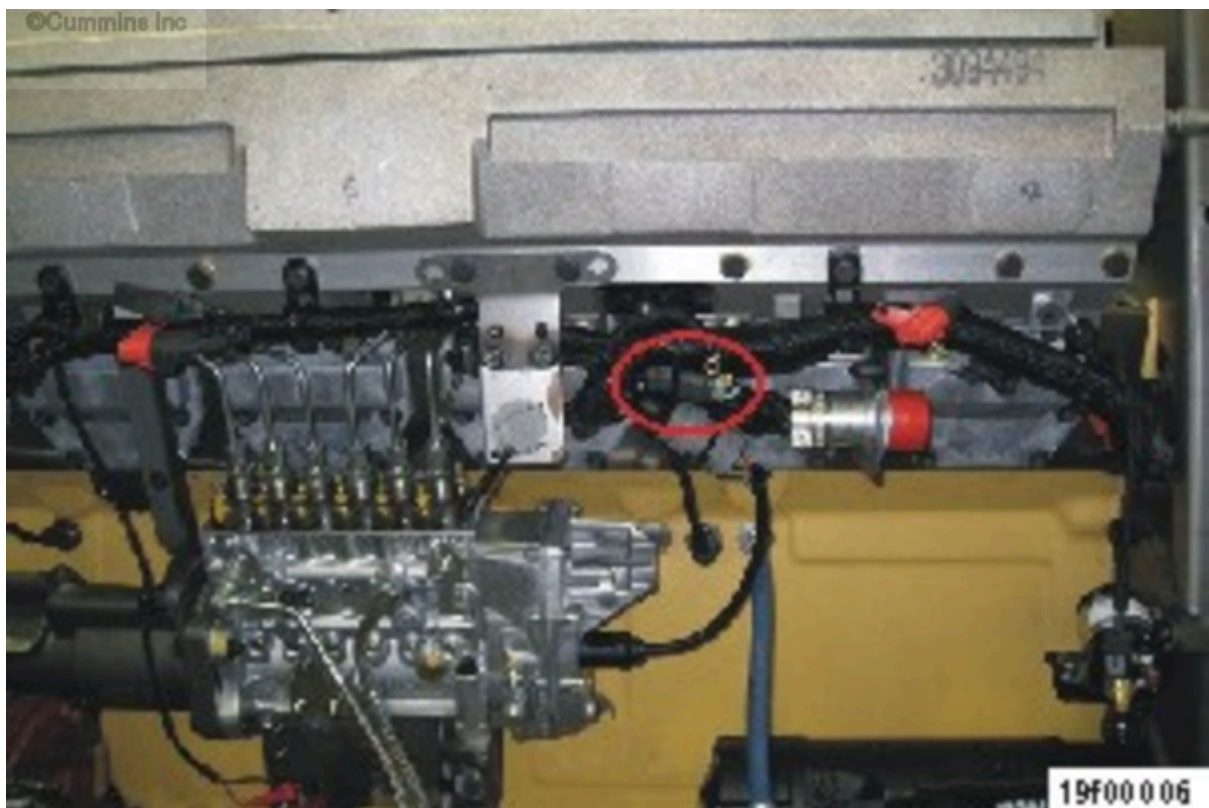


Figure 3: Resistor Location for QST30 Power Generation Interface Left Bank



Figure 4: Resistor Location for QST30 Power Generation Interface Right Bank

Document History

Date	Details
2010-12-14	Module Created

Last Modified: 06-Jan-2011
