



Technical Service Bulletin

Technical Service Bulletin: TSB110305	Released Date: 09-Feb-2012
QST30 New Aftercooler Drain Port	

QST30 New Aftercooler Drain Port

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document announces a change to the right bank water transfer connector for the aftercooler. The affected options are: TB5717, TB5731, and TB5747. These options are **only** used on QST30 engines with auxiliary cooling systems with a two pump two loop design.

The right bank water transfer connectors have been redesigned with drain ports to allow the coolant to be completely drained from the right bank aftercooler core. Initially, the port was added to the existing part numbers, Part Number 3092905 and Part Number 4975564. This began in production on 01 August 2011.

The location of the drain port is shown in **Figure 1**, below.

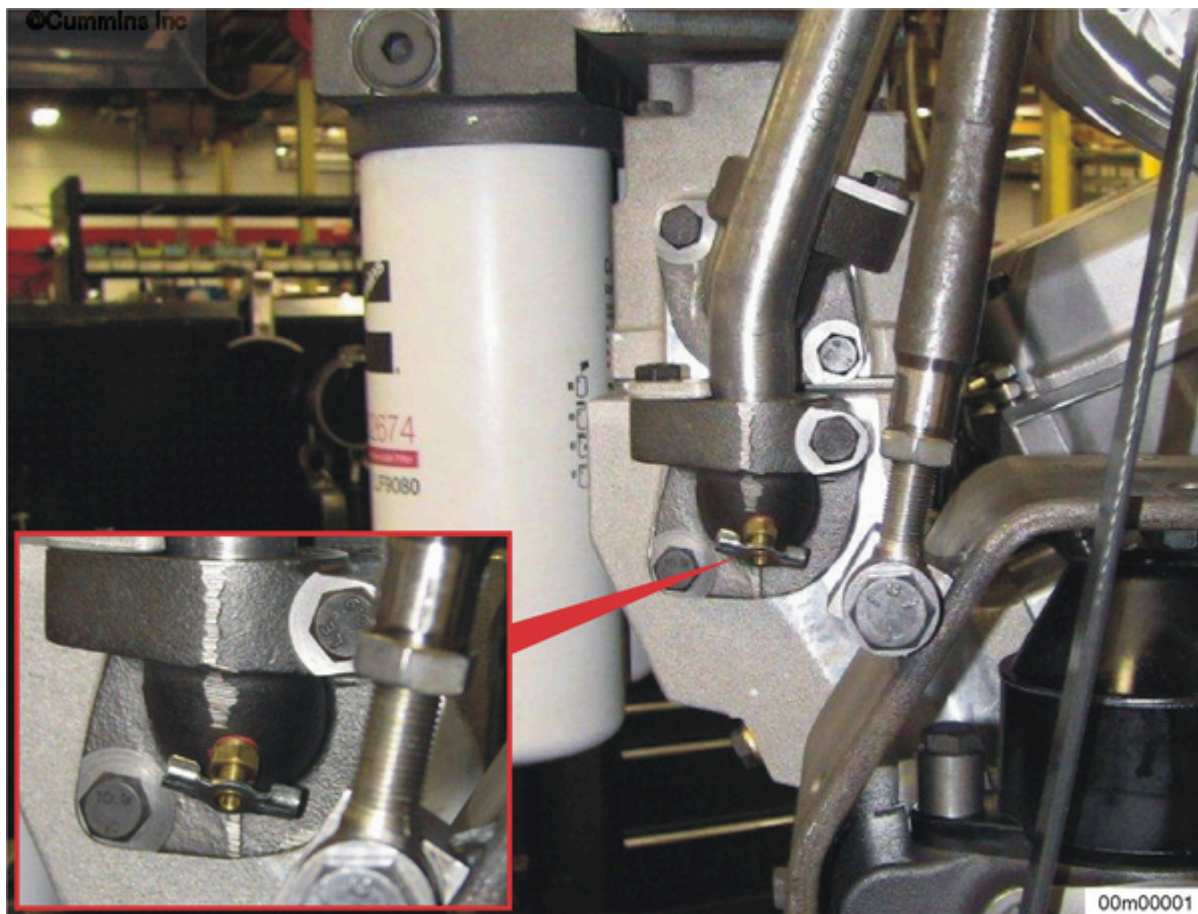


Figure 1. Location of drain port on right bank water transfer connector

Table 1. New and Old Right Bank Water Transfer Connectors

New Part Number	Old Part Number	ESN First	Date
4975819	3092905	37252700	02 Jan 2012
4975820	4975564	TBD	TBD

Document History

Date	Details
2011-11-7	Module Created

Last Modified: 09-Feb-2012