



Technical Service Bulletin

Technical Service Bulletin: TSB120224

Released Date: 08-Mar-2022

New Turbocharger Kit Containing B16 bolt for 0.25 mm [0.010 in] Shim

New Turbocharger Kit Containing B16 bolt for 0.25 mm [0.010 in] Shim

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document announces the release of a new turbocharger kit, Part Number 5357484. This kit is intended as a Step 3 solution for an active serious quality problem project investigating the A286 stainless steel capscrews breaking in the bearing-to-turbine housing joint. The turbocharger kit will contain new B16 capscrews (1), and new lock plates (2). The 0.25 mm [0.010 in] shim is fitted between the flange of the bearing housing and the turbine housing. See Figure 2 (ordered separately).

Shims can only be installed on turbochargers that do not use the C-seal.

This kit will also contain an installation sheet with instructions on how to install the shim.

This TSB is applicable to all High Horse Power engine platforms.

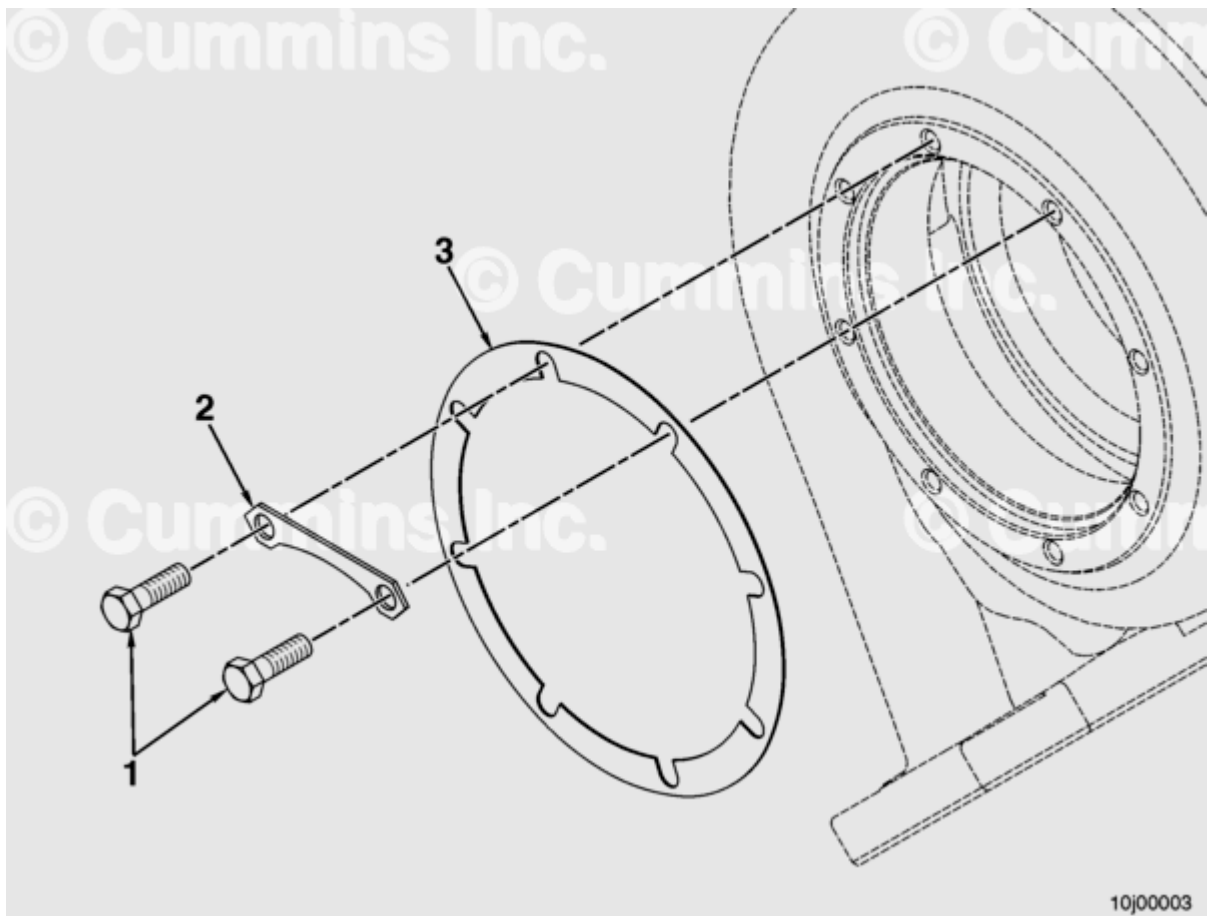


Figure 1 - Turbocharger Kit, Part Number 4034095 Contents

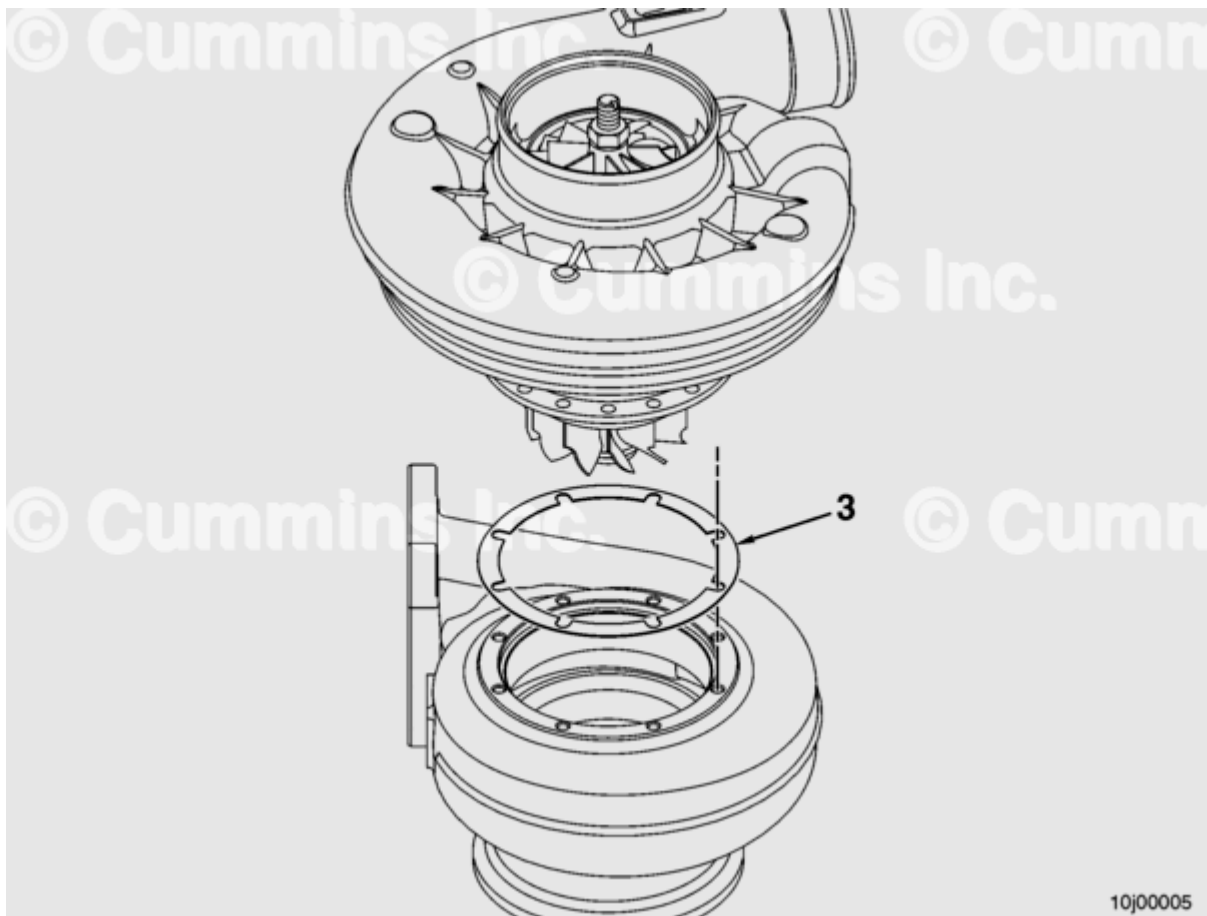


Figure 2 - Shim Location

Part Number	Description	Quantity
3780450	Shim (item 3 in Figure 1)	1
5357484	Kit, Service	1
Containing		
3522904	Lock Plate (item 2 in Figure 1)	4
3780503	Screw, Hexagon Head Set (item 1 in Figure 1)	8
4029606	Installation Sheet	1

Document History

Date	Details
2012-7-11	Module Created
2012-10-18	Incorrect Part Number
2012-10-22	QSOL Quick Fix Reason: Incorrect Part Number Notes: none
2020-5-12	Non-Product Problem Solving (PPS)

Date	Details
2020-10-29	Non-Product Problem Solving (PPS)
2022-3-8	Corrected table to include proper part numbers and included mention of B16 bolt into TSB.

Last Modified: 08-Mar-2022
