



Technical Service Bulletin

Technical Service Bulletin: TSB130160

Released Date: 05-Dec-2013

New QST30 Rear Deep Sump Application Oil Suction Tube and Brackets

New QST30 Rear Deep Sump Application Oil Suction Tube and Brackets

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document introduces a new lubricating oil suction tube and brackets for QST30 rear deep sump application; Option OP5137 **only**. The oil suction tube and brackets have been designed to prevent cracking of the oil suction tube caused by vibration.

The improved tube assembly includes brackets brazed onto the suction tube, as well as changes to the vertical and block brackets. The new brackets must be used with this revised tube and include slots for the capscrews to improve alignment with the tube clamps. A nominal 1 mm [0.039 in] gap is designed to space the tube away from the brackets, to prevent fretting between the tube and the brackets.

Use the following procedure "Lubricating Oil Suction Tube (Block Mounted)" in the QST30 Service Manual, Bulletin 4021539. Refer to Procedure 007-035 in Section 7.
(/qs3/pubsys2/xml/en/procedures/57/57-007-035-tr.html)

Engine Serial Number: 37259857

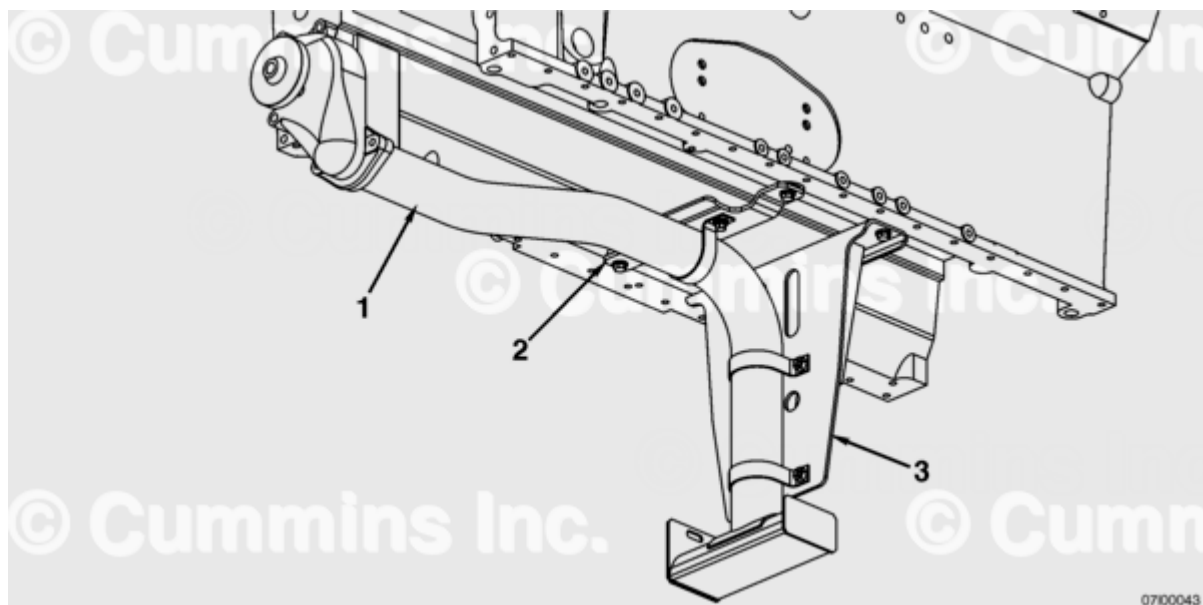


Figure 1. Revised suction tube (1), block bracket (2), vertical bracket (3)

Part Name	Old Part Number	Quantity	New Part Number	Quantity
Lube Oil Suction Tube	4308739	1	4334001	1
Tube Clamp	4975653	2	Obsolete	N/A
Block Bracket	4308741	1	4334003	1
Vertical Bracket	4308740	1	4334004	1
Block Bracket Tube Clamp	4308810	1	Obsolete	N/A
Block Hex Head Cap Screw	3093743	4	3093743	4
Bracket Hex Flange Head Cap Screw	3093932	6	3093932	6
Bracket Hex Head Nut	3094937	6	3094937	6
Bracket Plain Washer	170664	6	170664	6
Plain Washer	3093799	10	3093799	6
O-Ring Seal	3093801	1	3093801	1

Document History

Date	Details
2013-11-4	Module Created

Last Modified: 05-Dec-2013
