



Technical Service Bulletin: TSB160011

Released Date: 03-Sep-2019

New Exhaust Gas Temperature Sensor and Injector Quadrant Wiring Harness and Mounting Brackets

New Exhaust Gas Temperature Sensor and Injector Quadrant Wiring Harness and Mounting Brackets

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK50 CM850 MCRS
- QSK50 CM2150 MCRS
- QSK50 DF CM850/CM2150 MCRS

Issue

Symptom:

- Injector and/or exhaust gas temperature sensor fault codes present. Fault Codes: 1535, 1529, 2125, 2131, 623, 1117, 621, 628, 2137, 2134, 1532.

Root Cause:

- Break, short, or open circuit in wiring harness or exhaust gas temperature sensor connector damage caused by incorrect contact with cylinder block, cylinder head, camshaft cover, or aftercooler housings.

Verification

- Check for fault codes as listed above.
- Inspect wiring harness and exhaust gas temperature sensor connector for physical damage.

Resolution

The following components have been released to remedy the malfunctions outlined above:

- A wiring harness and bracket assembly and new cylinder head mounting bracket
- New camshaft cover bracket

The new components reroute the wiring harness and prevent wiring harness fretting caused by contact with the cylinder block, cylinder head, or camshaft cover.

Service Instructions

New camshaft cover brackets are also required when installing the new wiring harness and bracket assemblies. The camshaft cover bracket is mounted on the cylinder block and one **must** be installed for every engine quadrant wiring harness used.

Service Parts Availability

Service parts are available. See Table 1 for part numbers. The part number quantities listed in Table 1 are for replacing all obsolete parts on the entire engine.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number	Quantity Per Engine Bank	Engine Bank
Wiring Harness and Bracket Assembly	3642413	Yes	Yes	5372877	2	Left
Wiring Harness and Bracket Assembly	3642414	Yes	Yes	5372878	2	Right
Eliminator TM Compatible Wiring Harness	Not Applicable			5372879	1	Right
Camshaft Cover Bracket				5372029	2	Left and Right

Part Compatibility

The new parts are compatible with obsolete parts, but Cummins Inc. recommends all engine quadrants have new components installed.

Note : When up-fitting an engine equipped with an Eliminator, use EliminatorTM specific wiring harness, Part Number 5372102, for quadrant above EliminatorTM, all other quadrants use standard harness. See Table 1 above for part numbers. See Figures 3 and 4 below.

Part Identification

- The cylinder bank (left bank or right bank) on which wiring harness is to be used is identified by yellow tag. See Figure 1 below.

- The camshaft cover bracket is same for each engine quadrant. See Figure 2 below.
- The Eliminator™ quadrant wiring harness has a longer main wiring harness connection. See Figures 3 and 4 below.


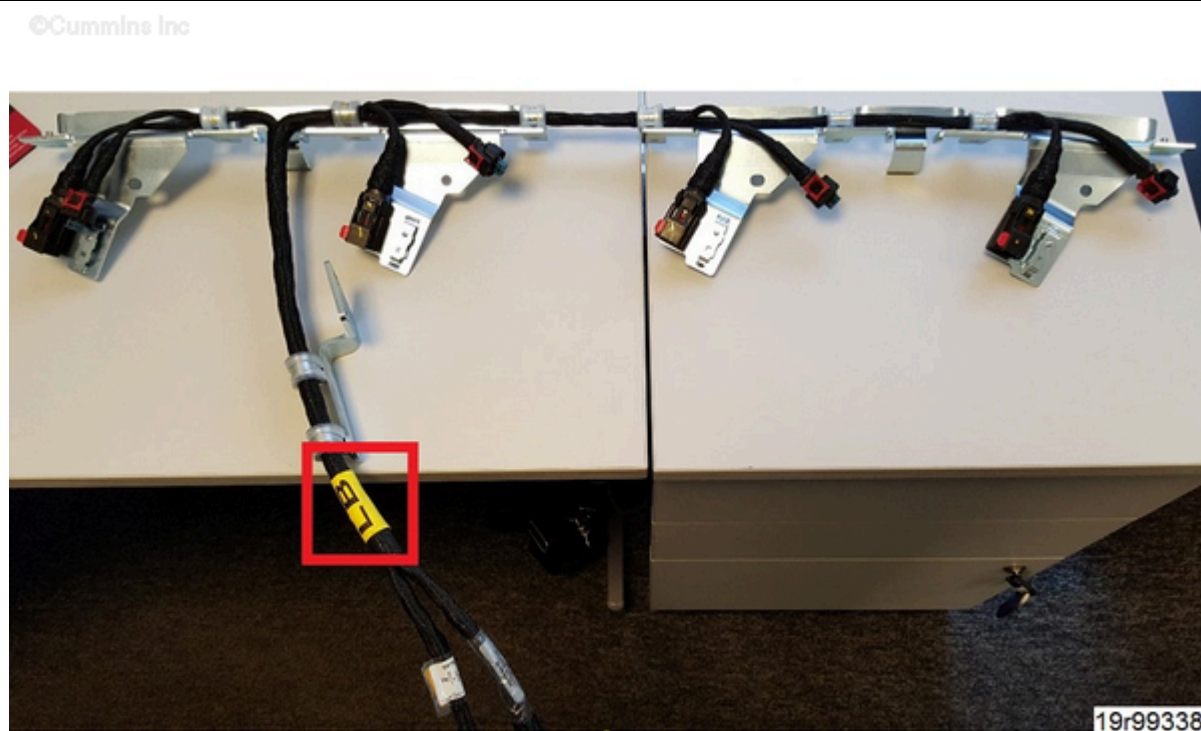


Figure 1, Left Bank Wiring Harness Identified By Yellow Tag.



19r99339

Figure 2, Camshaft Cover Bracket.

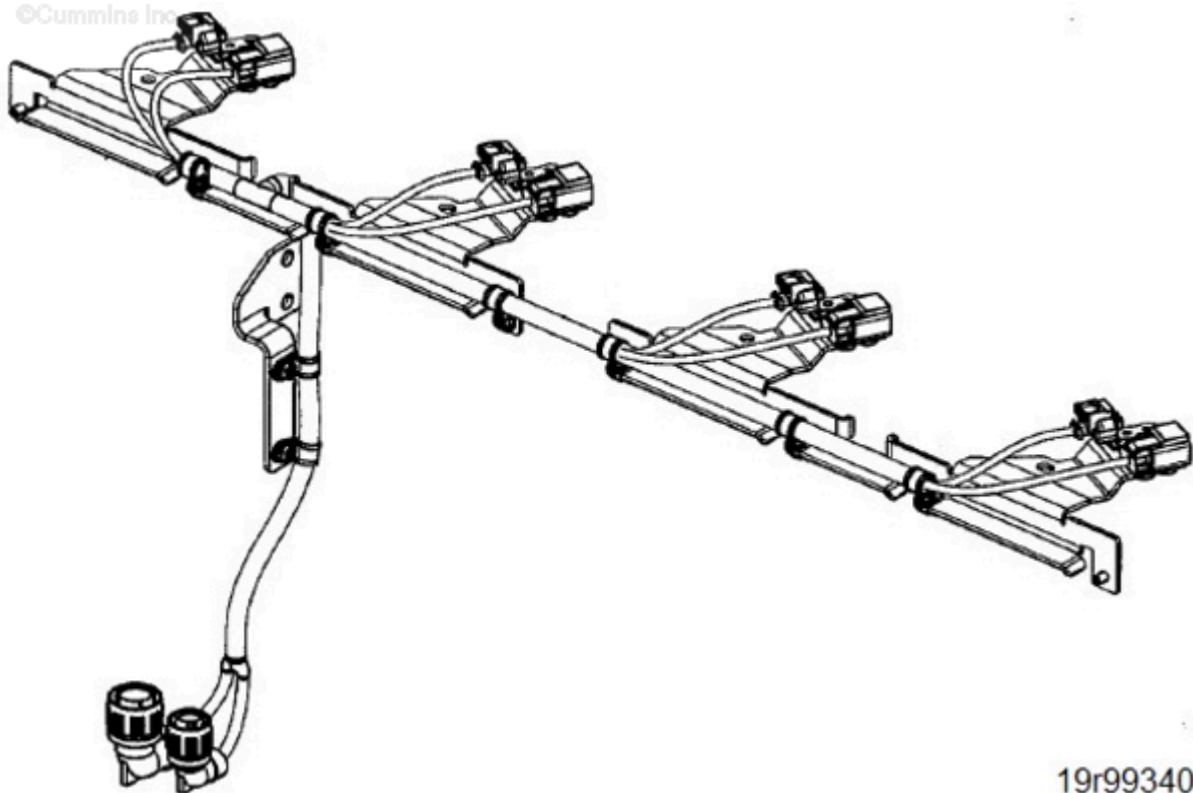

19r99340

Figure 3, Standard Filter Head Wiring Harness.

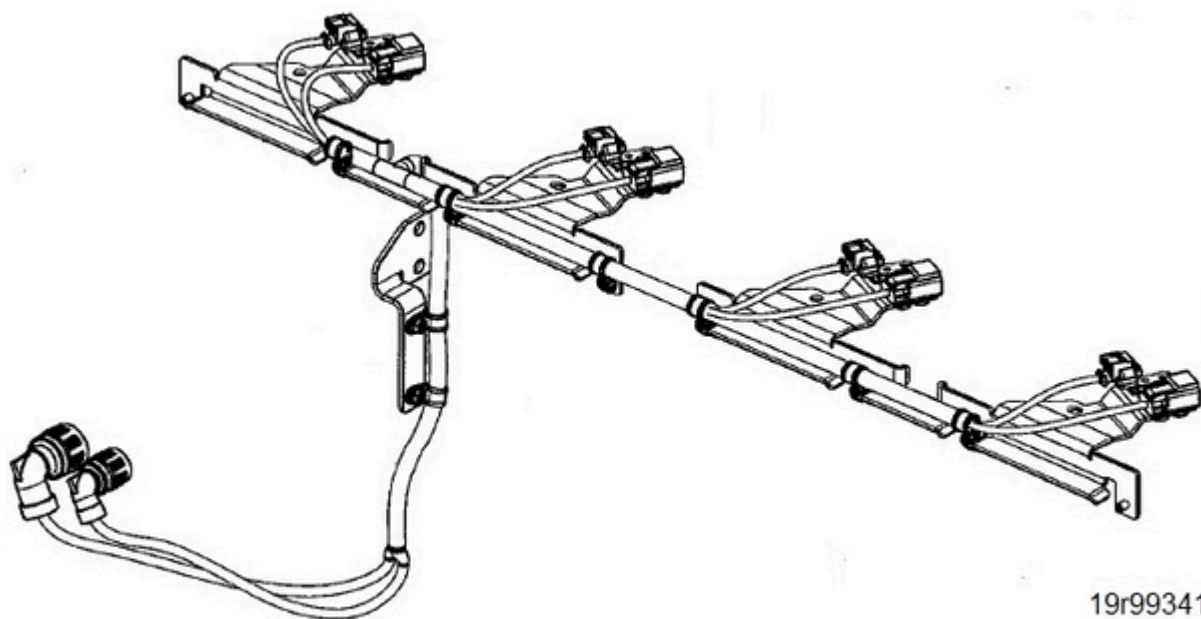


Figure 4, Eliminator™ Wiring Harness.

Production Status**Table 2, Production Information**

ESN First	Build Date ¹	Plant
33206850	12 February 2016	Daventry Engine Plant

¹Engine build date can be found on the engine dataplate.

Publications Affected**Table 3, Publications Affected**

Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Troubleshooting and Repair	QSK38, QSK50 and QSK60 CM2150	4021533	Engine Wiring Harness	Refer to Procedure 019-043 (/qs3/pubsys2/xml/en/procedures/05/05-019-043.html)	19

Table 3, Publications Affected					
Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Operation and Maintenance	K38, K50, QSK38 and QSK50	3810497	Rocker Lever Cover	Refer to Procedure 003-011 (/qs3/pubsys2/xml/en/procedures/28/28-003-011-om.html)	A

Document History

Date	Details
2016-2-2	Module Created
2017-1-9	Corrected part number error in Table 1 and added part number 5372879.
2019-9-3	Corrected part number 3642412 to 3642414