



Technical Service Bulletin: TSB180083

Released Date: 20-Jun-2018

V-Ribbed Belt Tension Drive Load Change for Industrial Applications

V-Ribbed Belt Tension Drive Load Change for Industrial Applications

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

Engine:

- QST30 CM2350 T101
- QST30 CM552

Issue

Symptom:

- High coolant temperature fault code caused by belt rib wear, belt pattern wear, or belt shredding.

Root Cause:

- High inertia fan blade and high deacceleration rate spikes can lead to belt wear or malfunction.

Resolution

After verifying belt tension is below 525 or above 625 lbs, adjust belt tension using belt tension gauge tool, Part Number 3164750. Reference procedure 008-087 in the corresponding Service Manual. If tension load adjustment does **not** reach 525 lbs, and belt does **not** align properly, add additional washer, Part Number 3036900, to tensioner assembly as shown in Figure 1 below.

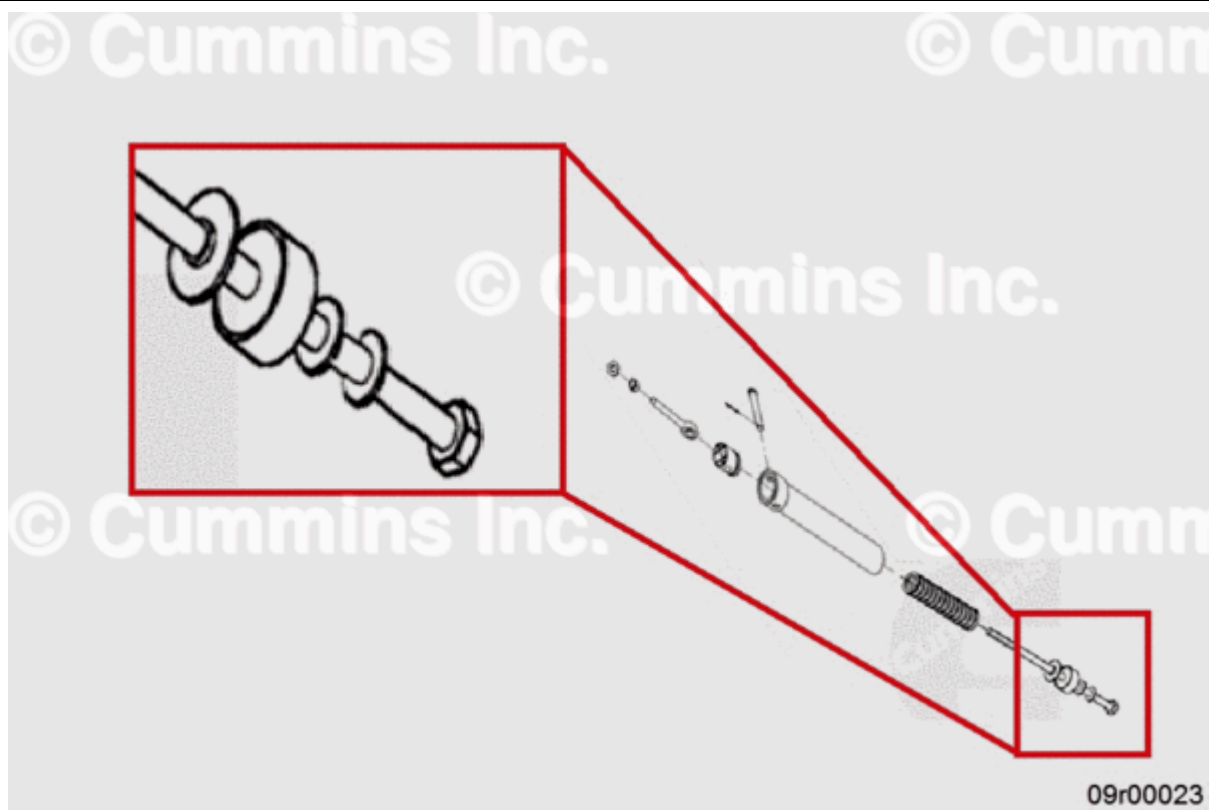


Figure 1, Location of Additional Washer

Publications Affected

Table 1, Publications Affected

Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Service Manual	QST30C	4021539	Cooling Fan Belt Tensioner	Refer to Procedure 57-008-087	8

Document History

Date	Details
2018-6-12	Module Created

Last Modified: 20-Jun-2018