



Technical Service Bulletin

Technical Service Bulletin: TSB190052

Released Date: 29-Apr-2019

New Fuel Pump Inlet Filter Screen

New Fuel Pump Inlet Filter Screen

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK38 CM2150 K106
- QSK38 CM850 MCRS
- QSK50 CM2150 K107
- QSK50 CM850 MCRS
- QSK60 CM2150 MCRS
- QSK60 CM850 MCRS

Description of Change

A new fuel pump inlet filter screen has been released to provide additional protection against debris entering the fuel pump.

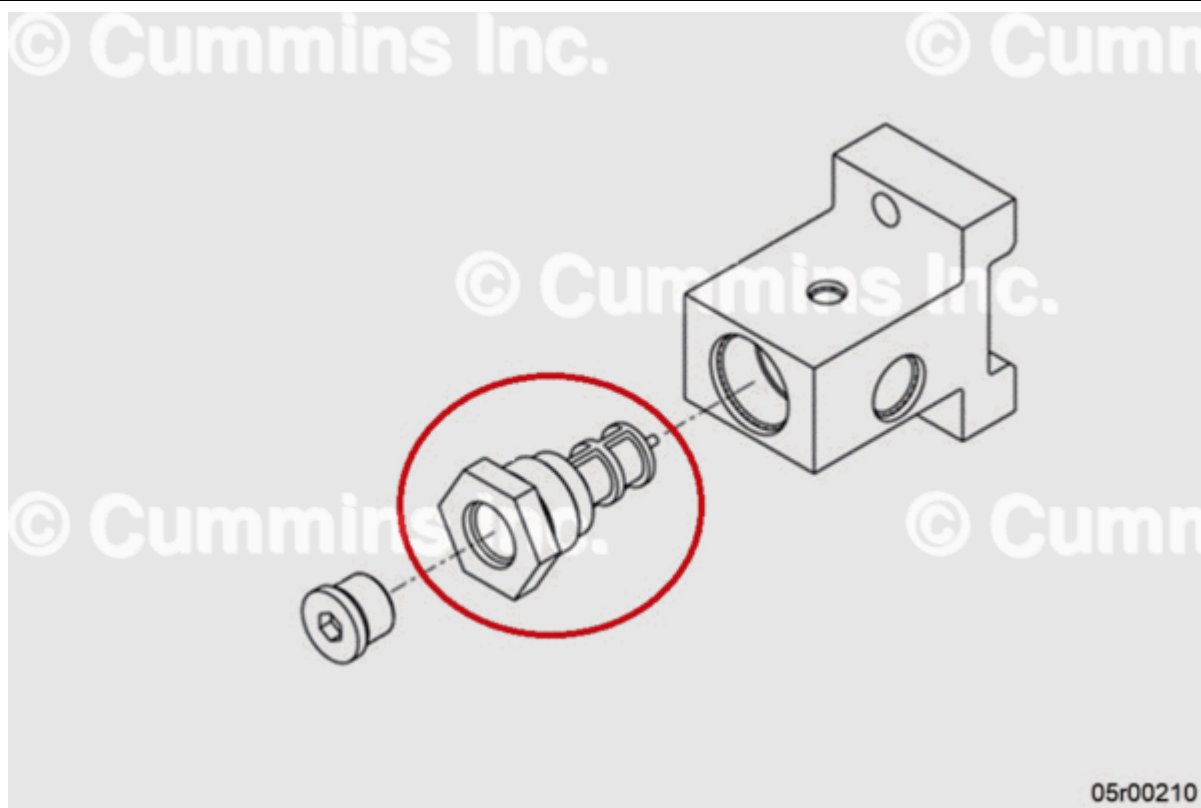


Figure 1, New Fuel Pump Inlet Filter Screen.

Service Instructions

- New fuel pump inlet filter screen consists of an adapter to be installed into a revised fuel supply manifold.
 - Fuel pump inlet filter screen torque specification is 185 N•m [136 ft-lbs].
- There is no approved cleaning procedure for the fuel pump inlet filter screen and must be replaced when necessary.
- PA threaded protective plug can be ordered if engine was shipped without original equipment manufacturer (OEM) fuel inlet plumbing. See Table 1 below for part number information.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
MANIFOLD, FUEL	4381483	Yes	Yes	5417125
SCREEN, FILTER	-	No	No	5417128
PLUG, THREADED	-	No	No	3678611

Part Compatibility

- If engine is equipped with fuel pump option FP6970, the fuel pump inlet filter screen assembly is **not** compatible.

Production Status

Implemented for production. See Table 2.

Table 2, Production Information

ESN First	Build Date ¹	Plant
33214792	18 June 2018	Daventry

¹Engine build date can be found on the engine dataplate.

Document History

Date	Details
2019-4-12	Module Created

Last Modified: 29-Apr-2019
