



Technical Service Bulletin: TSB200057

Released Date: 27-Jul-2020

Fractured Low Temperature Aftercooler Water Pump Shaft

Fractured Low Temperature Aftercooler Water Pump Shaft

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QST30 CM552

Issue

Symptom:

- High intake manifold temperature.

Root Cause:

- Fractured low temperature aftercooler water pump shaft.

Verification

Inspect low temperature aftercooler water pump shaft. See Figure 1 below.

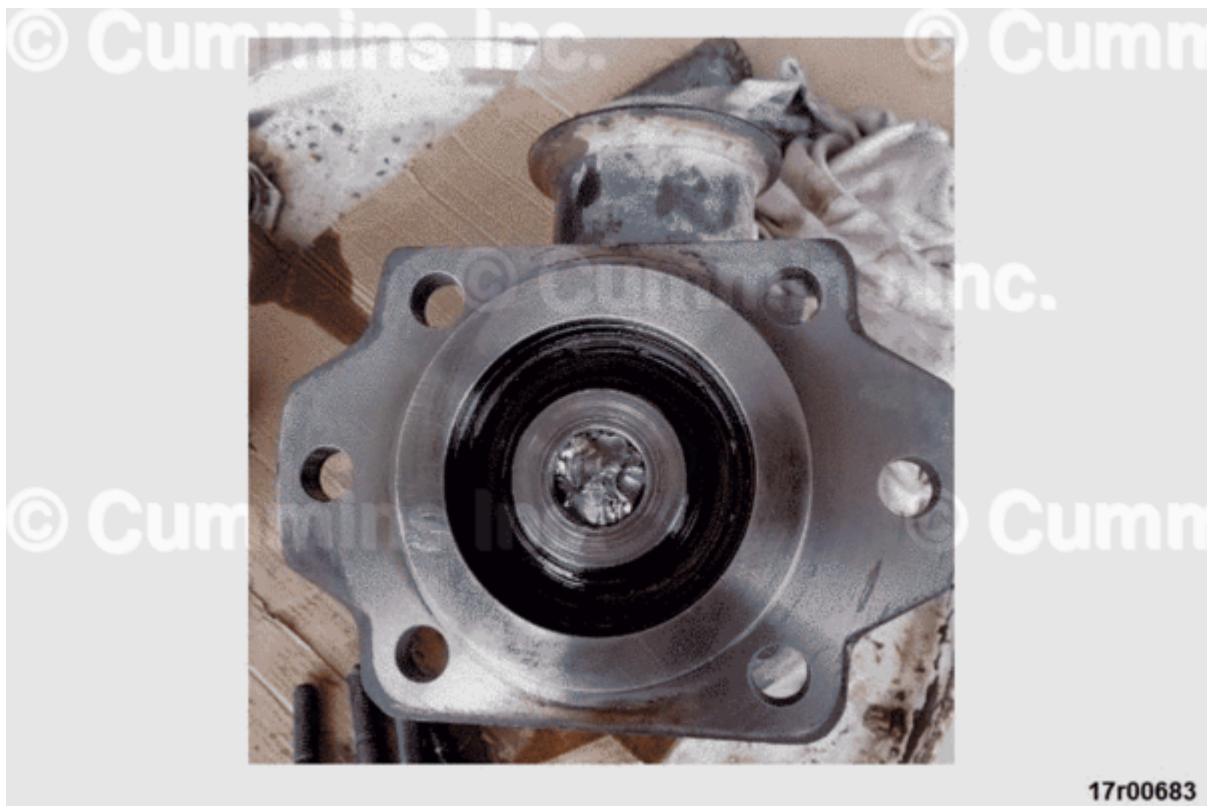


Figure 1, Fractured Low Temperature Aftercooler Water Pump Shaft.

Resolution

A new water pump and water pump brace were released. See Figure 2 below for new mounting arrangement.

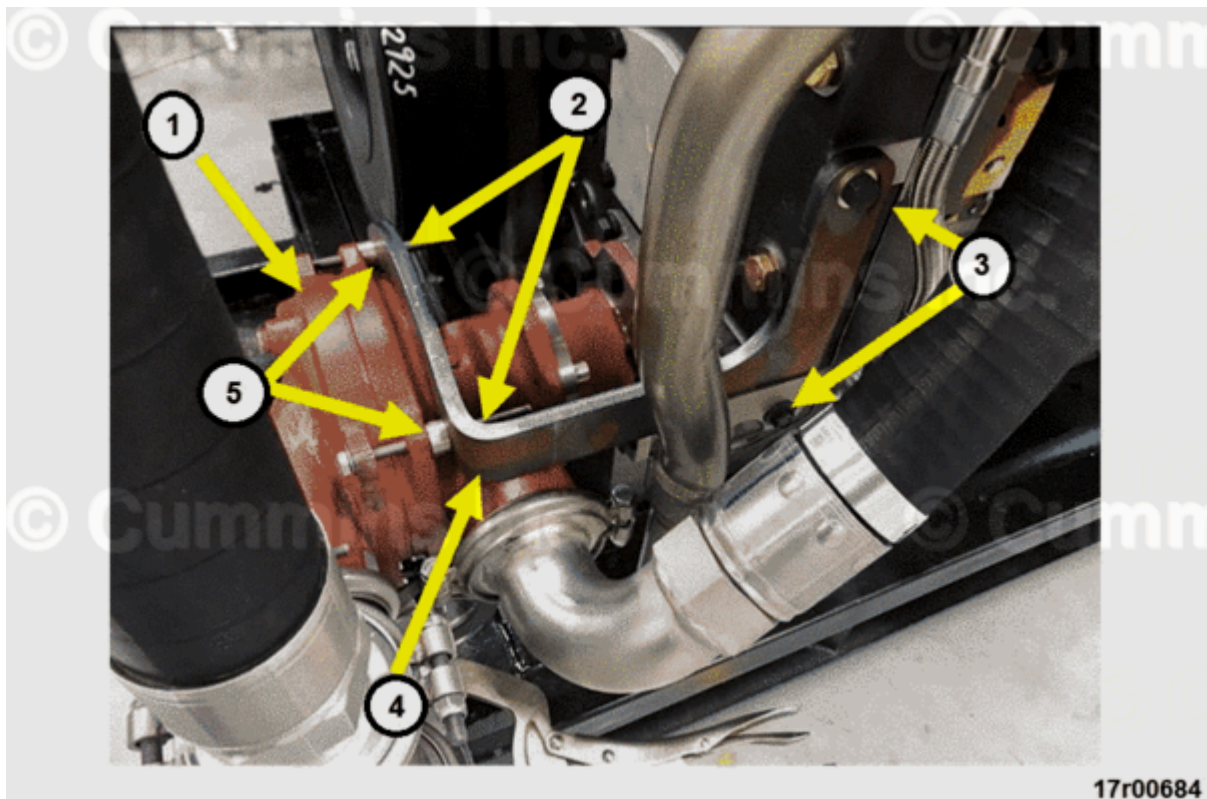


Figure 2. New Low Temperature Aftercooler Water Pump Mounting Arrangement.

Install two mounting spacers (5) between the water pump housing (1) and water pump brace (4).

Install water pump brace mounting capscrews (2).

- Torque Value: 65 N•m [48 ft-lb]

Install water pump brace mounting capscrews (3).

- Torque Value: 33 N•m [24 ft-lb]

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts

Part Description	Quantity	Existing Part Number	Obsolete	Superseded	New Part Number
Water Pump	1	4310976	No	No	5409320
Mounting Spacer	2	-	No	No	3092334
Water Pump Brace	1	4068468	No	No	5416188

Document History

Date	Details
2020-3-11	Module Created
2020-7-20	Non-Product Problem Solving (PPS)

Last Modified: 27-Jul-2020
