



Technical Service Bulletin

Technical Service Bulletin: TSB200111

Released Date: 07-Aug-2026

Eliminator™ Filter and Eliminator™ Hydraulic Motor

Eliminator™ Filter and Eliminator™ Hydraulic Motor

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- K38
- QSK38 CM850 MCRS
- QSK38 CM2150 MCRS
- QSK38 CM2150 K106
- QSK38 CM2150 K142M
- QSK38 CM2350 K125
- QSK38 CM2350 K138M
- QSK45 CM500
- QSK50 CM2150 MCRS
- QSK50 CM2150 K107
- QSK50 CM2150 K140M
- QSK50 CM2350 K108
- QSK50 CM2350 K130
- QSK60 CM500
- QSK60 CM850 MCRS
- QSK60 CM2150 MCRS
- QSK60 CM2150 K132M
- QSK60 CM2250 K112
- QSK60 CM2350 K116
- QSK60 CM2350 K117
- QSK60 CM2350 K121
- QSK60 CM2350 K135
- QSK60 CM2350 K136
- QSK60 CM2350 K149M
- QSK78 CM500
- QSK78 CM2250 K104
- QSK78 CM2350 K126

- QSK78 CM2350 K137
- QSK78 CM2350 K154C
- QSK95 CM2350 K111
- QSK95 CM2350 K113
- QSK95 CM2350 K128M
- QSK95 CM2350 K143C
- QSK95 CM2350 K147C

Issue

Symptom: No revolution or slow revolution of the hydraulic motor causing excessive residue to build up on the eliminator filter screens.

Root Cause: Oil leaks internal to the hydraulic motor causes motor to stop functioning as intended.

Verification/Confirmation

Check the function of the hydraulic motor. Make a note of the number of minutes it takes to do one revolution.

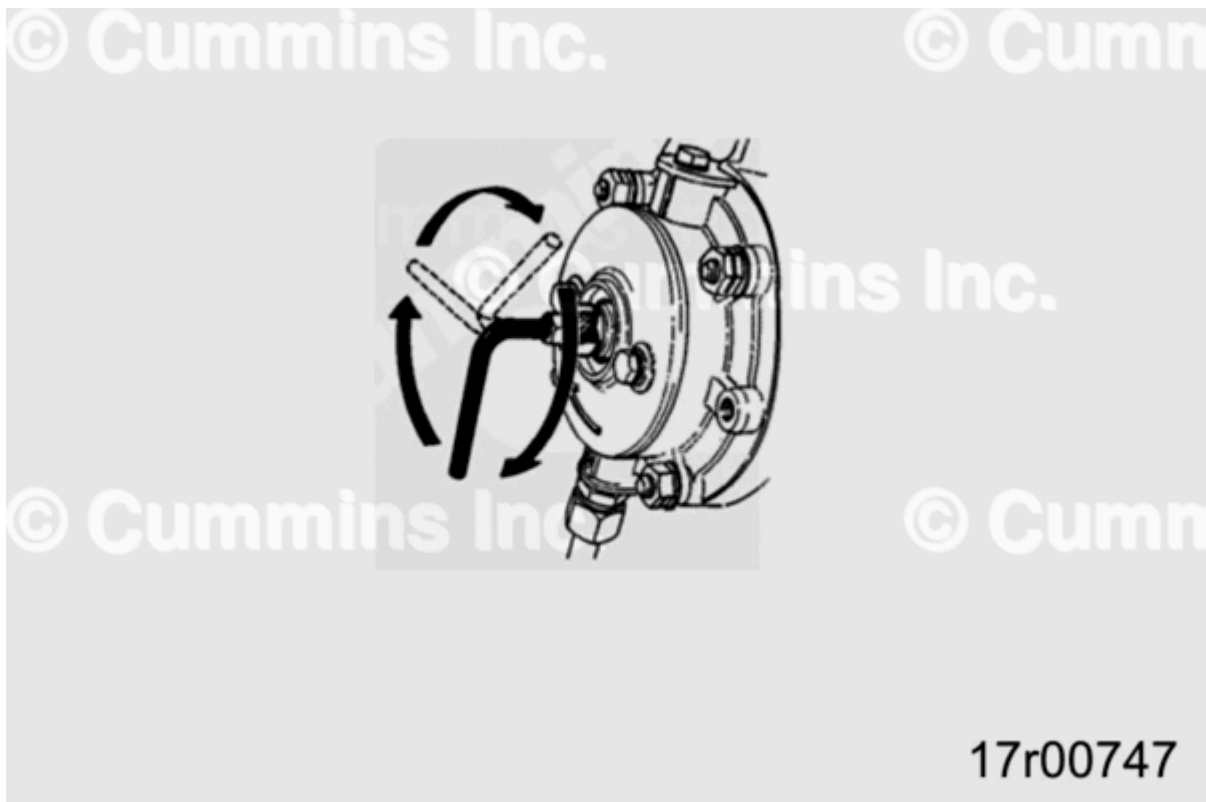


Figure 1, Hydraulic Motor

The following are given as a guide for a normal operating condition:

- Engine at idle: 10 minutes maximum

- Engine at max RPM: 5 minutes maximum

Note : If the operating indicator does **not** rotate, or the time for one revolution is more than indicated above, check the pressure drop and make a note of the value. Under normal operating conditions, the value **must not** exceed 12 psi.

Resolution

If the motor is found to not function as intended, it **must** be replaced with a new or reconditioned part.

Description of Change

This document announces a new hydraulic motor for the Eliminator. This includes changes internally to the motor to increase its capability.

Reason for Change

The part has been changed due to the hydraulic motor failing, preventing it from rotating the filtering elements. This causes excessive residue to build up and results in the eliminator failing to filter the oil effectively.

Service Instructions

The hydraulic motor is no longer a serviceable item. If it fails or reaches end of life, it should **not** be disassembled. It **must** be replaced with a new or reconditioned part.

Service Parts Availability

Service parts are available. Eliminator Assemblies are **not** specific to engine K models or ECM models. To simplify Table 1 **only** the engine platform is communicated.

Table 1, Service Parts					
Engine Platform	Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
NA	Hydraulic Motor	5540800	Yes	Yes	6660301
QSK38M	New Eliminator Assembly	5540799	Yes	Yes	6660263
	ReCon Eliminator Assembly	5540799RX	Yes	Yes	6660263RX

Table 1, Service Parts					
Engine Platform	Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
QSK38	New Eliminator Assembly	5540798	Yes	Yes	6660283
QSK50	ReCon Eliminator Assembly	5540798RX	Yes	Yes	6660283RX
QSK45	New Eliminator Assembly	5540797	Yes	Yes	6660291
	ReCon Eliminator Assembly	5540797RX	Yes	Yes	6660291RX
QSK60	New Eliminator Assembly	6373355	Yes	Yes	6660293
	ReCon Eliminator Assembly	6373355RX	Yes	Yes	6660293RX
QSK78	New Eliminator Assembly	6429905	Yes	Yes	6660297
QSK95	New Eliminator Assembly	5578723	Yes	Yes	6660299
	ReCon Eliminator Assembly	5578723RX	Yes	Yes	6570452RX
Historical Changes					
NA	Hydraulic Motor	3631958	Yes	Yes	5540800

Part Compatibility

This part is fully backwards compatible to all eliminators fitted with the existing part number.

Part Identification

The two motors are only distinguishable by their stamped part numbers. The part numbers are marked on the motor and is their **only** identifier. The stamped designation "CK" identifies the latest part number motor. The "CK" stamping is only visible when the motor is removed. See Figure 2. The Cummins part number is not stamped onto the motor.



Figure 2, Eliminator Motor "CK" Marking Location (Previous version shown "CJ" for this example)

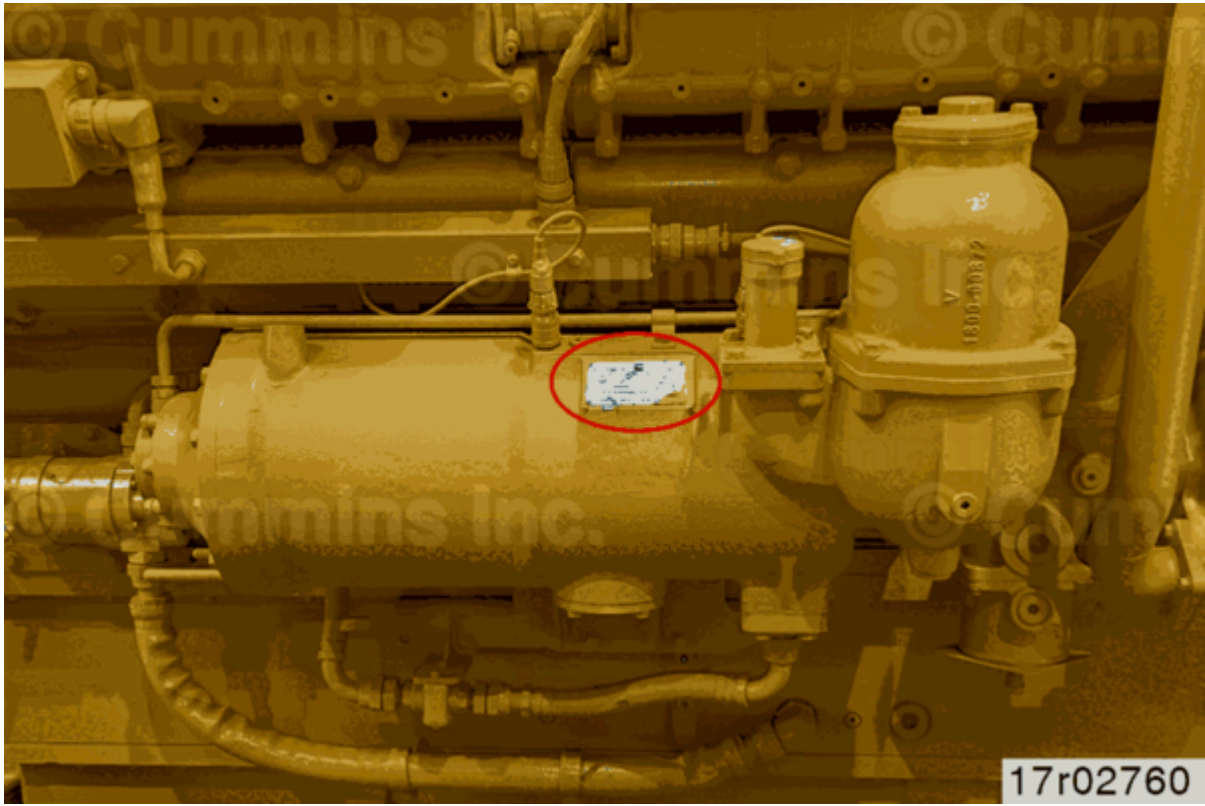


Figure 3, Eliminator Dataplate Position

Part Inventory Action

Existing Eliminator assembly stock to be scrapped. New parts to be purchased under new or RX part numbers.

Existing Eliminator motor stock to be used up before using new part number stock.

Publications Affected / Associated Publications

Eliminator™ Filter Service Bulletin, Bulletin Number 3666253, applicable to all engines fitted with Eliminator™.

Document History

Date	Details
2020-5-12	Module Created
2026-7-31	Added models and updated part identification.

