



Technical Service Bulletin

Technical Service Bulletin: TSB210042

Released Date: 06-Apr-2022

New Exhaust V-band Clamp

New Exhaust V-band Clamp

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK50 CM2150
- QSK50 CM2350 K108
- QSK50 CM850
- QSK60 CM2150
- QSK60 CM2250
- QSK60 CM2350 K116
- QSK60 CM2350 K117
- QSK60 CM2350 K121
- QSK60 CM2350 K135
- QSK60 CM2350 K136
- QSK60 CM500

Description of Change

- An alternative V-band clamp is available which utilizes a larger diameter bolt and improved bolt material.
- The new V-band clamp bolt uses A286 material compared to 410SS in the existing design which is less susceptible to corrosion and cracking under increased loads.

Reason for Change

V-band bolts have been fracturing, leading to exhaust leaks.

Service Instructions

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Exhaust V-band Clamp	3089765	No	Yes	4936174

Part Identification

The alternate V-band clamp has a larger cut out in the strap as shown and has a different part number stamped on the strap.

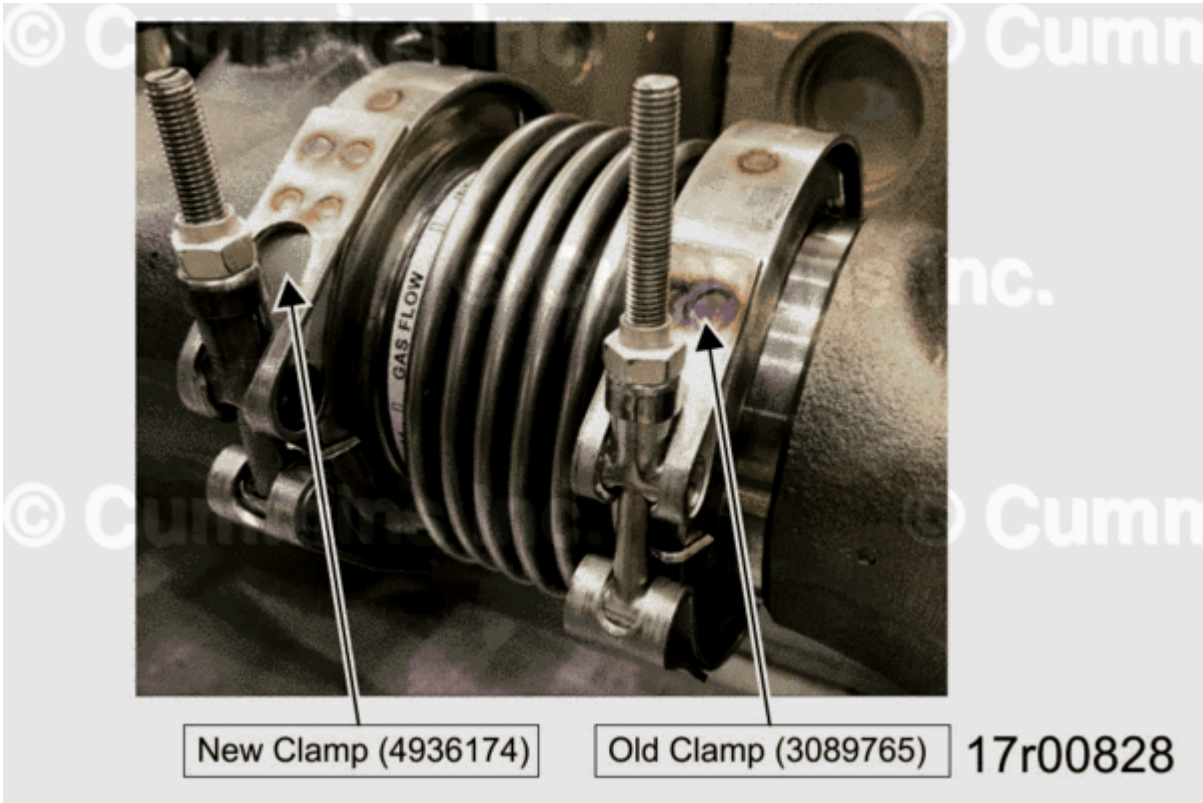


Figure 1, New and Old V-band Clamp.

Production Status

Implemented for production. See Table 2.

Table 2, Production Information		
ESN First	Build Date ¹	Plant
33223962	5 February 2021	Daventry
85012063	22 March 2022	CPG India

Publications Affected

Table 3, Publications Affected				
Manual Type	Engine	Bulletin Number	Procedure	Section
Service Manual	QSK60 CM500,850,2150	4021530	Refer to Procedure 011-007 (/qs3/pubsys2/xml/en/procedures/56/56-011-007.html)	11
Service Manual	QSK60 CM2250 K112	4367454	Refer to Procedure 011-007 (/qs3/pubsys2/xml/en/procedures/343/343-011-007.html)	11
Service Manual	QSK60 CM2350 K116	4367444	Refer to Procedure 011-007 (/qs3/pubsys2/xml/en/procedures/376/376-011-007.html)	11
Service Manual	QSK60 CM2350 K117	4367449	Refer to Procedure 011-007 (/qs3/pubsys2/xml/en/procedures/376/376-011-007.html)	11
Service Manual	QSK60 CM2350 K121	4388645	Refer to Procedure 011-007 (/qs3/pubsys2/xml/en/procedures/367/367-011-007.html)	11
Service Manual	QSK60 CM2350 K135	5504626	Refer to Procedure 011-007 (/qs3/pubsys2/xml/en/procedures/587/587-011-007.html)	11
Service Manual	QSK60 CM2350 K136	5504631	Refer to Procedure 011-007 (/qs3/pubsys2/xml/en/procedures/589/589-011-007.html)	11

Document History

Date	Details
2021-2-17	Module Created
2022-4-6	Updated Table 2 with ESN 85012063.

Last Modified: 06-Apr-2022
