



Technical Service Bulletin

Technical Service Bulletin: TSB220022

Released Date: 04-Oct-2024

Engine Control Module (ECM) Will Not Communicate or Will Not Accept ECM Calibration Code

Engine Control Module (ECM) Will Not Communicate or Will Not Accept ECM Calibration Code

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

Note : ROM Booted CM2180 ECM should not attempt to be recovered by recalibrating. See Technical Service Bulletin, INSITE™ Electronic Service Tool Error 5080 - Electronic Control Module (ECM) ROM-Booted or ROM-Booted in a Password Protected State, TSB150120.

All models with Engine Control Modules (ECM) except CM420 (B5.9G, B5.9LPG, C8.3G, L10G), ECM B (CELECT™), CM400 (CENTRY™), CM800 (ISBe, ISB four-cylinder), and CM551D (ISB light-duty Chrysler™).

Applicable Engine Control Modules:

- CM2150
- CM2180/CM2380
- CM2220
- CM2250
- CM2330
- CM2350/CM2450
- CM2450
- CM2358A
- CM2620
- CM2670
- CM2880
- CM3230
- CM500
- CM550
- CM552

- CM554
- CM556B
- CM558
- CM570
- CM700
- CM850
- CM870
- CM871
- CM875
- CM876
- ECM C

Issue Summary

Some ECMs have been replaced and Cummins Inc. has determined a portion of them were operating properly after being reset and calibrated. Unnecessary replacements of functional ECMs can be avoided by following the ROM boot and calibration procedures listed in this document.

Symptom:

- No communication with ECM
- ECM does **not** accept ECM calibration code

Root Cause:

- ECM calibration was **not** performed correctly
- Power or communication interruption during ECM calibration
- Incorrect ECM calibration code

Verification

Verify there is no communication with the ECM or that the ECM will **not** accept a calibration code.

Resolution

Before replacing the ECM, reset the ECM using the ROM boot process and attempt to recalibrate the ECM.

- Reset the ECM software using the ROM boot procedures listed in Table 1 and verify that INSITE™ shows a similar message as in Figure 1 below.
- Recalibrate the ECM using the ECM calibration procedures listed in Table 1 below.
- For general tool information, including the correct installation configuration and required cables, see the ECM-specific Bench Calibration Base Harness Service Tool Instruction, Bulletin 3377791.
- If the bench calibration base harness or any of the required hardware is **not** available, follow the technical escalation process.

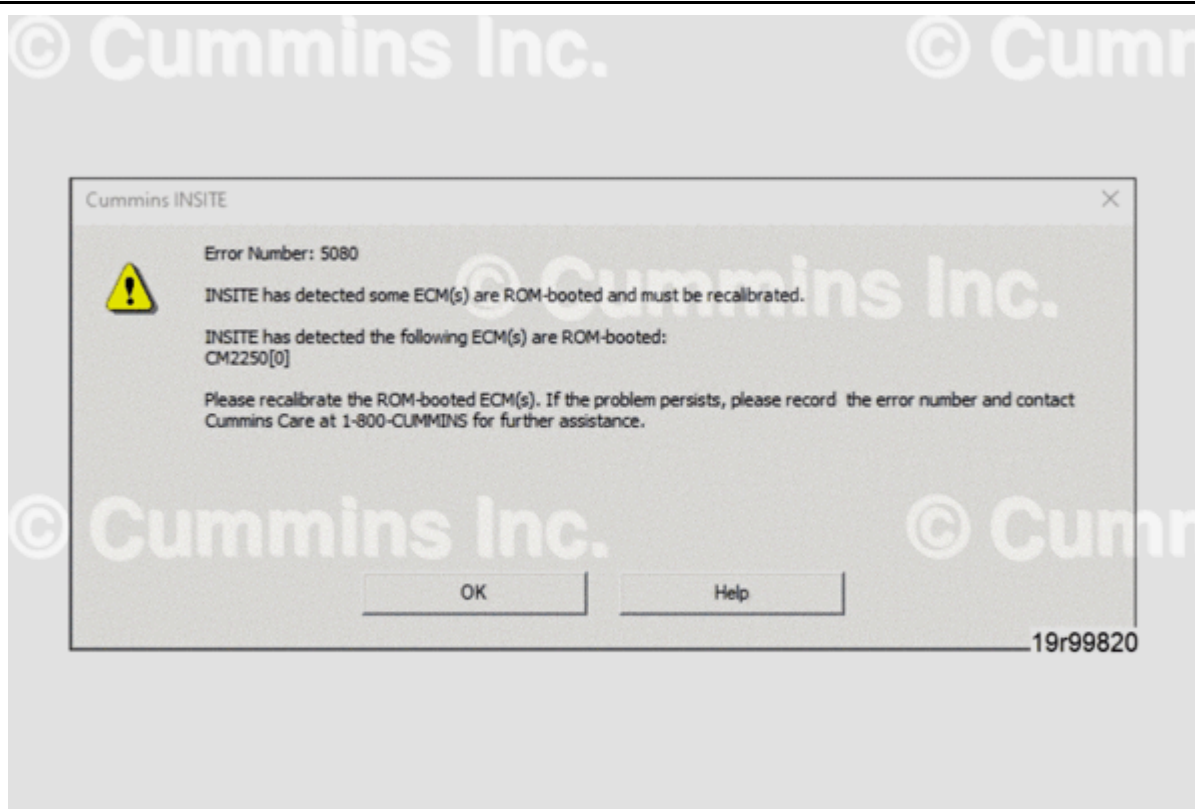


Figure 1, Example of the Error Message From INSITE™ Confirming the ECM Is Rom-Booted and Needs Recalibration.

Associated Publications

Table 1, ECM Associated Publications

Publication Type	Bulletin Number	Procedure Title	Procedure	Section
ECM ROM Boot				
Service Manual	See corresponding Service Manual	Engine Control Module ROM Boot	019-427	19
Electronic Control System Troubleshooting and Repair Manual	See corresponding Electronic Control System Troubleshooting and Repair Manual	Engine Control Module ROM Boot	019-427	19

Table 1, ECM Associated Publications				
Publication Type	Bulletin Number	Procedure Title	Procedure	Section
Technical Service Bulletin	TSB150120	INSITE™ Electronic Service Tool Error 5080 - Electronic Control Module (ECM) ROM-Booted or ROM-Booted in a Password Protected State	-	-
ECM Calibration				
Service Tool Instruction	3377791	ECM Bench Calibration Base Harness	-	-
Service Manual	See corresponding Service Manual	Engine Control Module Calibration Code	019-032	19
Electronic Control System Troubleshooting and Repair Manual	See corresponding Electronic Control System Troubleshooting and Repair Manual	Engine Control Module Calibration Code	019-032	19

Document History

Date	Details
2022-2-2	Module Created
2024-10-4	No changes made to tsb content.

