



Technical Service Bulletin

Technical Service Bulletin: TSB240059

Released Date: 18-Mar-2024

Repair Strategy for Fuel Lift Pump Relay and Wiring Harness: Fault Codes 583, 2265, 2266

Repair Strategy for Fuel Lift Pump Relay and Wiring Harness: Fault Codes 583, 2265, 2266

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QST30 CM552

Issue Summary

Symptom:

- Burned or malfunctioning fuel lift pump relay.
- Engine Difficult to Start or Will Not Start (No Exhaust Smoke)
- Potential fault codes:
 - 583
 - 2265
 - 2266

Verification

After following the published troubleshooting manual procedures, if a fuel lift pump relay is found to be dysfunctional, inspect the fuel lift pump relay and wiring harness connector for signs of heat damage, such as melted plastic.

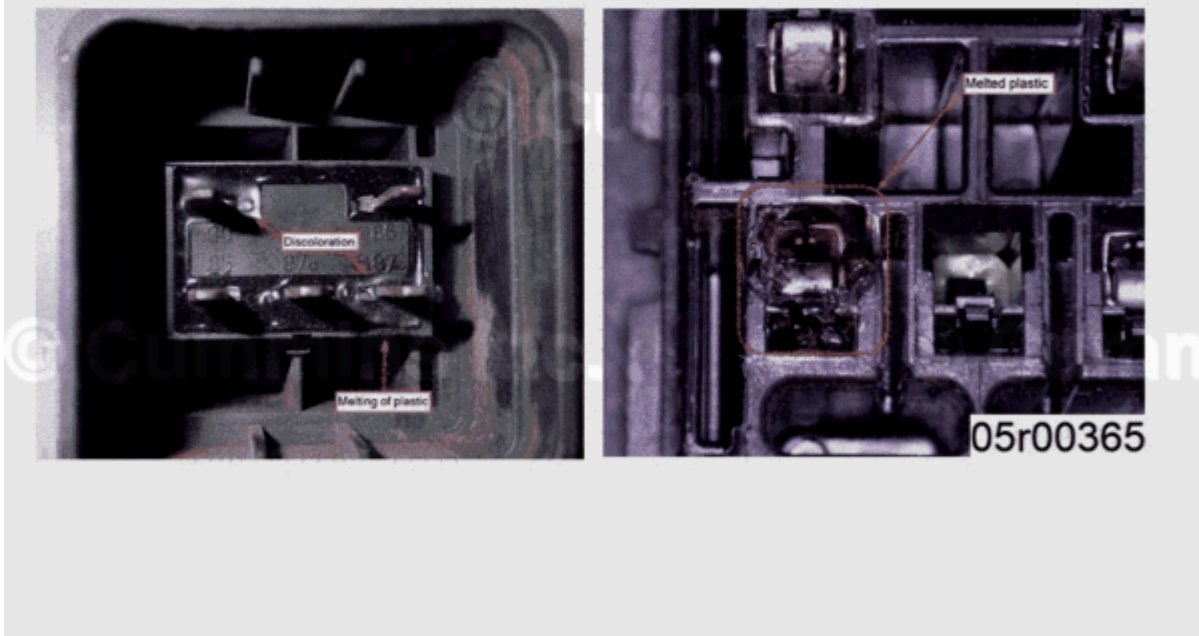


Figure 1, Examples of Burned Fuel Lift Pump Relay and Wiring Harness Connector.

Resolution

If any signs of heat damage are present on either the fuel lift pump relay and/or the wiring harness connector, replace both the fuel lift pump relay and wiring harness.

Document History

Date	Details
2024-3-12	Module Created

Last Modified: 18-Mar-2024