



Technical Service Bulletin

Technical Service Bulletin: TSB240188

Released Date: 16-Oct-2025

New Electric Fuel Lift Pump System

New Electric Fuel Lift Pump System

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QST30 CM552
- QST30 CM850

Description of Change

A new electric fuel lift pump system has been released for the product affected. This change includes a new supplier for the fuel lift pumps, an increase from two to three fuel lift pumps per engine, and new relevant hardware. See Table 3. These new fuel lift pumps are added to the Operation and Maintenance Manual, Bulletin 3666134, as maintenance items.

Service Instructions

Select the Lift Pump Base Service Kit, Filter Bracket, and Service Wiring Harness from Table 1 needed for the relevant application and configuration. See corresponding Service Manual. Reference Procedure 005-045 in Section 5, for removal, clean and inspect, and install instructions for the fuel lift pumps. Reference procedure 006-017 in section 6 of the corresponding service manual for removal, clean and inspect and install instructions for the fuel filter head. For new conversions, reference procedure 006-017 in Section 6 of the corresponding service manual for the removal of the old hardware. Reference both procedures 005-045 and 006-017 in Sections 5 and 6 of the corresponding service manual for the installation of the new hardware.

Table 1, Kits/Parts Needed for Conversion from Two-Pump to Three-Pump System

Application/Configuration	Description	Part Number
Base Kit		
All	Fuel Lift Pump Base Service Kit	6563609
Filter Bracket		

Table 1, Kits/Parts Needed for Conversion from Two-Pump to Three-Pump System		
Application/Configuration	Description	Part Number
Engines built with one of the options: • FF 5079 • FF 5080 • FF 5086 • FF 5088 • FF 5105 • FF 5107 • FF 5108	Filter Bracket (See Figure 1 in Part Identification section)	6426058
Engines built with one of the options: • FF 5081 • FF 5106	Filter Bracket with Air Plumbing Support (See Figure 2 in Part Identification section)	6426729
Service Wiring Harness		
PowerGen (12V System)	Wiring Harness (2 pump to 3 pump – PG 12V to 24V)	6470469
PowerGen (24V System)	Wiring Harness (2 pump to 3 pump – PG 24V)	6470470
Industrial (12V or 24V System)	Wiring Harness (2 pump to 3 pump – IND)	6474493
Table 2, Kits Needed for Fuel Pump Head Reassembly (No Malfunctioning Fuel Lift Pumps)		
Description	Part Number	Quantity
Lift Pump Consumables Kit (3 sets of isolators and seals)	6563611	1
Table 3, Kit Needed for Routine Maintenance and Malfunction Replacements		
Description	Part Number	Quantity
Lift Pump Replacement Kit (Consumables Kit + 3 Fuel Lift Pumps)	6563610	1
For field repairs, all three fuel lift pumps must be replaced if one or more fuel lift pump malfunctions. Service Parts		

Service parts are offered. See Table 4 for part numbers.

Table 4, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Fuel Lift Pump	5483862	No	Yes	6413638
Fuel Filter Head	5483701	No	Yes	6425066
Fuel Pump Head	5483705	No	Yes	6425068
Vibration Isolator	4067902	No	Yes	6425064
Filter Bracket	4295451	No	Yes	6426058
Filter Bracket with Air Plumbing Support	4975740	No	Yes	6426729
Wiring Harness (2 pump to 3 pump – PowerGen 12V to 24V)	-	-	-	6470469
Wiring Harness (2 pump to 3 pump – PowerGen 24V)	-	-	-	6470470
Wiring Harness (2 pump to 3 pump – Industrial)	-	-	-	6474493
Fuel Pump Kit	5593523	Yes	No	See Table 1
Lift Pump Base Conversion Kit	-	-	-	6563609
Lift Pump Consumables Kit (3 sets of isolators and seals)	-	-	-	6563611

Part Inventory Action

Use existing part number inventory before using the new part number.

Production Status

Implemented for production. See Table 5.

Table 5, Production Information

Application	ESN First	Build Date ¹	Plant
PowerGen	37295184	4 October 2024	Seymour Engine Plant
Industrial	37295256	14 October 2024	Seymour Engine Plant

¹Engine build date can be found on the engine dataplate.

Publications Affected

Table 5, Publications Affected

Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Service Manual	QST30	4021539	Fuel Lift Pump	Refer to Procedure 005-045 (/qs3/pubsyss2/xml/en/procedures/57/57-005-045-tr.html)	5
Operations and Maintenance Manual	QST30	3666134	Maintenance Schedule	Refer to Procedure 102-002 (/qs3/pubsyss2/xml/en/procedures/57/57-102-002-om.html)	2
Operations and Maintenance Manual	QST30	3666134	Fuel Lift Pump	Refer to Procedure 005-045 (/qs3/pubsyss2/xml/en/procedures/57/57-005-045-om.html)	6

Part Identification



Figure 1, Filter Bracket, Part Number 6426058.

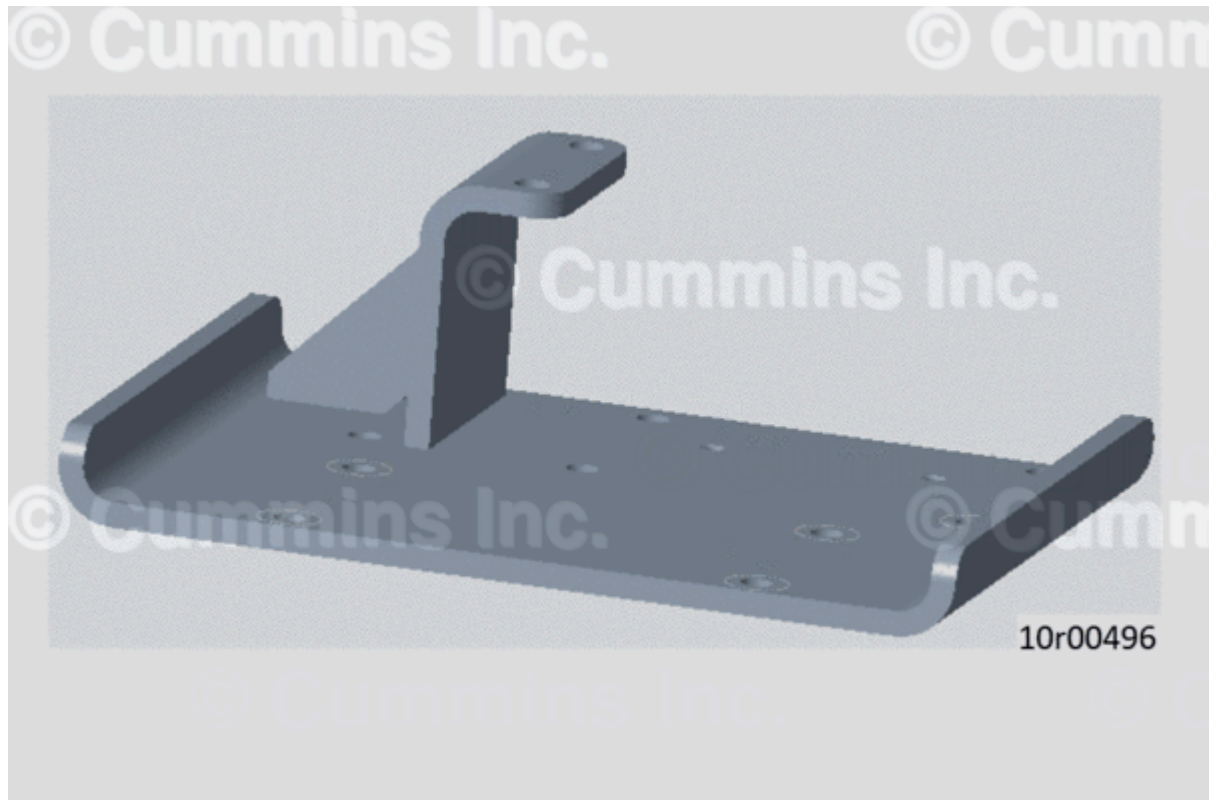


Figure 2, Filter Bracket with Air Plumbing Support, Part Number 6426729.

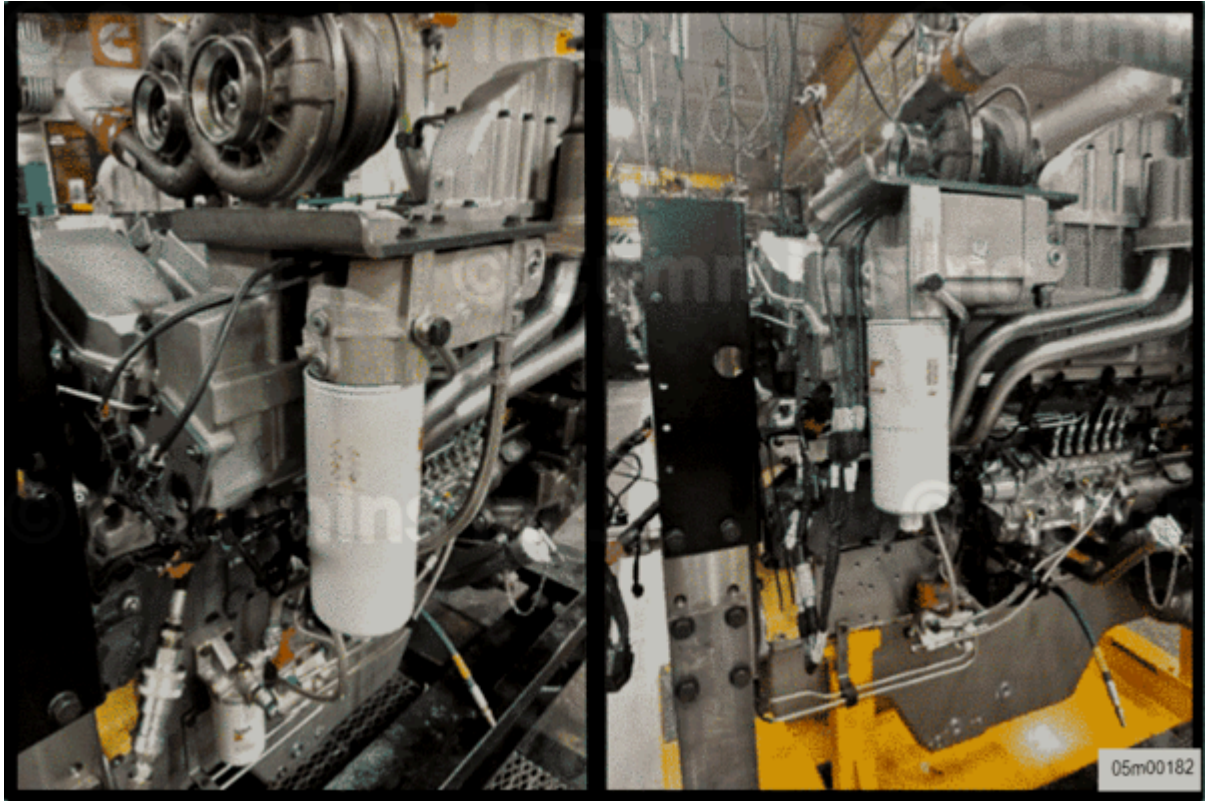


Figure 3, Comparison of Installed Two-Pump (Left) and Three-Pump (Right) Systems.

Document History

Date	Details
2024-9-23	Module Created
2024-11-18	Non-Product Problem Solving (PPS)
2025-1-14	Updated Table 1 and Table 3. Added Part Identification section.
2025-6-16	Updated Table 2 and field repair statement.
2025-10-15	Non-Product Problem Solving (PPS)