



Technical Service Bulletin: TSB250112

Released Date: 16-Jun-2025

Lubricating Oil Leaks from Turbocharger Compressor Outlet

Lubricating Oil Leaks from Turbocharger Compressor Outlet

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QST30 CM552

Issue Summary

Symptom:

- External lubricating oil leak from turbocharger compressor outlet and/or air crossover inlet

Root Cause:

- With prolonged operation in low-load and low-speed conditions, lubricating oil can accumulate in the turbocharger bearing housing and leak past the turbocharger compressor seal, leaking externally at the air crossover hose connection between the turbocharger compressor outlet and air crossover inlet.

Verification

Visually inspect the turbocharger compressor outlet, air crossover inlet and air crossover hose for signs of an external lubricating oil leak.

Resolution

Fast-setting RTV is to be applied to the hose connections at the turbocharger compressor outlet and air crossover inlet. Reference Service Instruction section.

Service Instruction

Reference the steps below for the bank(s) leaking lubricating oil:

- Loosen the T bolt clamps (1) on the air crossover hose (2).
- Refer to Procedure 010-019 (</qs3/pubsys2/xml/en/procedures/57/57-010-019-tr.html>) in Section 10 to remove the air crossover.

- Remove the T bolt clamps (1) from the air crossover hose (2) and remove the hose from the turbocharger compressor outlet (4).
- Clean the outer surfaces of the air crossover inlet (3) and turbocharger compressor outlet (4).
- Clean the inner surface of the air crossover hose (2).
- Apply a bead of Loctite RTV Gasket Maker: SI 587, Part Number 135504, or equivalent, to the outer surface of the air crossover inlet (3) and the turbocharger compressor outlet (4) behind the lip of the inlet/outlet.
- Install the air crossover hose (2) onto the turbocharger compressor outlet (4).
- Loosely install the T bolt clamps (1) onto the hose (2).
- Refer to Procedure 010-019 (/qs3/pubsys2/xml/en/procedures/57/57-010-019-tr.html) in Section 10 to install the air crossover (3).

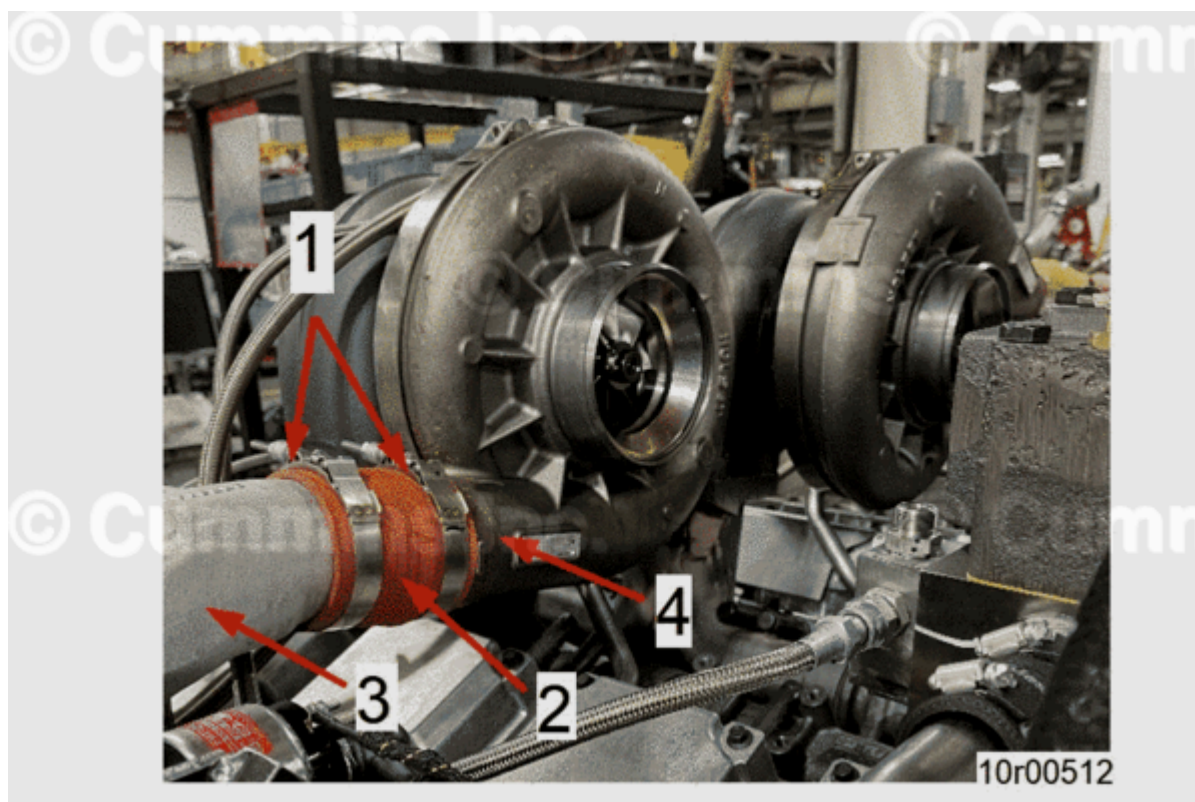


Figure 1, Example of Turbocharger Joint (LB shown).

Document History

Date	Details
2025-5-30	Module Created

