



Technical Service Bulletin: TSB250191

Released Date: 09-Dec-2025

Fuel Injection Pump Bracket Countermeasure

Fuel Injection Pump Bracket Countermeasure

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QST30 CM552

Issue Summary

Symptom:

- Fuel injection pump mounting bracket and P-clip capscrew loosens, sometimes leading to fuel injection mounting bracket fracture (see Figure 1).



Figure 1, Example of loosened capscrew and broken fuel injection mounting bracket

Root Cause:

- The isolated spot-facing of the fuel injection mounting bracket creates a step that interferes with the P clip seating, leading to bending of the P-clip, progressive preload loss of the joint, capscrew loosening and possible fuel injection mounting bracket fracture.
 - In some instances, some fuel injection mounting brackets have been installed without the washer between the P clip and capscrew head included.

Verification

This issue pertains to any engine built with fuel injection mounting bracket Part Number 3093263 with a P-clip mounted in the location shown in Figure 2. This will be found on the left bank side of the engine.

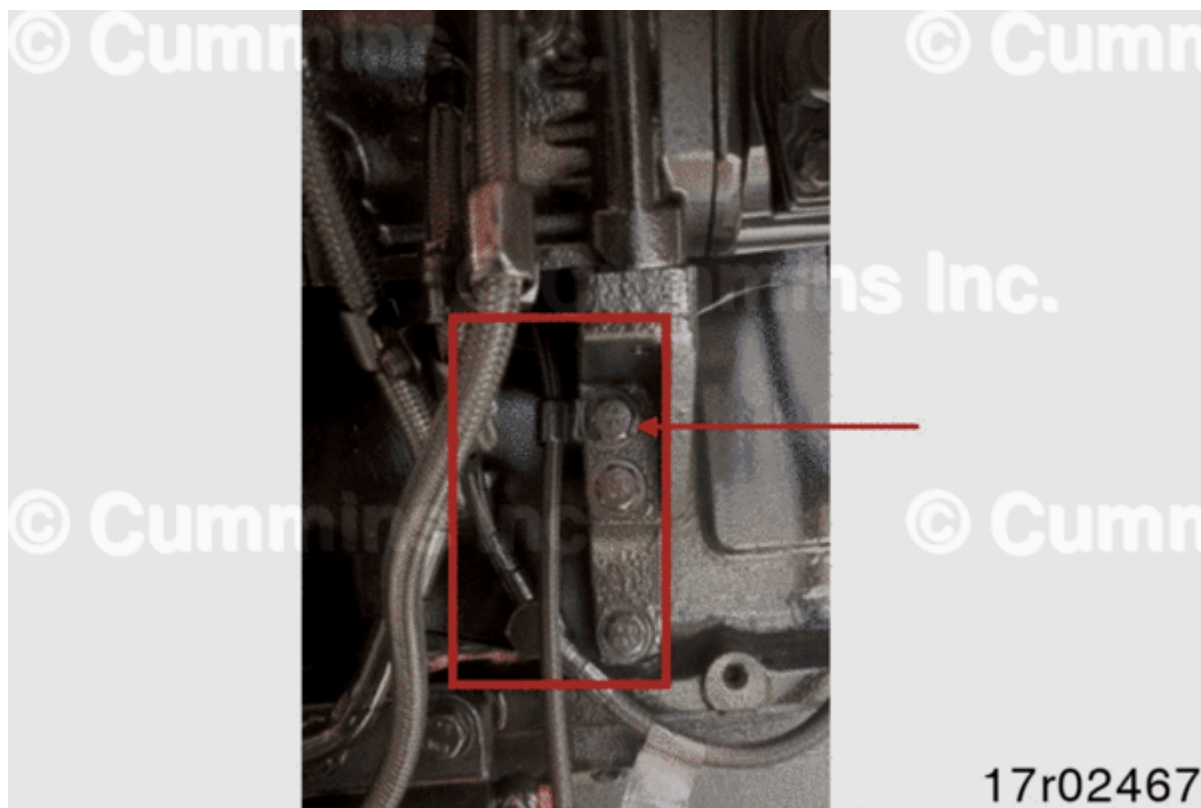


Figure 2, Example of P-clip mounting location

Resolution

First, verify there is a washer present between the P-clip and capscrew head. If there is no washer present, washer Part Number 3094024 (1), will need to be installed between the capscrew head and P-clip.

Additionally, washer Part Number 3093799 (2), should be installed between the P-clip and the fuel injection mounting bracket surface, as shown in Figure 3.

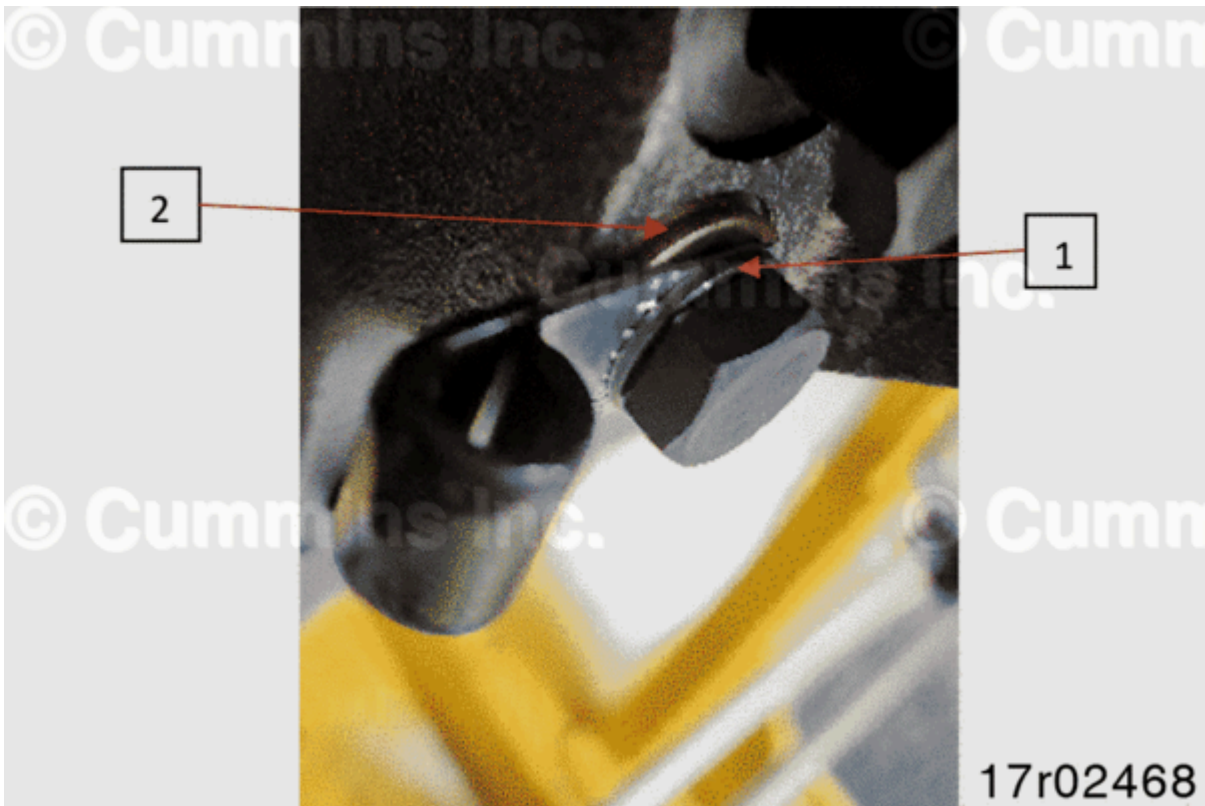


Figure 3, Washer Countermeasure Installation

Production Status

Implemented for production. See Table 1.

Table 1, Production Information

ESN First	Build Date ¹	Plant
37297911	3 September 2025	Seymour Engine Plant

¹Engine build date can be found on the engine dataplate.

Document History

Date	Details
2025-10-13	Module Created
2025-11-27	Added Production Status

