



Technical Service Bulletin

Technical Service Bulletin: TSB250205

Released Date: 09-Dec-2025

Belt Guard Noise

Belt Guard Noise

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QST30 CM552

Issue Summary

Symptom:

- Loud rattling noise coming from front of engine.

Root Cause:

- Loose/cracked belt guard.

Verification

- Verify the belt guard has loose capscrews or cracks in belt guard.

Resolution

If a loose belt guard is observed, the belt guard can be removed and reinstalled with alternate isolators. If the belt guard is also cracked, the belt guard should be replaced when the alternate isolators are installed. See QST30 Service Manual, Bulletin 4021539. Refer to Procedure 008-001 in Section 8 to remove belt guard. Follow modifications described in this bulletin to install the belt guard.

Service Instruction

See QST30 Service Manual, Bulletin 4021539. Refer to Procedure 008-001 in Section 8 to remove belt guard.

Install:

1. Install the capscrew assemblies onto the belt guard. The components **must** be in the order shown.

Three mounting locations will each use:

1. Part Number 3093807 – capscrew – quantity 1
2. Part Number 3643019 – retaining ring – quantity 1
(**Not** visible in picture, located between bracket and first washer)
3. Part Number 3035083 – vibration isolator – quantity 1
4. Part Number 3035084 – vibration isolator – quantity 1
5. Part Number 3033800 – washer – quantity 2

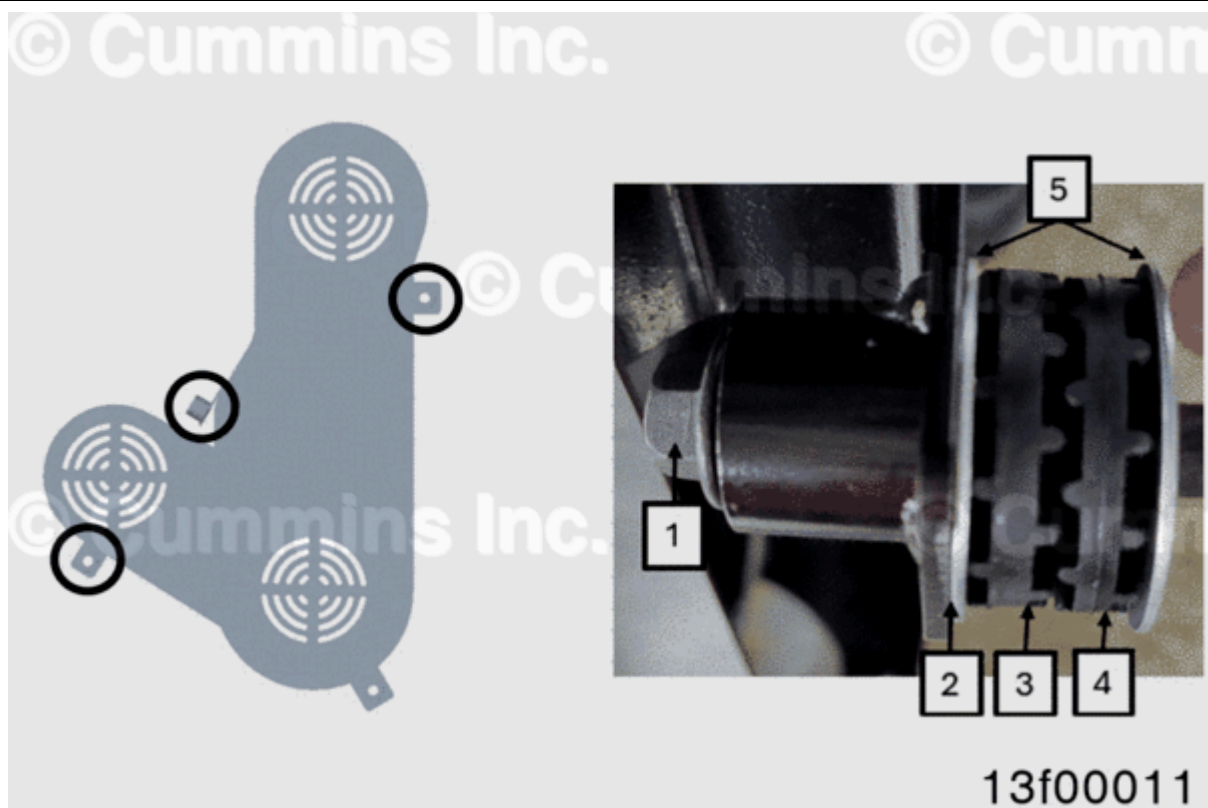


Figure 1, Capscrew Assembly with Three Mounting Locations

One mounting location (bottom) will use:

1. Part Number 3641716 – capscrew – quantity 1
2. Part Number 3643019 – retaining ring – quantity 1
(**Not** visible in picture, located between bracket and first washer)
3. Part Number 3035083 – vibration isolator – quantity 1
4. Part Number 3035084 – vibration isolator – quantity 1
5. Part Number 3033800 – washer – quantity 2
6. Part Number 3072999 – spacer – quantity 1

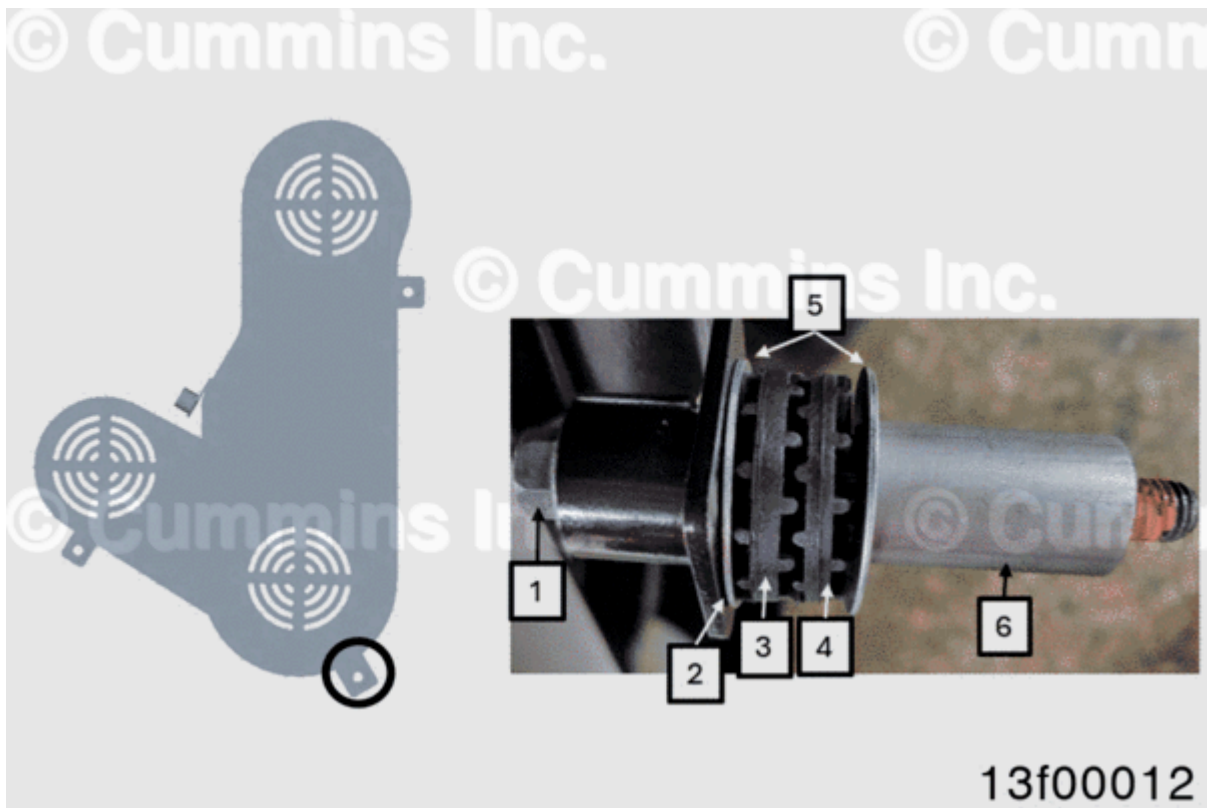


Figure 2, Capscrew Assembly with One Mounting Location

2. Apply Loctite to capscrews.
3. Install the belt guard.
4. Tighten the capscrew assemblies until the distance between the washers is 9.5 mm [0.37 in].

Service Parts

Service parts are offered. See Table 1 for part numbers.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Washer	3033800	No	No	N/A
Isolator	3035083	No	No	N/A
Isolator	3035084	No	No	N/A

Document History

Date	Details
2025-10-29	Module Created

Last Modified: 09-Dec-2025