



Technical Service Bulletin: TSB250219

Released Date: 09-Jan-2026

Low Temperature Aftercooler (LTA) Water Pump O-ring Oil Leak Countermeasure

## Low Temperature Aftercooler (LTA) Water Pump O-ring Oil Leak Countermeasure

### Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

### Contents

#### Product Affected

QST30 CM552

#### Issue Summary

Symptom:

- External oil leak from the LTA water pump-to-accessory drive joint.

Root Cause:

- The o-ring seal of this joint experiences temperature exposure beyond its material capabilities.

#### Verification

Verify you have an accessory drive-driven LTA water pump system, which includes options DF5749 or DF5752 paired with options TB5820 or TB5828

#### Resolution

As a countermeasure for this issue, replace failed seal part number 4025376 with seal part number 3033248, which has higher temperature exposure capabilities. See image 1 for referenced o-ring seal.

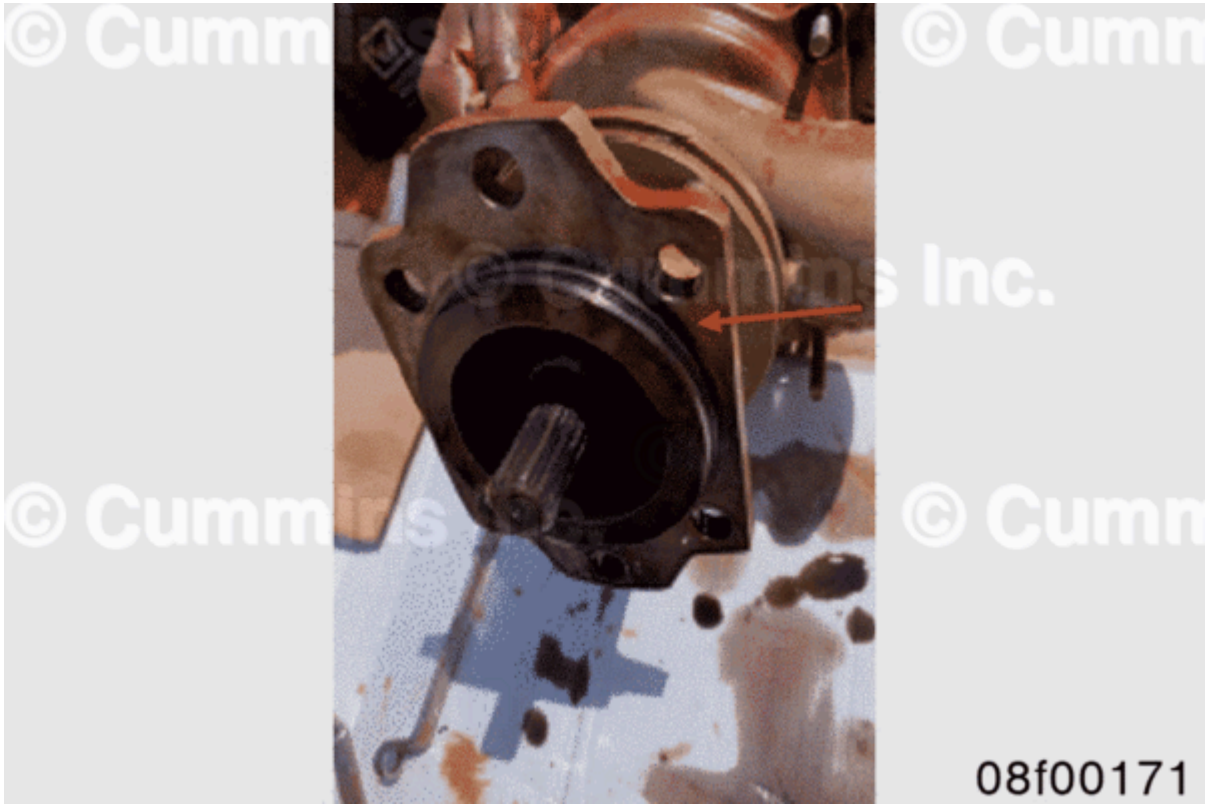


Figure 1, Example of LTA water pump mounting o-ring seal

**Service Parts**

Service parts are offered. See Table 1 for part numbers.

**Table 1, Service Parts**

| Part Description | Existing Part Number | Obsolete | Superseded | New Part Number |
|------------------|----------------------|----------|------------|-----------------|
| SEAL,O RING      | 4025376              | No       | No         | 3033248         |

**Document History**

| Date       | Details        |
|------------|----------------|
| 2025-11-27 | Module Created |