



Technical Service Bulletin: TSB260059

Released Date: 11-May-2026

Low-Temperature Aftercooler (LTA) Accessory Drive Housing Improvement

## Low-Temperature Aftercooler (LTA) Accessory Drive Housing Improvement

### Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

### Contents

#### Product Affected

- QST30 CM552
- QST30 CM2350 T101

#### Issue Summary

##### Symptom:

- Lubricating oil leak from joint between offset accessory drive and low temperature aftercooler (LTA) water pump drive.

##### Root Cause:

- Press in place seal installed incorrectly.
- Surface finish of offset accessory drive mating surface machined incorrectly.

#### Verification

Verify you have an accessory drive driven LTA water pump system, which includes DF5749 or DF5752 with options TB5820 or TB5828. Verify external lubricating oil leak originates from press in place seal joint and **not** from adjacent joints.

#### Resolution

Inspect offset accessory drive and LTA water pump drive for damaged threads and excessively rough sealing surfaces. Replace any damaged components. Replace press in place seal. Verify that press in place seal is fully seated in seal groove.

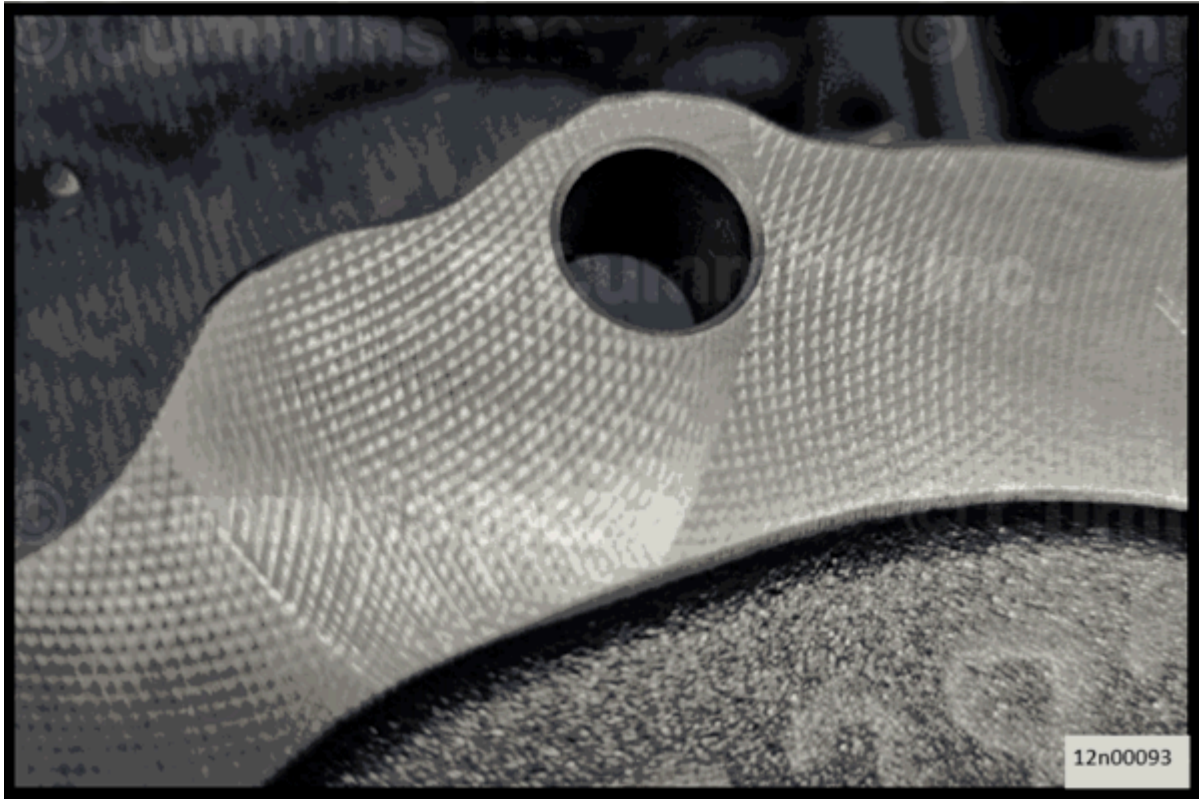


Figure 1, Example of Rough Sealing Surface on Accessory Drive

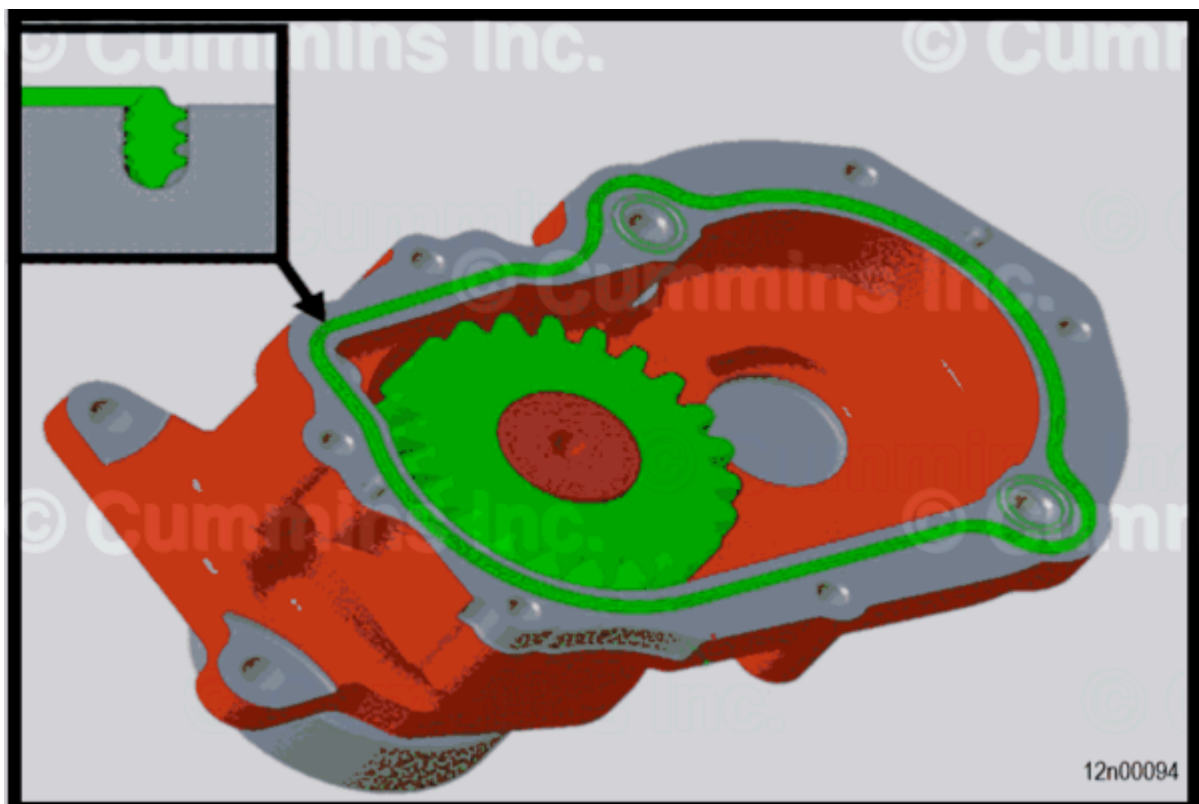


Figure 2, Press in Place Seal Fully Seated in Seal Groove

### Service Parts

Service parts are offered. See Table 1 for part numbers.

| Table 1, Service Parts  |                      |          |            |                 |
|-------------------------|----------------------|----------|------------|-----------------|
| Part Description        | Existing Part Number | Obsolete | Superseded | New Part Number |
| DRIVE, ACCESSORY        | 5415281              | No       | No         | N/A             |
| DRIVE, ACCESSORY        | 5409383              | No       | No         | N/A             |
| SEAL, RECTANGULAR STRIP | 4390009              | No       | No         | N/A             |
|                         |                      |          |            |                 |

| Production Status                                                |                         |                      |
|------------------------------------------------------------------|-------------------------|----------------------|
| Implemented for production. See Table 2.                         |                         |                      |
| Table 2, Production Information                                  |                         |                      |
| ESN First                                                        | Build Date <sup>1</sup> | Plant                |
| 37299741                                                         | 27 April 2026           | Seymour Engine Plant |
| <sup>1</sup> Engine build date can be found on engine dataplate. |                         |                      |
|                                                                  |                         |                      |

## Document History

| Date      | Details                         |
|-----------|---------------------------------|
| 2026-4-15 | Module Created                  |
| 2026-5-6  | Added Production Status section |