



Technical Service Bulletin

Technical Service Bulletin: TSB260089

Released Date: 22-Jun-2026

Vibration Damper Guard

Vibration Damper Guard

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QST30 CM552

Issue Summary

Symptom:

- Loud rattling noise coming from front of engine.

Root Cause:

- Loose/cracked vibration damper guard.

Verification

- Verify the vibration damper guard has loose capscrews or cracks in vibration damper guard.

Resolution

- If a loose or cracked vibration damper guard is observed, there is a new vibration damper guard available. The new vibration damper guard is made from thicker sheet steel and is modified so that isolators can be installed. Longer capscrews and washers are used with the isolators.

Service Instructions

Remove:

1. Remove the loose/cracked vibration damper guard.

Install:

1. Install the capscrew assemblies onto the vibration damper guard. The washer used varies by mounting location. The isolator **must** be located between the vibration damper guard and the engine.

The top mounting locations will each use:

- Part Number 3920447 – capscrew – quantity 1
- Part Number 4975786 – retaining ring – quantity 1 (**Not** visible in picture, locate between bracket and first washer)
- Part Number 3041247 – plain washer – quantity 1
- Part Number 3035083 – isolator – quantity 1

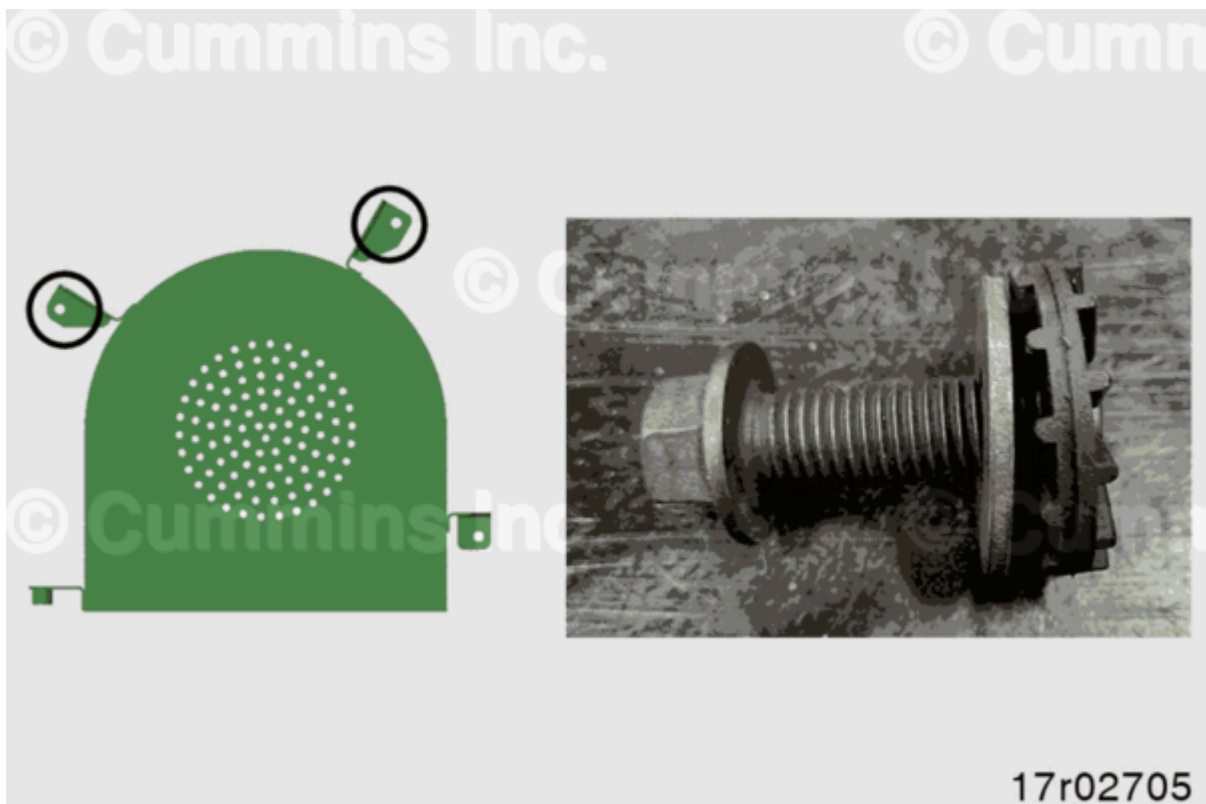


Figure 1, Capscrew Assembly for Top Mounting Locations

The bottom right mounting location will use:

- Part Number 3920447 – capscrew – quantity 1
- Part Number 4975786 – retaining ring – quantity 1 (**Not** visible in picture, locate between bracket and first washer)
- Part Number 3035806 – plain washer – quantity 1
- Part Number 3035083 – isolator – quantity 1

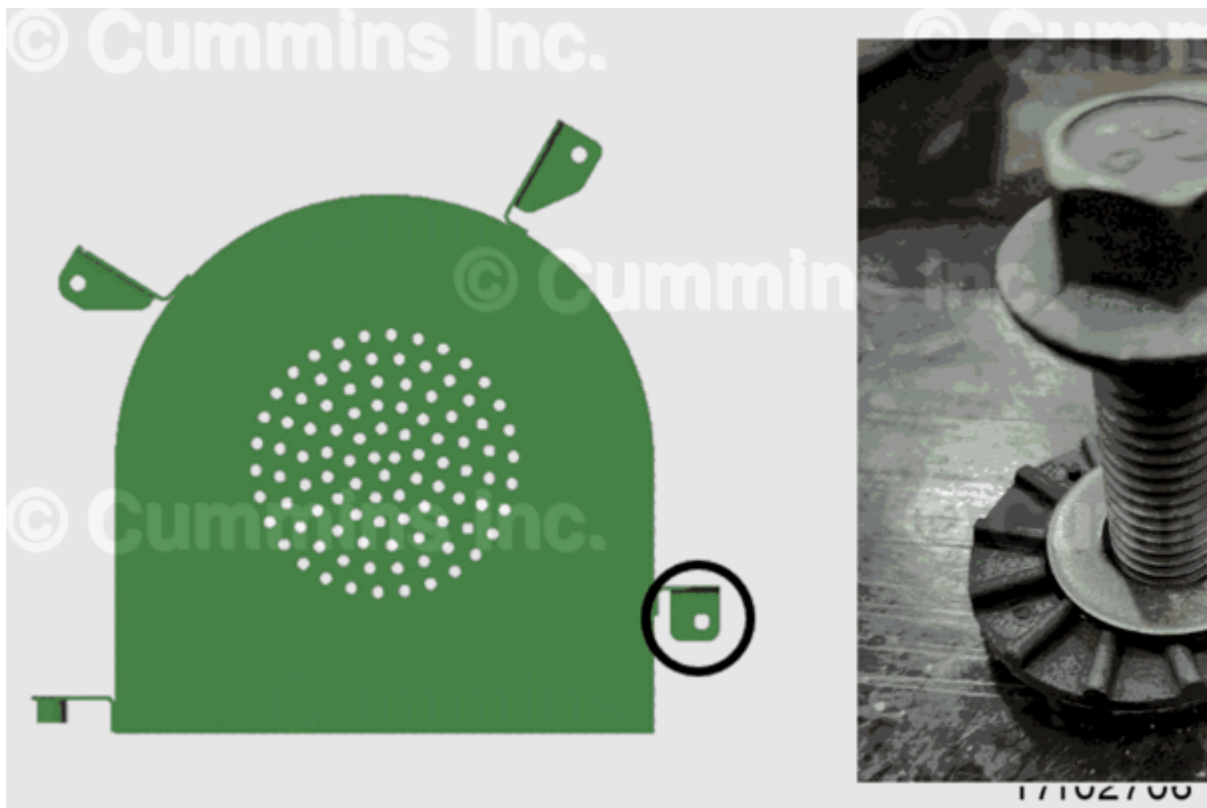


Figure 2, Capscrew Assembly for Bottom Right Mounting Location

The bottom left mounting location will use:

- Part Number 3920447 – capscrew – quantity 1
- Part Number 4975786 – retaining ring – quantity 1 (**Not** visible in picture, locate between bracket and isolator)
- Part Number 3035083 – isolator – quantity 1

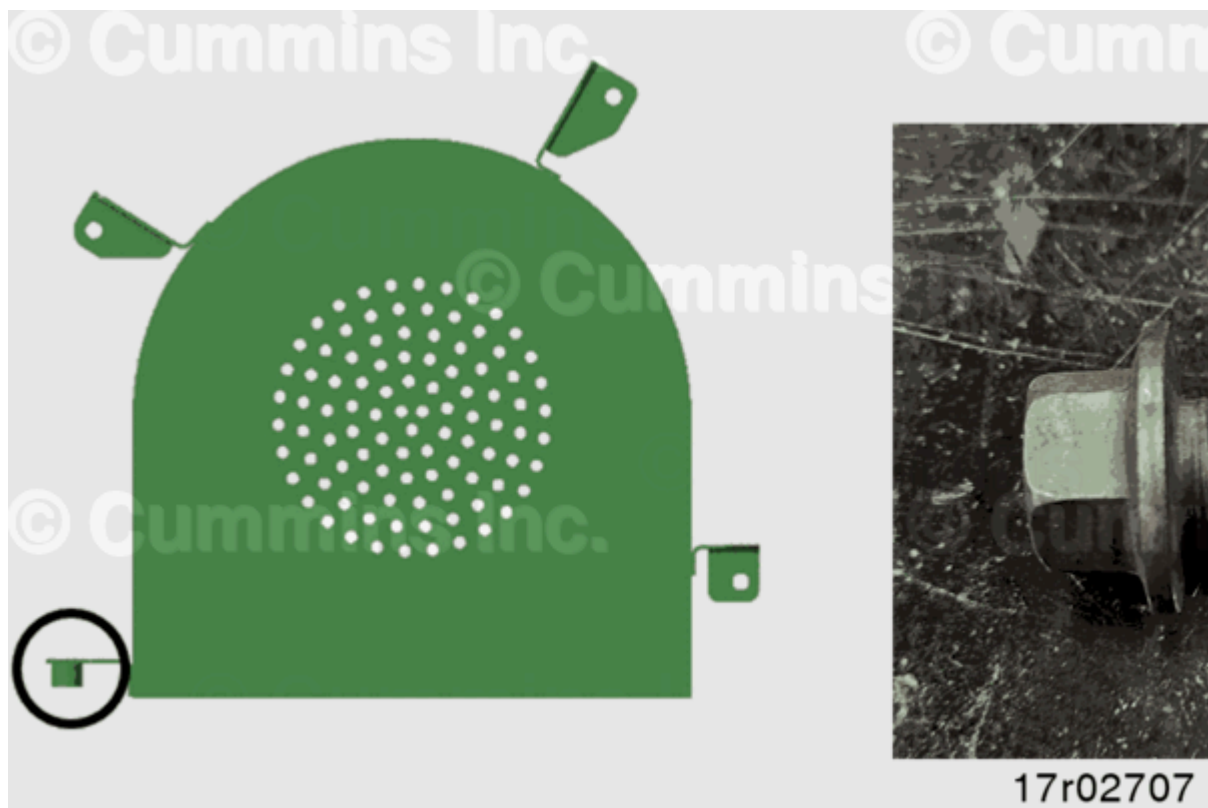


Figure 3, Capscrew Assembly for Bottom Left Mounting Location

2. Apply Loctite® to capscrew threads.
3. Position the vibration damper guard onto the engine and hand start the capscrews in the top mounting locations.
4. Hand start the capscrew in the bottom right location. The washer and isolator will be off center for clearance to the cover plate.
5. Hand start the capscrew in the bottom left location through the vibration damper guard and breather tube bracket.
6. Tighten capscrew assemblies until the isolator thickness is 2 mm [0.079 in] nominal.



Figure 4, Top Left Mounting Location after Install

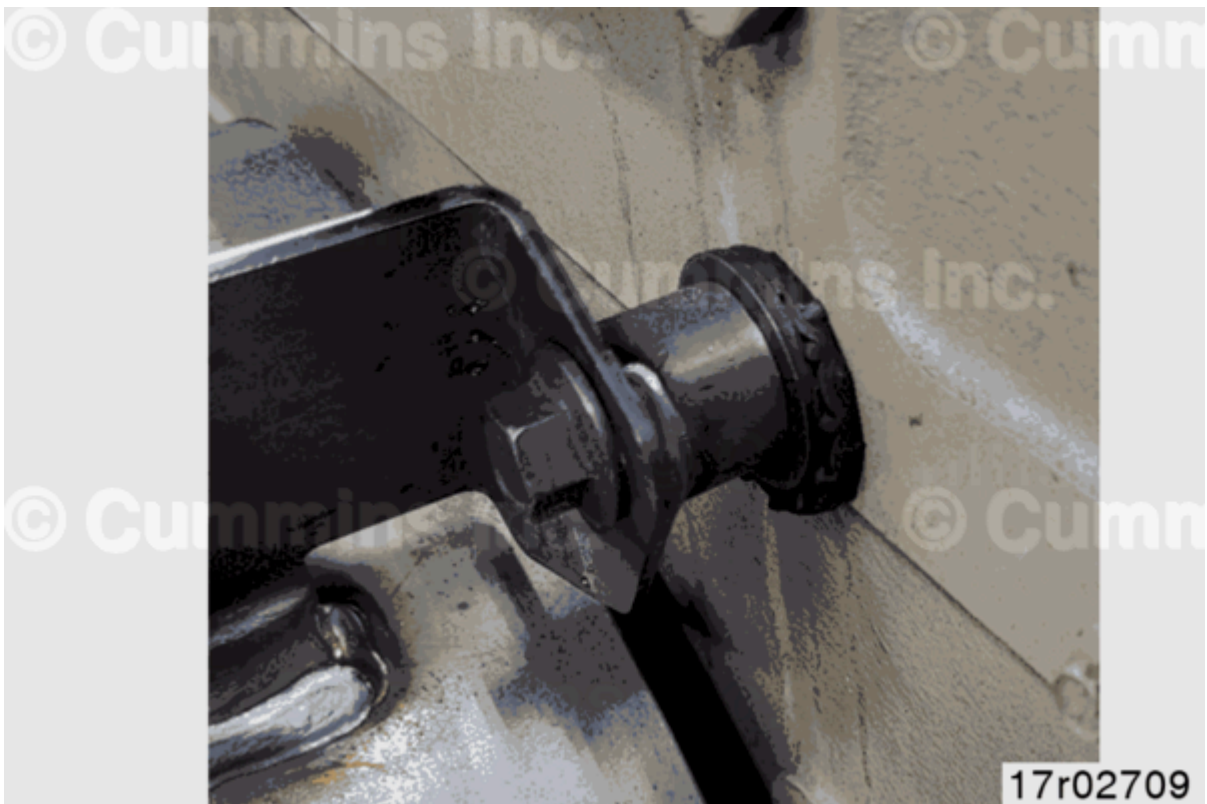


Figure 5, Top Right Mounting Location after Install



Figure 6, Bottom Right Mounting Location after Install



Figure 7, Bottom Left Mounting Location after Install

Service Parts

Service parts are offered. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Vibration Damper Guard	4975804	No	No	6636278
Isolator	-	No	No	3035083
Plain Washer	-	No	No	3035806
Plain Washer	-	No	No	3041247
Hex Flange Head Capscrew	3093939	No	No	3920447
Retaining Ring	4975786	No	No	4975786

Document History

Date	Details
2026-6-22	Module Created