

25 Toyota Crown Airbag Module Programming

1

Perform Health Check

Health Check Result

TIS : VOLTAGEDROPDIAG@GM

One Time Password - voltagedropdiag

ALLDATA Repair - Home

Scribe | Approve Device

127.0.0.1:50005/GetResource/gtsMain.html

Automotive Resour...

OEM Websites

Professional Training

Service Info - After...

Auto Rescue Tools

L1 Training - Login

J2534 - Facebook

Adobe Acrobat

TOYOTA | GTS+ ONLINE

VIM : Mongoose-Plus MFC3

Vehicle : NA

VOLTAGEDROPDIAG@GMAIL.COM

2025 CROWN SIGNIA HEV A25A-FXS | JTDACAAJ2S3015223 | Production Date 12/04/2024 | 17008mile

Health Check Result

STATUS

10/28/2025 15:07:09

Campaign Status: **NONE**

PERMANENT: **YES**

ECU Security Key: **Necessary**

SOCE: - / SOCR: -

Tire Pressure / Threshold Value [psi(gauge)]

Sensor1: **31.67/26.69**

Sensor2: **31.67/26.69**

Sensor3: **31.92/26.69**

Sensor5: **N/A/N/A**

Compensation Pressure [psi(gauge)]

GTS+ has established a network connection to TIS.

A network connection is required to ensure all TIS functionality is

Health Check

S30700-DL-002

HealthCheck has completed.

Would you like to retrieve additional information?

*Additional information: The information that is memorized in ECU in the following information.
[Vehicle Control History(RoB) Detailed data, Operation History, ABS History, Special Operation History, Diagnosis Related Information, CAN Bus Check, Tire Pressure]

Yes

No

Caution

Enhanced

Generic

System

Engine

Brake/EPB

DTC information

DTC

U012587

Lost Communication with Multi-axis Acceleration

DTC

U015187

Lost Communication with Restraints Control Module Missing Message

Blind Spot Monitor "B"

Calibration

Update

Configure

RoB

DTC

8A2223022000

No

No

-

0

F152630J0000

No

No

2

/ Conf

Pending

History

Test Failed

FFD

SB

x

x

*

No

x

x

*

No

8816F3004100

Yes

No

0

8AA213003000

No

8816F3004100

Yes

ECU SEARCH

ECU

DTC

Ver2025.03.004.02

Subscription Expiration:195d

Vehicle ID:12694

ONLINE

3:09 PM

10/28/2025

2 Notice ECU Security Key is Necessary

Health Check Result

127.0.0.1:50005/GetResource/gts/GTSMMain.html

TOYOTA | GTS+ ONLINE VIM : Mongoose-Plus MFC3 Vehicle : NA VOLTAGEDROPDIAG@GMAIL.COM

2025 CROWN SIGNIA HEV A25A-FXS | JTDACAAJ2S3015223 | Production Date 12/04/2024 | 17008mile

Health Check Result

STATUS

10/28/2025 15:07:00
Campaign Status: NONE
PERMANENT: YES
ECU Security Key: Necessary
SOCE: - / SOCR: -

Tire Pressure / Threshold Value [psi(gauge)]

Sensor1: 31.67/26.69
Sensor2: 31.67/26.69
Sensor3: 31.67/26.69
Sensor4: 31.92/26.69
Sensor5: N/A/N/A

Compensation Pressure [psi(gauge)]

Front: -
Rear: -

GTS+ has established a network connection to TIS.
A network connection is required to ensure all TIS functionality is

Caution

Enhanced Generic Completed: 10/28/2025 15:09:50

System	Monitor Status	Calibration	Update	Configure	RoB	DTC
Engine	Inc	8A2223022000	No	No	-	0
Brake/EPB	-	F152630J0000	No	No	-	2
DTC information						
DTC	Description	Curr / Conf	Pending	History	Test Failed	FFD
U012587	Lost Communication with Multi-axis Acceleration Sensor Module Missing Message	x			x	No
U015187	Lost Communication with Restraints Control Module Missing Message	x			x	No
Blind Spot Monitor "B"						
		8816F3004100	Yes	No	-	0
		8AA213003000	No	No	-	0
		8816F3004100	Yes	No	-	0

Ver2025.03.004.02 Subscription Expiration:195d

Vehicle ID:12694 ONLINE

3:10 PM 10/28/2025

3 Click YES to configure SRS module

Health Check Result

127.0.0.1:50005/GetResource/gts/GTSMMain.html

TOYOTA | GTS+ ONLINE VIM : Mongoose-Plus MFC3 Vehicle : NA VOLTAGEDROPDIAG@GMAIL.COM

2025 CROWN SIGNIA HEV A25A-FXS | JTDACAAJ2S3015223 | Production Date 12/04/2024 | 17008mile

Battery:14.4V

Health Check Result

STATUS

Caution

Enhanced Generic Completed: 10/28/2025 15:09:50

System	Monitor Status	Calibration	Update	Configure	RoB	DTC
Tire Pressure Monitor	-	897BF6006000	No	No	-	0
		897BF3004000	No	No	-	0
EMPS	-	8965F3018000	No	No	-	0
		8A3113023100	No	No	-	0
Front Recognition Camera	-	8646F3015200	No	No	-	0
		8679F3004000	No	No	-	0
Circumference Monitoring Camera Control Module	-	8679G3008000	No	No	-	0
		8679H3003000	No	No	-	0
Steering Angle Sensor	-	8924G4701100	No	No	-	0
Driver Monitor Camera Control	-	8647G3009000	No	No	-	0
		8647F3007000	No	No	-	0
Air Conditioner	-	8865F30130A0	No	No	-	0
SRS Airbag	-	8917F3077000	No	Yes	-	0
		8917H3014000	No	No	-	0
Main Body	-	8922F3025000	No	No	-	0
		8911F3005001	No	No	-	0
		894EF3009000	No	No	-	0

Ver2025.03.004.02 Subscription Expiration:195d

Vehicle ID:12694 ONLINE

3:10 PM 10/28/2025

4 Click Reprogramming Start

Software as a Part

As the result of the search, the following was found. Press the row and select update software.
When the number of selected files reaches the upper limit, can't press Reprogramming Start button.
If this vehicle need to write Vehicle Information, write automatically.

The Number of Selected Update Software
0 / 16

For Blank ECU

System	CID after Reprogramming	Note
SRS Airbag	8AA1130212	

Ver2025.03.004.02 Subscription Expiration:195d

Vehicle ID:12694 ONLINE

3:11 PM 10/28/2025

The 'Reprogramming Start' button is highlighted with an orange circle.

5 Click OK

Software as a Part

The following update(s) was/were found. Select update software and press OK button.
* When this vehicle need to update multiple systems simultaneously, other than the selected system is also displayed.

System: SRS Airbag
Current CID:

SU ID	CID after Reprogramming	Update Details	Note
-	8AA1130212	-	Configuration

Ver2025.03.004.02 Subscription Expiration:195d

Vehicle ID:12694 ONLINE

3:11 PM 10/28/2025

The 'OK' button is highlighted with an orange circle.

6 Click Reprogramming File

Software as a Part

The following update(s) was/were found. Select update software and press OK button.
* When this vehicle need to update multiple systems simultaneously, other than the selected system is also displayed.

System: SRS Airbag
Current CID:

SU ID	CID after Reprogramming	Update Details	Note
-	8AA113212	-	Configuration

OK Cancel

Ver2025.03.004.02 Subscription Expiration:195d

Vehicle ID:12694 ONLINE 3:11 PM 10/28/2025

7 Click OK

Software as a Part

The following update(s) was/were found. Select update software and press OK button.
* When this vehicle need to update multiple systems simultaneously, other than the selected system is also displayed.

System: SRS Airbag
Current CID:

SU ID	CID after Reprogramming	Update Details	Note
-	8AA1130212	-	Configuration

OK Cancel

Ver2025.03.004.02 Subscription Expiration:195d

Vehicle ID:12694 ONLINE 3:11 PM 10/28/2025

8 Click Reprogramming Start

The screenshot shows the Toyota GTS+ software interface. The top navigation bar includes the Toyota logo, 'GTS+ ONLINE', and various tool links. The main header displays vehicle information: '2025 CROWN SIGNIA HEV A25A-FXS | JTDACAAJ2S3015223 | Production Date 12/04/2024 | 17008mile' and 'Battery:12.5V'. The 'Software as a Part' section contains instructions and a table for blank ECU. The 'Reprogramming Start' button is highlighted with an orange circle.

Software as a Part

As the result of the search, the following was found. Press the row and select update software.
When the number of selected files reaches the upper limit, can't press Reprogramming Start button.
If this vehicle need to write Vehicle Information, write automatically.

The Number of Selected Update Software
1 / 16

For Blank ECU

System	CID after Reprogramming	Note
SRS Airbag	8AA1130212	Selected

Ver2025.03.004.02 Subscription Expiration:195d

Vehicle ID:12694 ONLINE

3:11 PM 10/28/2025

9 Click Next

The screenshot shows the Toyota GTS+ software interface. The top navigation bar and header are identical to the previous screenshot. The 'Software as a Part' section contains instructions about downloading files. The 'Next' button is highlighted with an orange circle.

Software as a Part


1 cal file(s) need to be downloaded.
If you press "Next", communication with server will start.
If it is not possible to download the file, then press "Output" and output the file list.

Ver2025.03.004.02 Subscription Expiration:195d


Vehicle ID:12694 ONLINE

3:11 PM 10/28/2025


10 Click OK To Log In

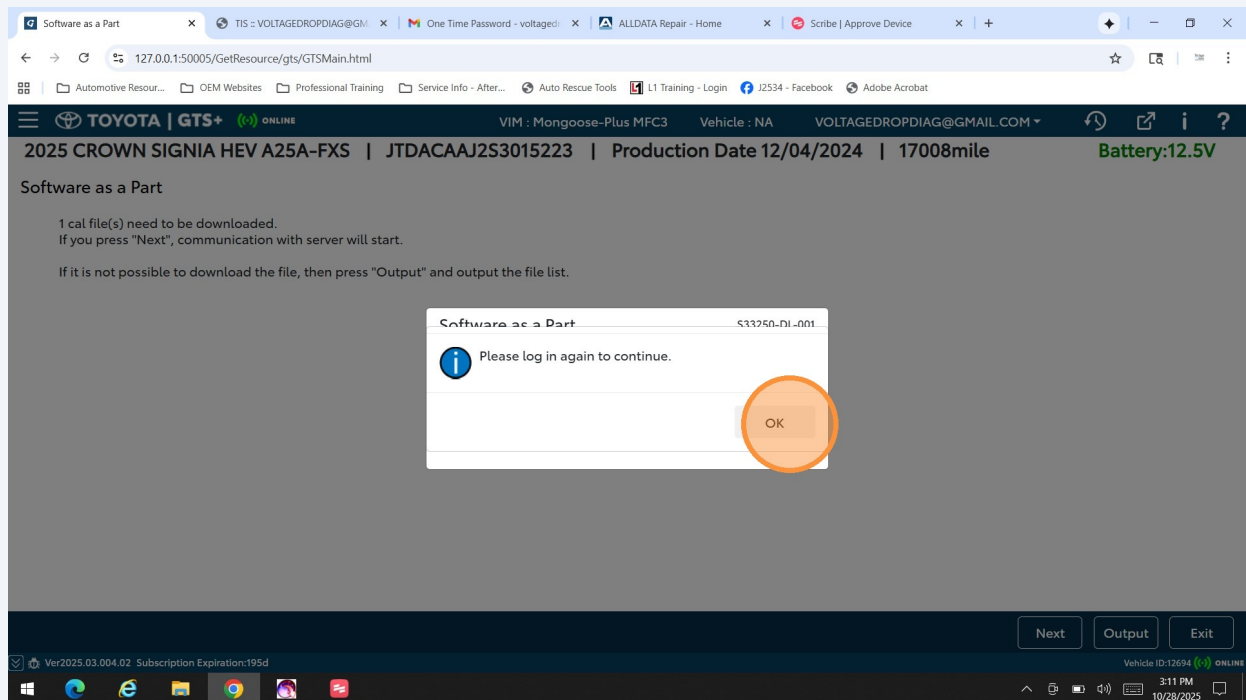


11 Log In

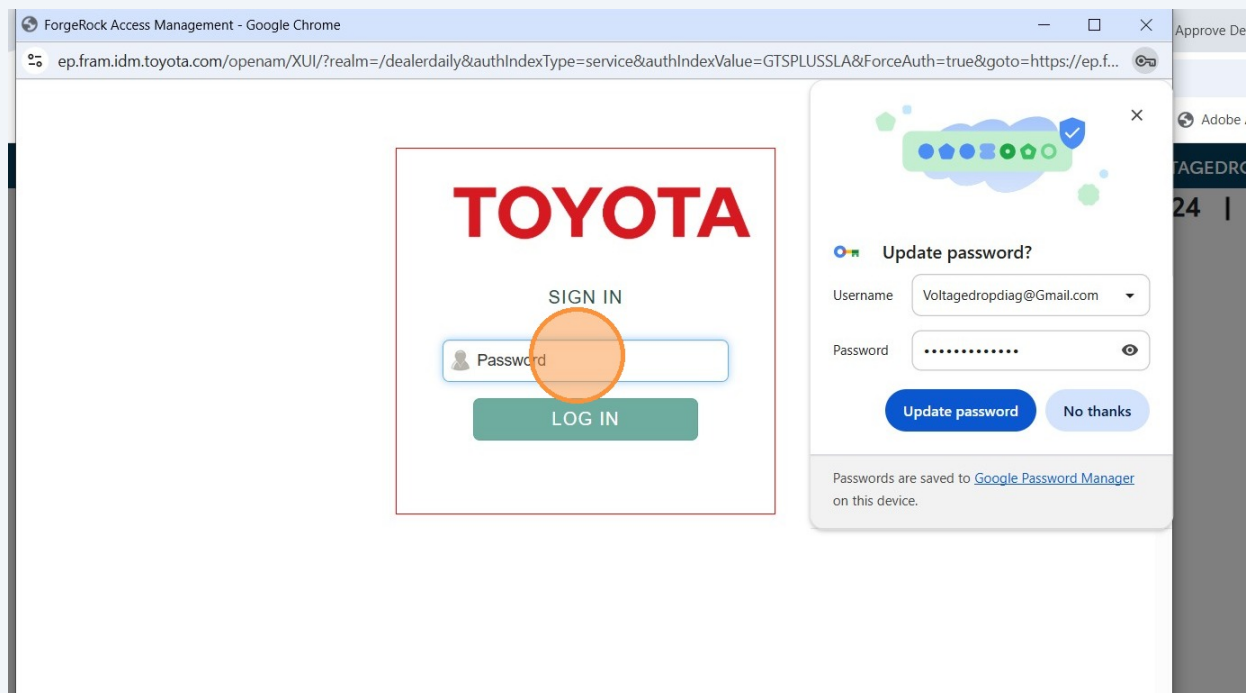


12 Click "Log in"

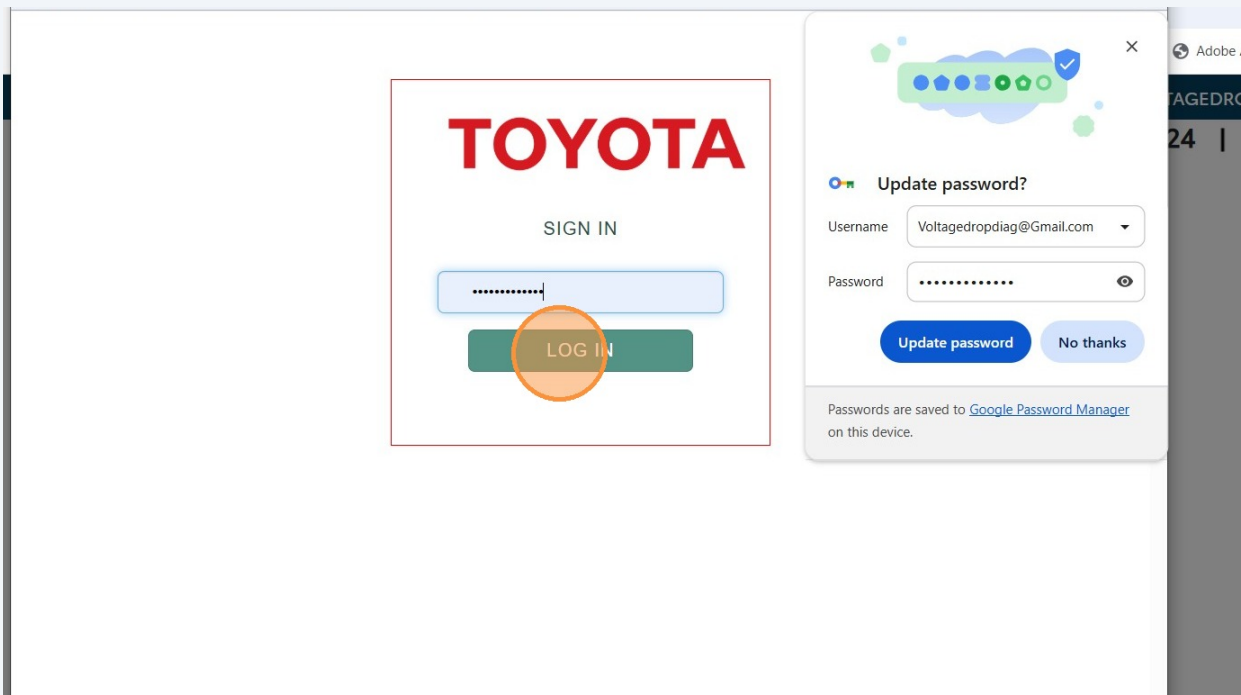


13 Click Next

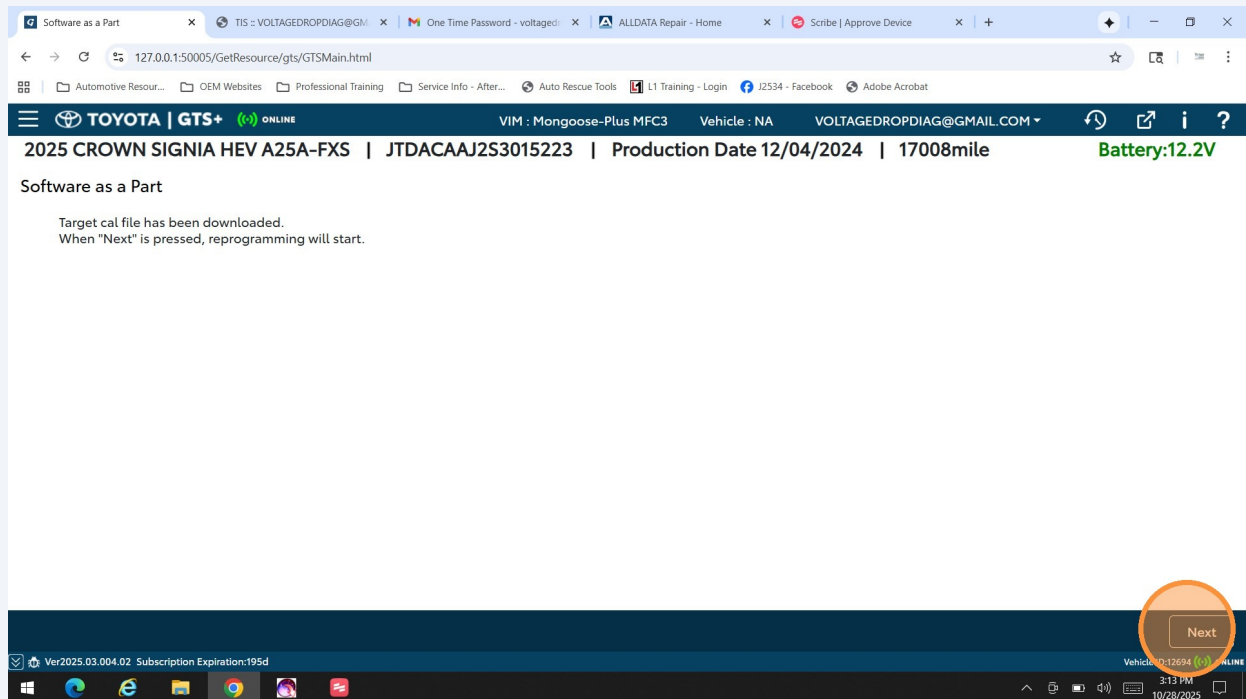


14 Click Next In CUW

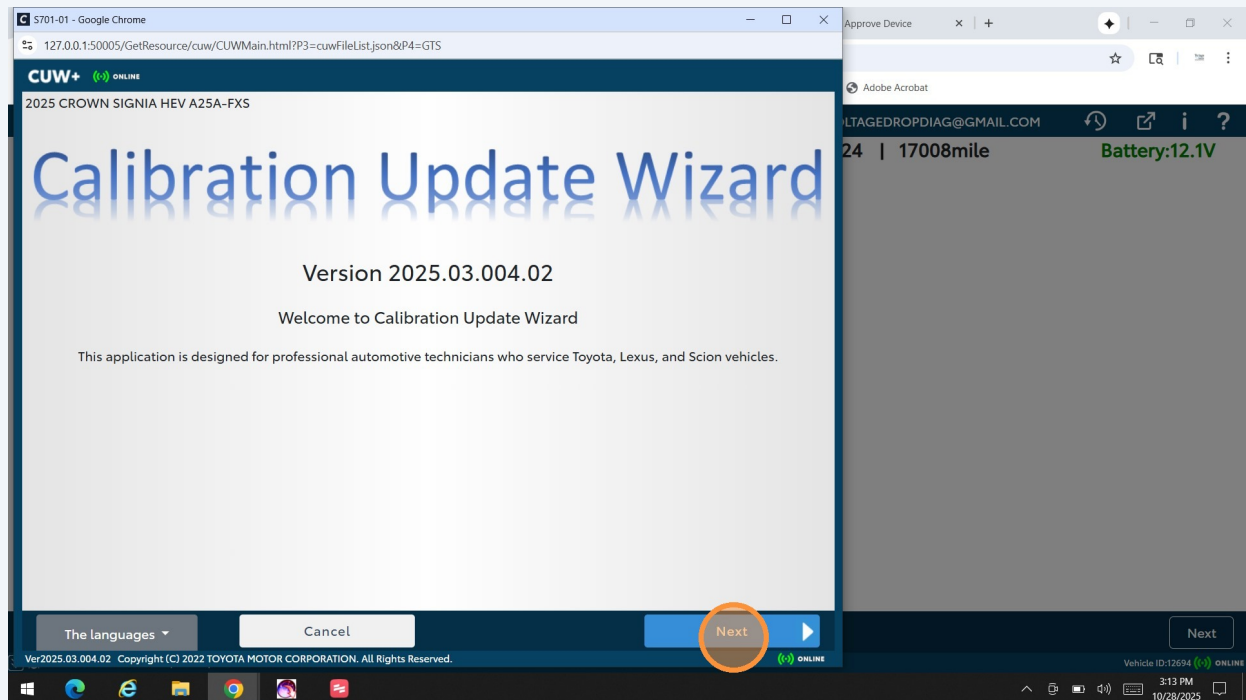


15 Click Next

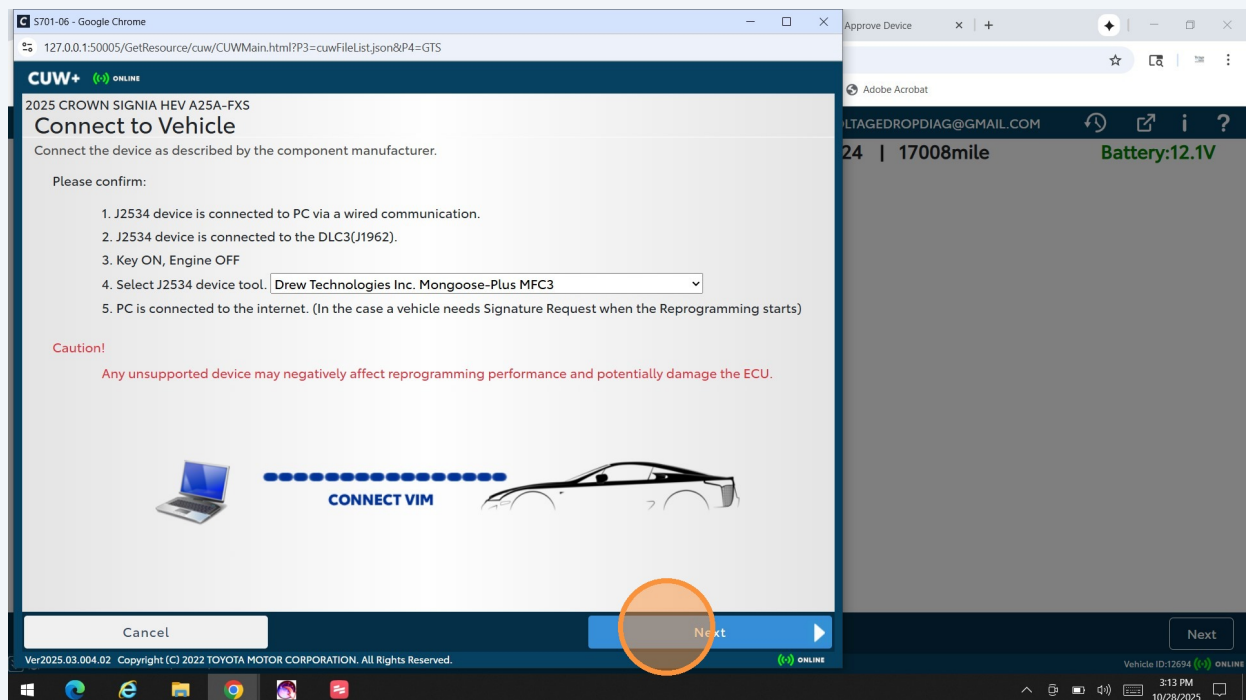

16 Click Next

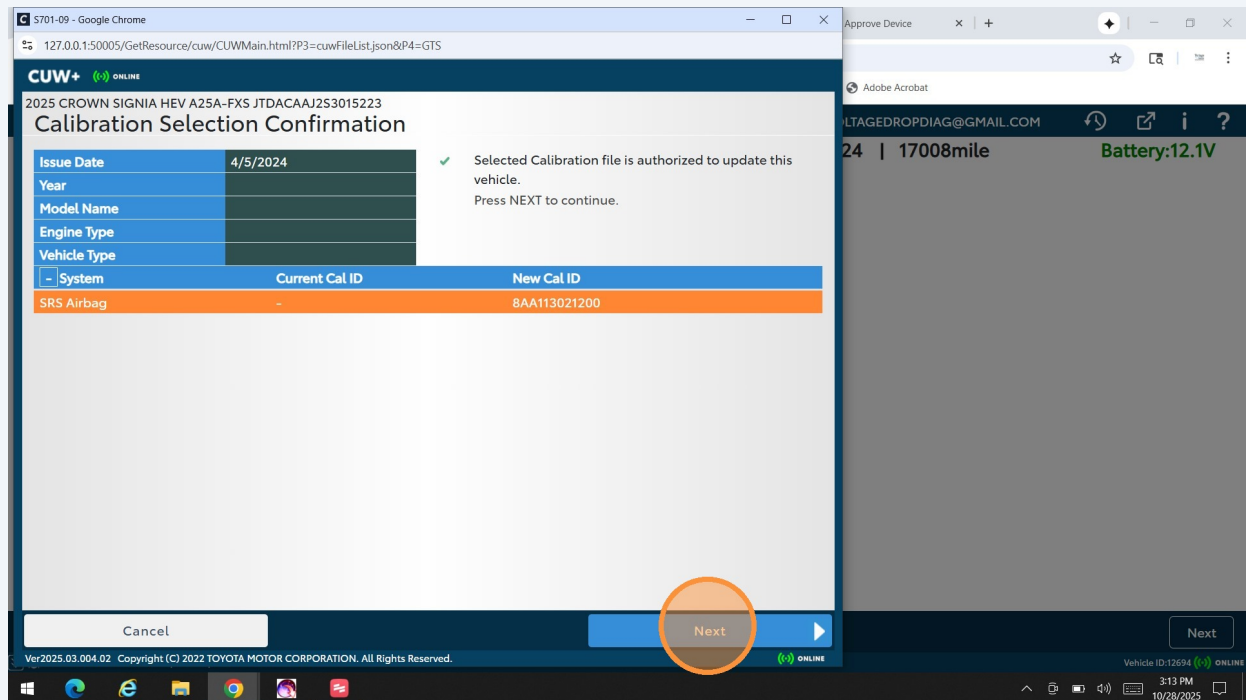

17 Click OK

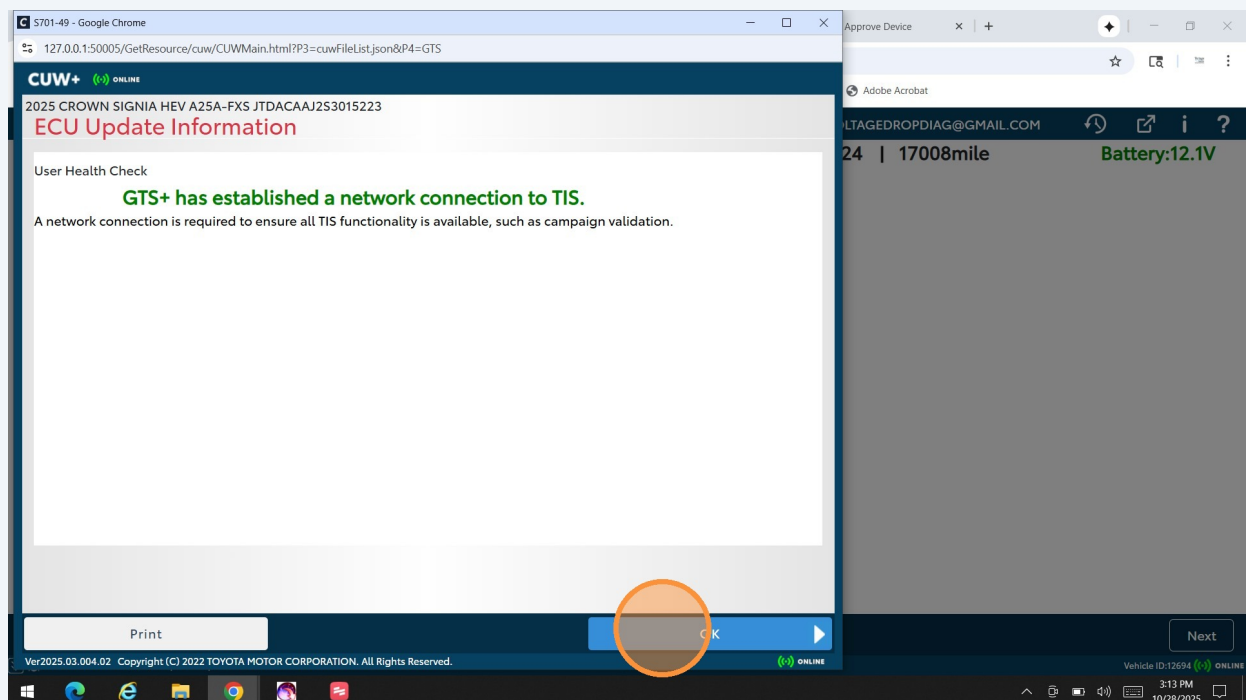

18 Shut Off Ignition Then Click Next

CUW+ ONLINE

2025 CROWN SIGNIA HEV A25A-FXS JTDACAAJ2S3015223

Vehicle Preparation

1. Turn Ignition OFF

NOTE:
Some vehicles require systems to be disabled before Flash Reprogramming.
Please refer to the Specific Service Bulletin for special vehicle preparation instructions required for this update.

There is a possibility a recorded diagnostic code is deleted during reprogramming.
Confirm and record any codes before reprogramming.
To confirm current codes, Click the cancel button and exit CUW+.

Click "Next" to continue.

Cancel Next

Ver2025.03.004.02 Copyright (C) 2022 TOYOTA MOTOR CORPORATION. All Rights Reserved.

Vehicle ID:12694 ONLINE

3:13 PM 10/28/2025

19 Turn Ignition On Then Click Start

CUW+ ONLINE

2025 CROWN SIGNIA HEV A25A-FXS JTDACAAJ2S3015223

Prepare for reprogramming

Confirm the following conditions.

1. Turn Ignition ON (IG ON Ready OFF for HV)
2. Engine Hood Open
3. All electrical accessories are OFF
4. Battery voltage above 12.0V

DLC3 BAT VOLTAGE 13.4V

CAUTION!

When reprogramming:

1. Do not disconnect the DLC3 cable from vehicle.
2. Do not turn OFF the IG switch.
3. Do not apply any electrical load to the vehicle.
4. Do not allow battery voltage to drop below 12.0V.

Click "Start" to begin reprogramming.


Cancel Start Next

Ver2025.03.004.02 Copyright (C) 2022 TOYOTA MOTOR CORPORATION. All Rights Reserved.


Vehicle ID:12694 ONLINE

3:16 PM 10/28/2025


20 Log In Again

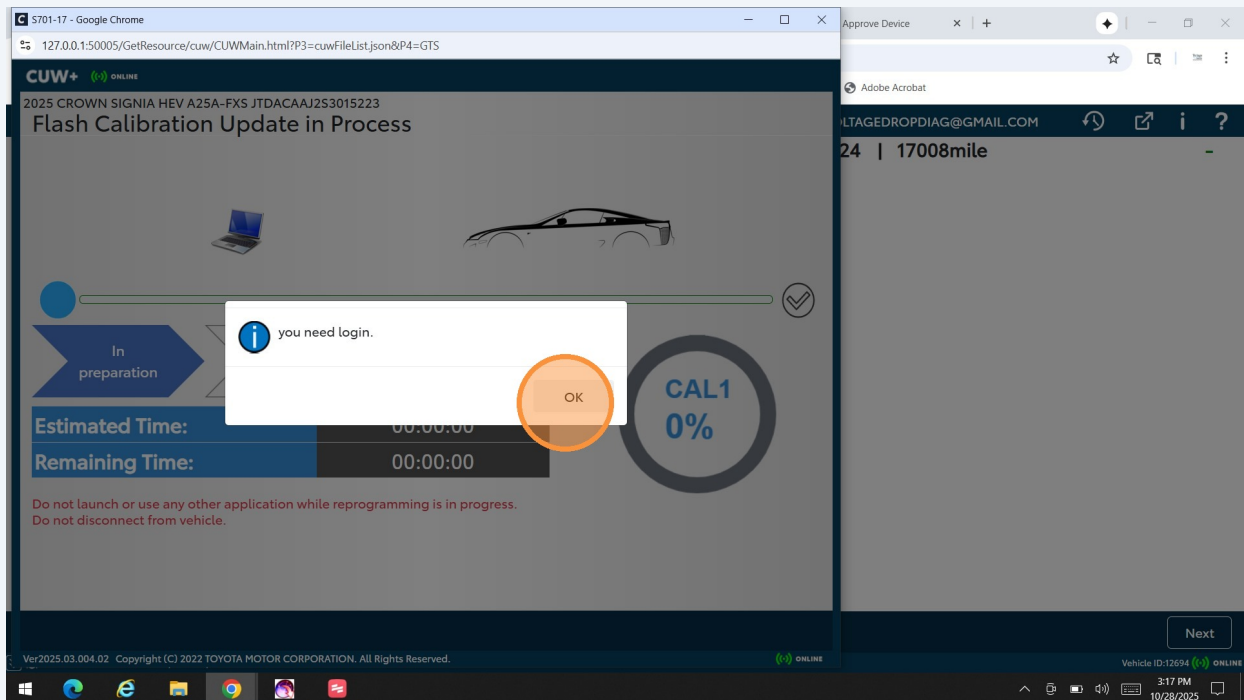

21 Click "Password"

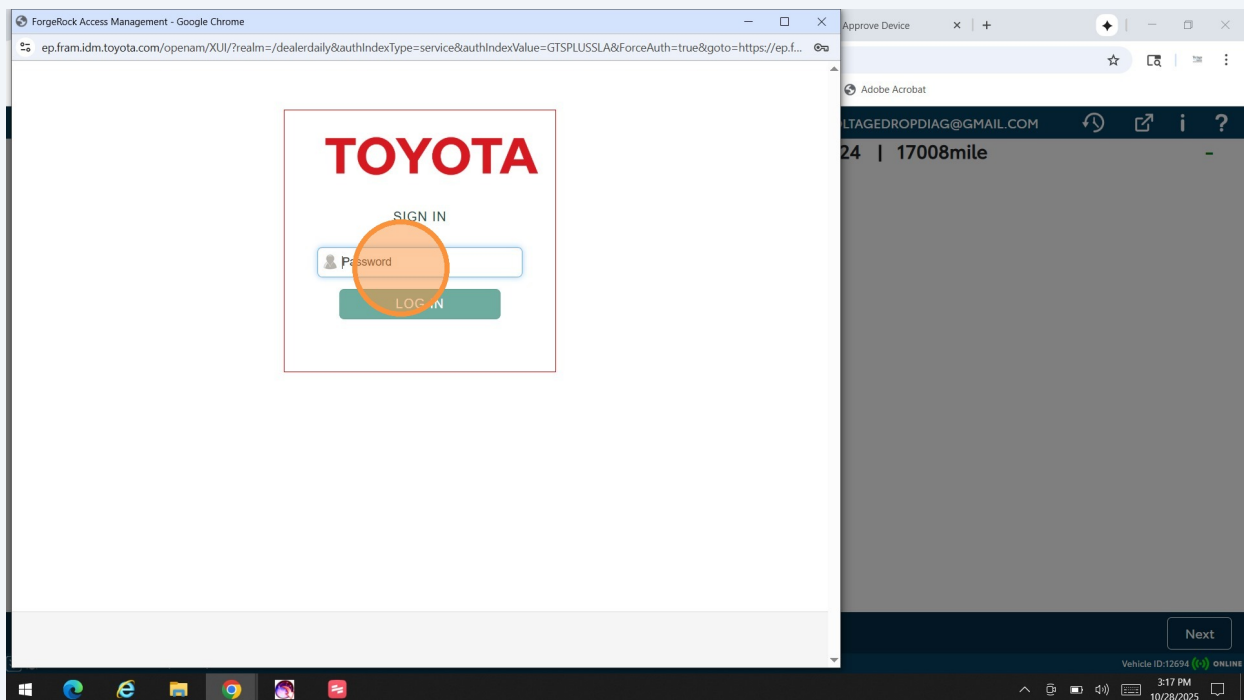


22 Click "Log in"

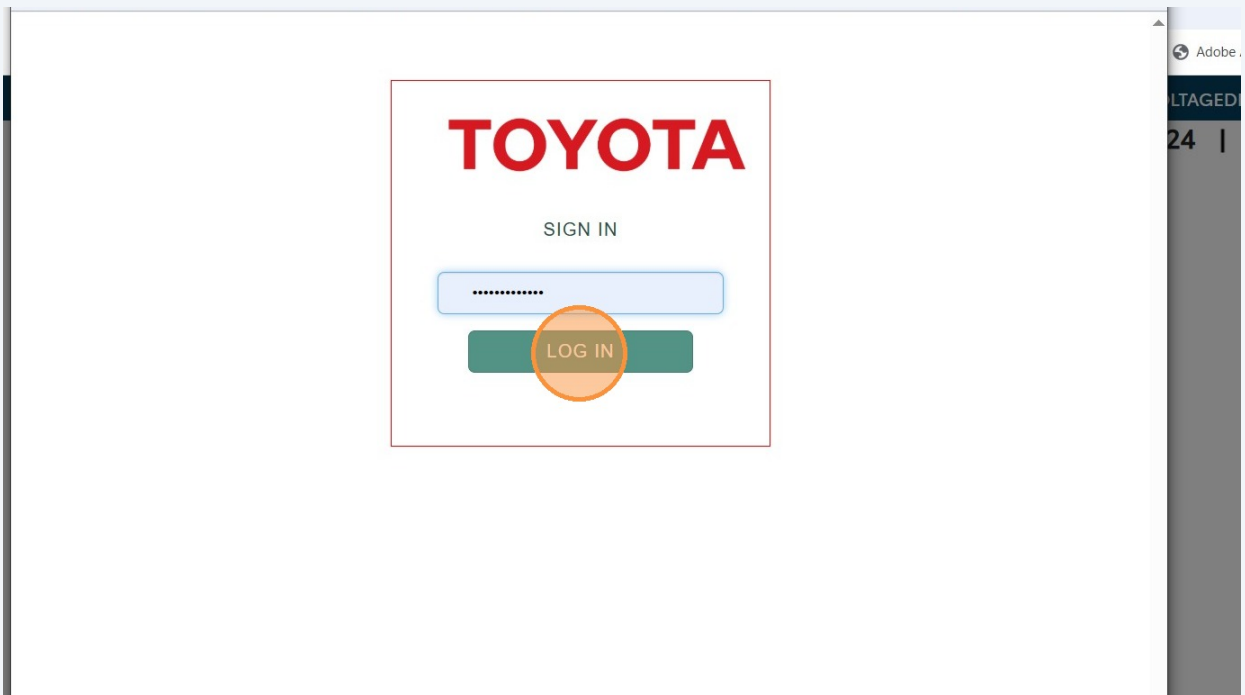


23 When Programming is Complete. Green Screen Will Display




24 Turn Ignition Off. Hit Next

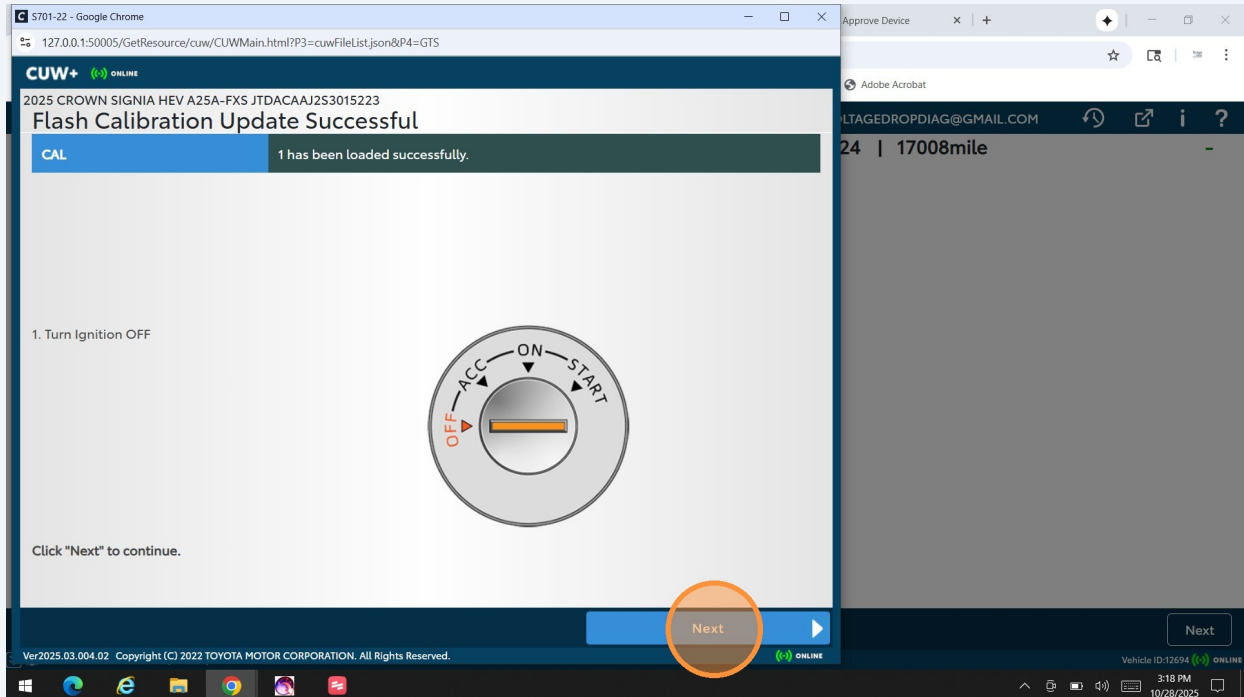


25 Ignition On. Hit Next

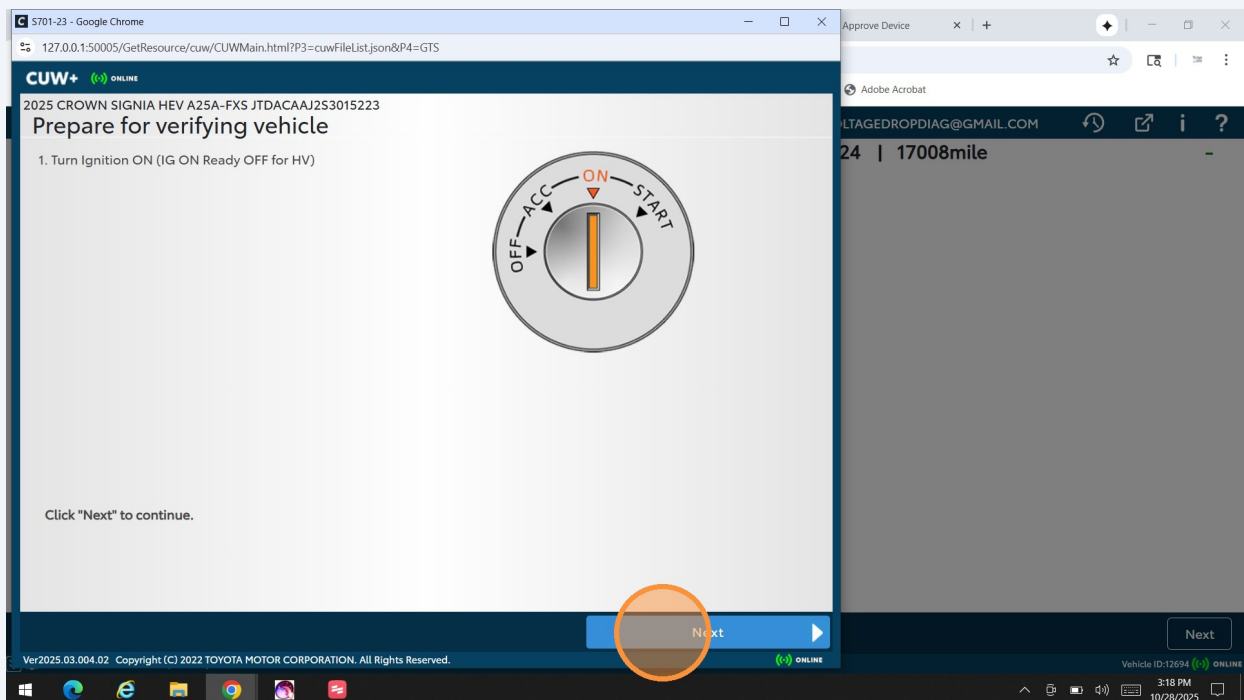


26 OK

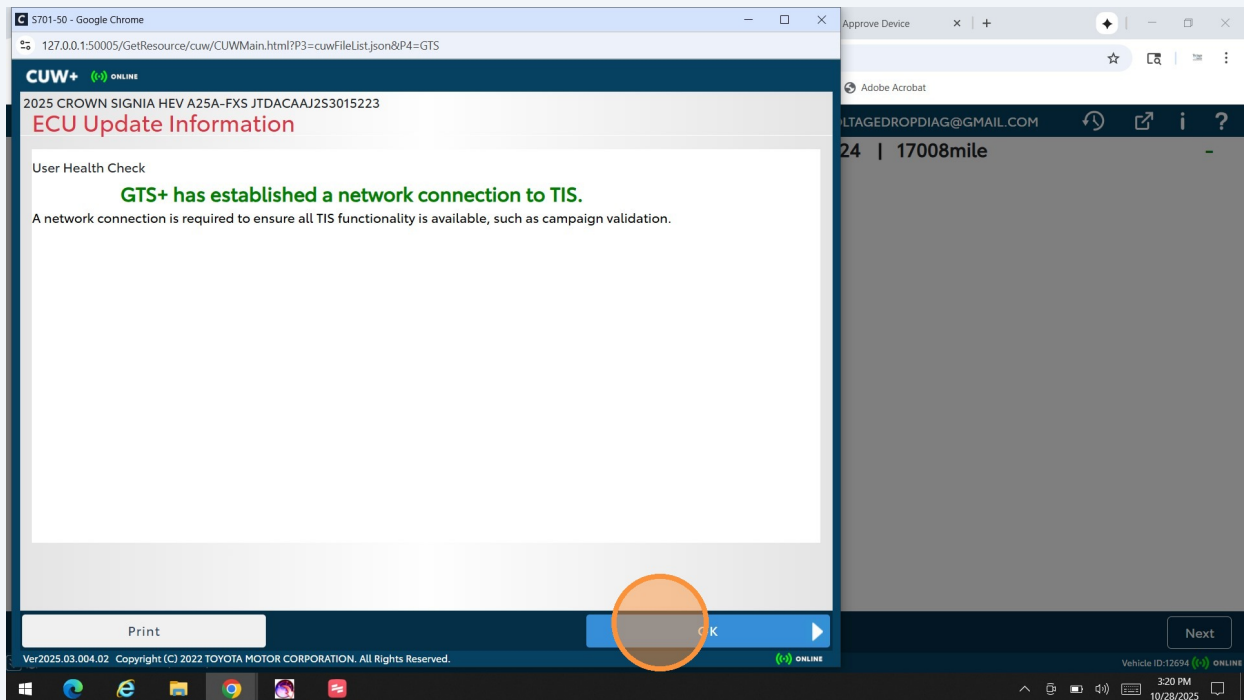

27 Take Screenshot for Invoice then Finish

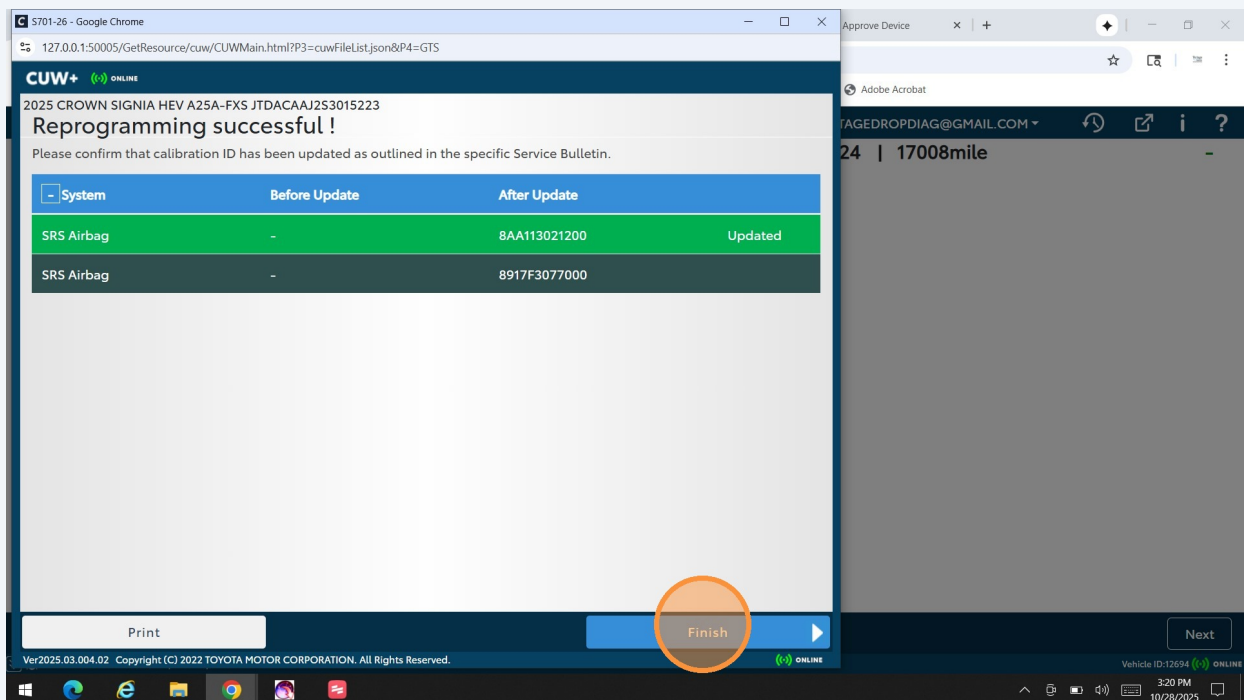

28 Click "Close"

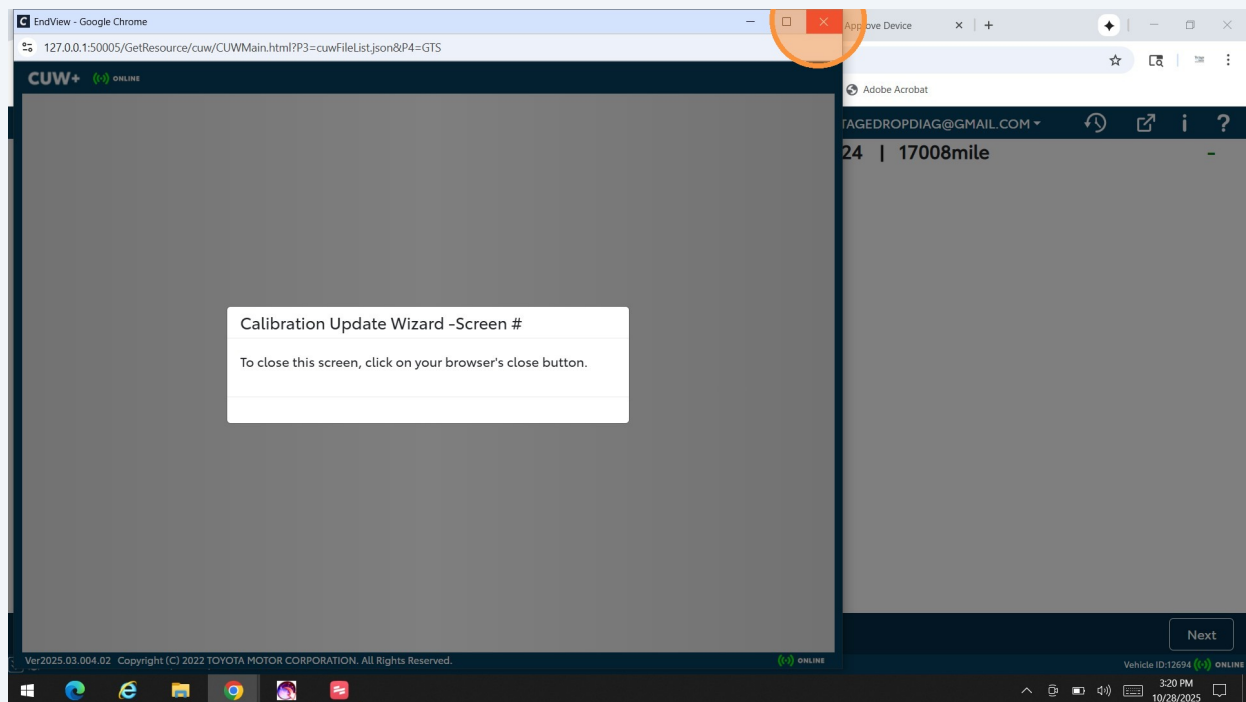

29 Click "Leave"

