

MEASURE THIS BAR: it must be exactly 100 mm. If it is not, the page was scaled — reprint at 100% / Actual size.

Lay the PCB here, component side UP, edges on the outline.



USB-C this end →

Modelled hole centres, from the board's top-left corner:


x = 2.1849999999999987 and 34.185 (pitch 32.0)

z = 3.5 and 16.8 (pitch 13.3)


Board outline 36.37 x 20.32. Rings are 0.25 mm apart.

The HEAVY ring is 1.0 mm radius = the M2 bore's own edge: if a hole is modelled correctly the heavy ring sits exactly under the eyelet's rim, all the way round.


WHAT YOU ARE LOOKING FOR (shown 10x; red dashed = the eyelet's bore as you see it)

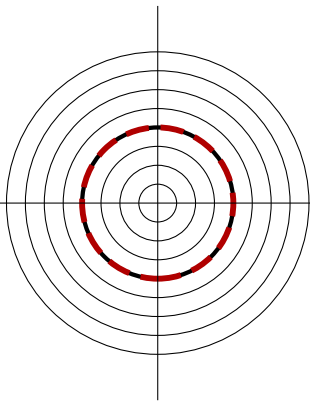

CENTRED
hole is right

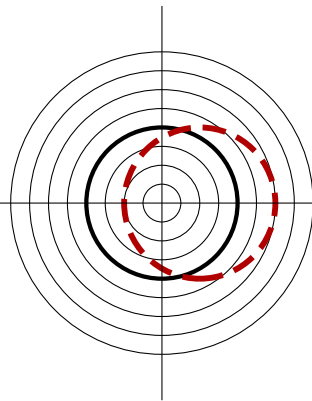

0.5 mm off
(2 rings)

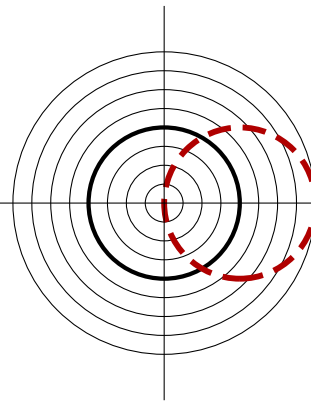

1.0 mm off
(4 rings)

HOW TO READ IT

1. Check the 100 mm bar above before anything else.
2. Lay the board on the outline, aligned by its EDGES, not by the holes.
3. Look straight down through each eyelet — it is a window onto the paper.
4. The HEAVY ring should sit exactly under the eyelet's rim, all the way round.
Gap on one side and hidden on the other = that hole is off, that way.
Count the 0.25 mm rings across the gap to size the error.

WHAT THE ANSWER MEANS

- All four off the same way → the pattern needs shifting (an offset).
- Off in opposite directions → the pitch is wrong, not the position.
- Only one off → re-check the board is square on the outline.

Report the direction and ring count for each of the four and the model can be corrected without anyone having to find the centre of a hole with calipers.