

SSD_burning instructions

1. Tool burning

- The board that can be booted to Uboot normally, it is recommended to directly use Tftp32 to burn;
 - The board that cannot boot to Uboot can only be burned with Flash_Tool.
-

1.1. Flash_Tool (ISP_Tool) programming

This method is suitable for the case where the blank chip is burned or the board cannot enter the Uboot console and use other methods to burn.

1. Boot into the Uboot console, enter debug (if it can enter normally), the uboot serial port is disabled at this time
2. Close the serial port debugging tool
3. Booting to Uboot requires the necessary partitions and the starting address of the partition

The difference between Nand/Nor is as follows:


- a. Nand Flash
-

partition file	Partition start address
GCIS.bin	0x000000
IPL.bin	0x140000
IPL_CUST.bin	0x200000
u-boot_spinand.xz.img.bin	0x2C0000

b. Nor Flash

partition file	Partition start address
IPL.bin	0x00000
IPL_CUST.bin	0x10000
MXP_SF.bin	0x20000
u-boot.xz.img.bin	0x30000

4. Open Flash_Tool, according to the above partitions and partition start addresses, follow the following methods to burn the partitions in sequence
 - a. Click Connect to establish the connection status (Connect must ensure that the serial port tool is closed, otherwise there will be a problem of competing for serial port resources)
 - b. Select Flash Type (Nand Flash/Nor Flash)
 - c. Select the img corresponding to the partition to be burned, take u-boot_spinand.xz.img.bin as an example
 - d. Check **Base shift at** , select start from base address 0
 - e. Fill in the starting address of the corresponding img partition (u-boot_spinand.xz.img.bin corresponds to 0x2C0000)
 - f. Click Run and wait for the end of the run until the Pass status is prompted.

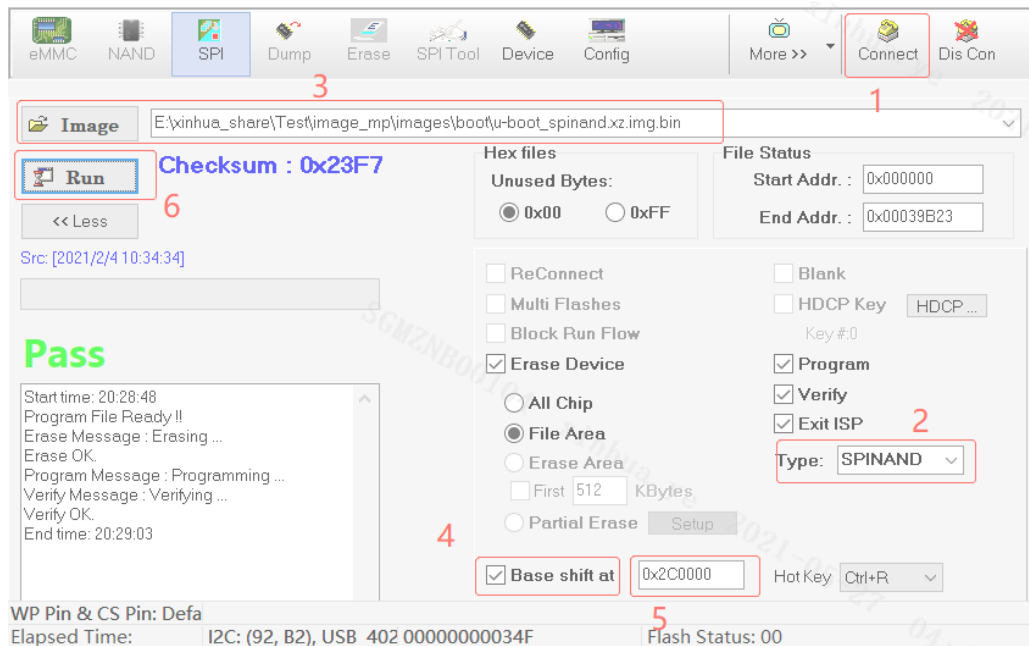


5. Burn the corresponding partition in step 3 according to the Flash Type, and follow the steps to burn the corresponding partition. After the burn is completed, reboot and you can boot to Uboot normally.

1.2. Tftp burning

This burning method is only for the case where you can enter the Uboot console, and this burning method is not supported for blank or unable to boot to the console.

1. Open the tftpd32 tool and select the image directory to be burned

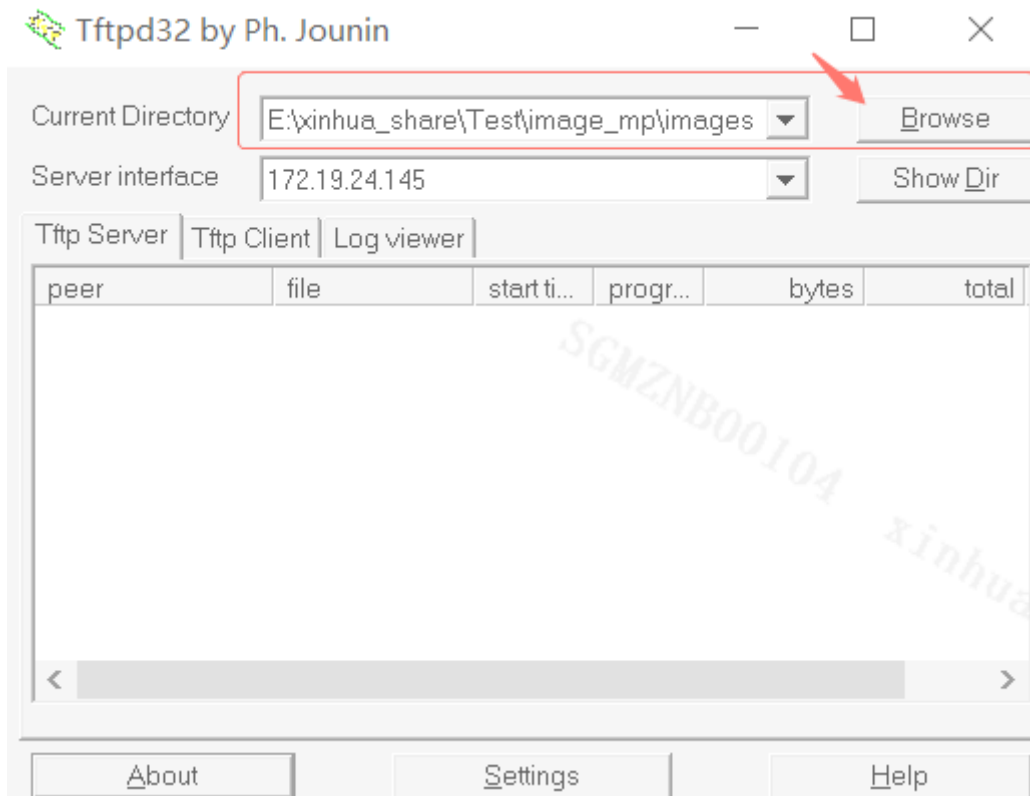

2. Boot into the Uboot console and set the IP

```
setenv serverip 172 . 19 . 24 . 145 ; // ip is the IP of the
environment where the Tftp tool is located

setenv ipaddr 172 . 19 . 24 . X ; // Set the ip of the board
, make sure the network segment is the same as Tftp , network
alley

saveenv ;
```

3. Enter estart (open the network card, this step is for the case where the network card is turned off by default in the Uboot stage)
4. Enter estar (the difference from full burning is that this method can write `estar auto_update.txt` scripts in any separate partition)