

D.1 Bus-simulator jig (“fake EI”) — used in Phase 2

Each monitored line is held high by 150 Ω (as the terminating drive does) and pulled to ground by a switch (as a 7438 in the EI does).
The monitor plugs onto the 3463. Ribbon conductor N = J1 pin N when the stripe is on contact 1 — check with the DMM before trusting the jig.

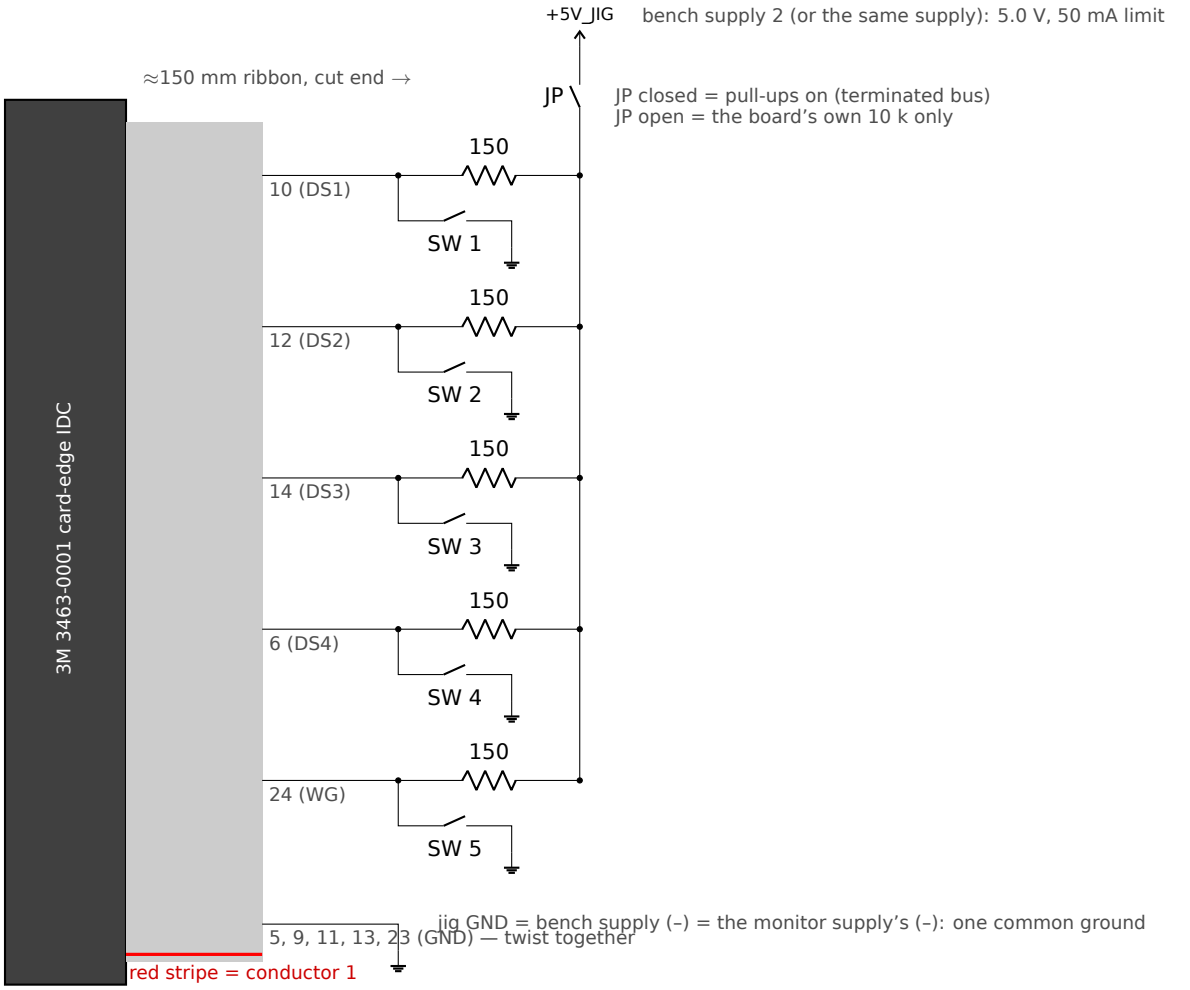

Steps 2.6.2 and 2.8: mA meter in place of SW n (line to GND). Step 2.6.22: meter in series with that line’s 150 Ω.
Any 34-way 0.1 in card-edge IDC and 28 AWG ribbon will do; parts in Appendix C.


D.2 Power pigtail for J2 — used in Phases 2 and 3

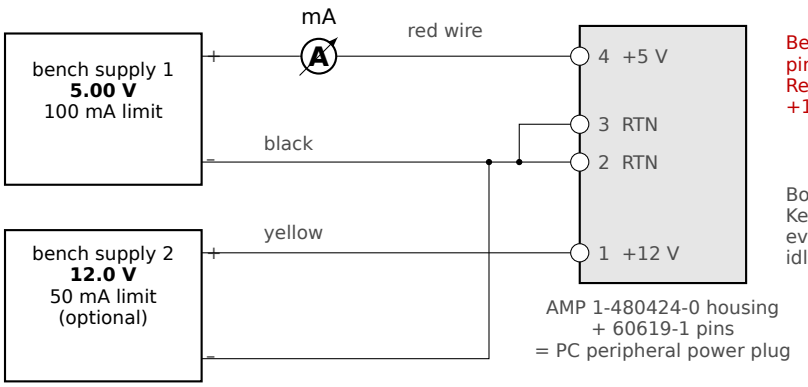

Before first use, DMM on the plug:
pin 4 = +5 V, pin 1 = +12 V, 2 and 3 = 0 V.
Reversed +5 V is blocked by Q1;
+12 V on pin 4 is fault F2 and may cost D11.

Both supplies’ (–) are tied at pin 2/3.
Keep the mA meter in the +5 V lead for every powered step; it is the board’s idle-current fingerprint (2.1.1).

D.3 Key plug (optional) — 3M 3439-2 in the connector, opposite the board’s slot between fingers 4 and 6

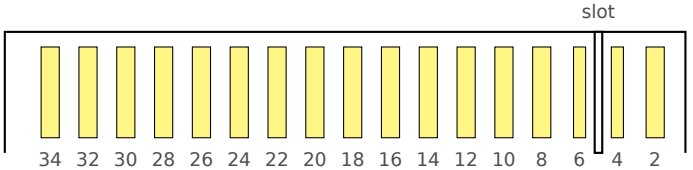

Board tab seen from the component side, fingers pointing away: pin 2 at the right, even pins on top, odd (GND) underneath. The 3439-2 pushes into the 3463’s contact cavity at that position; the connector then only fits the monitor one way. Without it, the stripe-to-pin-1 check in 3.0 is what prevents a reversed plug.