

TEKİNTOOLS

BORING BAR RUN-OUT PRE-SETTER

User Manual

Model No.
ZTS-10015



Application

- To measure and adjust the boring bar run-out

Features

- Applied to accurately and promptly measuring the concentricity / run-out.
- Base
The material of the base is marble.
- Center supports
Both the upper & lower centers are adjustable (slidable).
- An adjusting hand wheel is designed under the lower center support with its max adjustable stroke of 18mm.

Technical parameters


- Radial rotary accuracy: 0.002mm
- Max measuring length: 1000mm
- Max measuring diameter: 150mm
- Size: 1538x560x430(mm)
- Weight: about 110kg

Components

- Centers
- Micrometers
- Reference calibration rod
- Hex wrenches

Structure

1. Marble base
2. Locknuts of upper & lower center supports
3. Adjustable wheels of upper & lower center supports height
4. Upper & lower centers
5. Upper & lower center supports
6. Column guideway
7. Micrometer brackets
8. Micrometers
9. Foot screws
10. Flexible center grip

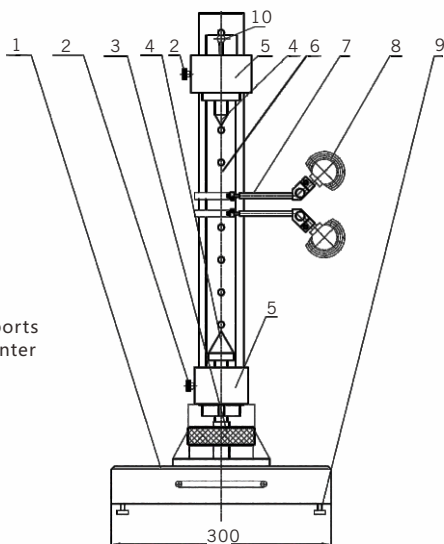

Instruction

Preparation

Open the package to check if all components are in accord with the Packing List I ,Then take out the presetter and place it on a horizontal worktable. Check if all the components are workable, Completely clean all center holes of the work-piece and place it with the presetter in the measuring room to keep the both to have the same temperature before measuring begins.

Measuring instructions


Work-piece fixing

Loosen the locknuts of the micrometer brackets before work-piece is fixed on. Move the micrometer brackets to the end of the guideway and then screw the locknut of the lower center base tightly. Loosen the locknut of the upper center base to adjust its height according to the work-piece length. Fix the work-piece between the upper and lower centers and screw the locknut tightly. The work-piece fixed between the upper and lower centers should not be started or loose and must rotate smoothly.

Micrometer brackets adjustment

Loosen the locknuts of micrometers brackets (see the sketch below), and then move it along the guideway to the designated height and screw the locknuts tightly.

Adjust the micrometer rod to have the measuring head contacted the work-piece exccircle. Then slightly adjust the micrometer rod until the pointer indicates a read on the micrometer. Screw the locknut tightly and record the results to end the measuring.

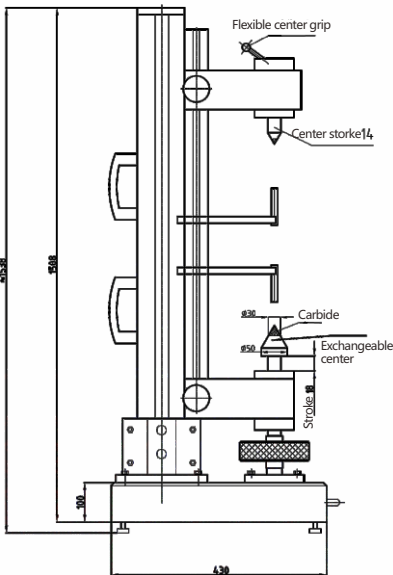

Components functions

Marble base: to bear the weight of the work-piece

Locknuts of the upper & lower center supports: to lock the supports

Height adjusting handwheel of the lower center: to adjust the height of the lower center with its max adjustable stroke of 18mm.

Upper & lower centers: to support and fix the work-piece

Upper & lower center supports: to support the upper and lower centers


Guideway column: the reference orbit the upper & lower center supports sliding along

Micrometer brackets: to support the micrometers

Mahr micrometers: to measure the run-out of the work-piece

Foot screws: to give the worktable a level standing

Upper center adjusting knob: to adjust the upper center in its support.

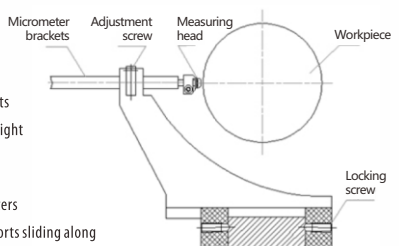

Appendix I Packing List

No.	Name	Unit	Quantity	Remarks
1	Worktable	Set	1	
2	User Manual	Piece	1	
3	Center	Piece	2	
4	Mahr torsion spring micrometer	Piece	2	
5	Reference calibration rod	Piece	1	in vertical suspended status
6	Hex wrench	Piece	1	

Appendix II Inspection Report

No.	Inspection content	Inspection method	Required size	Results
1	150	Reference calibration rod	>0.002mm	
2	300	Reference calibration rod	>0.002mm	
3	450	Reference calibration rod	>0.002mm	
4	600	Reference calibration rod	>0.002mm	
5	700	Reference calibration rod	>0.002mm	
6	900	Reference calibration rod	>0.002mm	
7	1000	Reference calibration rod	>0.002mm	
8	Max length	Reference calibration rod	1000mm	
9	Max diameter		150mm	

HENAN TEJIN SUPER-HARD MATERIAL CO., LTD.

Tel: +86 371 60300918

Mobile: +86 13937104872

E-mail: tekintools@163.com

Web: <http://www.tekintools.com/>

Address: 220255, Floor 13, Longyu International, Shangding Road,

Dongfeng South Road, Zhengzhou Pilot Free Trade Zone (Zhengdong), Henan 450000, P.R. China.