# Plywood cutting plan

Production overview / Rectangular blanks first, machining second

| 2 | 17 | 24 | 5 mm |
|---|---|---|---|
| SHEETS TO BUY | INDIVIDUAL BLANKS | SAW CUTS | MAX. KERF ALLOWANCE |

## 01 STOCK TO BUY

| SHEET | PLYWOOD | STOCK SIZE | USABLE SIZE (MM) | BLANKS | CUTS |
|---|---|---|---|---|---|
| 1.1 | 12 mm | 5x5 ft | 1524 x 1524 | 11 | 16 |
| 2.1 | 18 mm | 5x5 ft | 1524 x 1524 | 6 | 8 |

## 02 CUTTING WORKFLOW

1. Follow FROM and KEEP LEFT for each cut; see the cutting guide on the next page.
2. Mark every blank with its P ID before separating similar parts.
3. Machine flagged parts using the source model / drawings before assembly.

Grain: longest blank edge follows sheet X. Preserve the layout when turning panels.

Usable stock sizes assumed; no edge-trim allowance. No stacked cuts assumed.

Material / grade assumed uniform; sheets grouped by thickness. 16 hardware objects excluded.

Plan: shop workflow. Search is heuristic; minimum cut count is not proven.

SOURCE complete-cabinet.step

# Keep the sized piece on the left

Use local measurements for every cut / Diagram positions use the maximum kerf allowance

## 01 PICK THE CORRECT SUBPANEL

FROM identifies the piece: S1 = this group's sheet 1; C4L = left piece from cut 4; C4R = right remainder.

After each cut, label both sides CnL / CnR and retain any remainder referenced by a later cut.

## 02 ORIENT IT BEFORE MEASURING

V: put the diagram-left edge on your left. H: turn clockwise so the diagram-bottom edge is on your left.

Use the sheet diagram as the orientation reference each time. Turning a panel does not change its grain layout.

## 03 MEASURE KEEP LEFT TO THE NEAREST CUTTING EDGE

Measure from the current left reference edge to the blade tooth edge nearest the kept piece, not the blade centre.

Reset this measurement for every cut. Do not use cumulative sheet coordinates or subtract the kerf.




## 04 FINISH REMAINDERS TO SIZE

The plan reserves 5 mm per cut. Smaller actual kerfs leave extra stock; finishing cuts remove it.

Finish even at a diagram edge. Skip a pass only if the piece measures to size; still use its CnL label.

The actual kerf must be no greater than 5 mm. Replan for a wider blade. Exact stock size and accurate setup still matter.

P IDs in LEFT PIECE mark finished blanks. Other left pieces and right remainders may need further cuts.

# Parts register

One row per physical blank. P IDs link this register to layouts and labels.

| ID | PART / MODEL BOARD NAME | LENGTH | WIDTH | THICK. | QTY | FINISHING |
|---|---|---|---|---|---|---|
| P01 | B12 - Left carcass side | 773 | 579 | 18 | 1 | Blank |
| P02 | B13 - Right carcass side | 773 | 579 | 18 | 1 | Blank |
| P03 | B14 - Carcass bottom | 579 | 494 | 18 | 1 | Blank |
| P04 | B15 - Carcass top | 579 | 494 | 18 | 1 | Blank |
| P05 | B16 - Left face-frame stile | 773 | 38 | 18 | 1 | Blank |
| P06 | B17 - Right face-frame stile | 773 | 38 | 18 | 1 | Blank |
| P07 | B01 - Left side | 523 | 102 | 12 | 1 | Machine * |
| P08 | B02 - Right side | 523 | 102 | 12 | 1 | Machine * |
| P09 | B03 - Front wall | 453 | 102 | 12 | 1 | Machine * |
| P10 | B04 - Back wall | 453 | 102 | 12 | 1 | Machine * |
| P11 | B05 - Bottom panel | 511 | 465 | 12 | 1 | Blank |
| P12 | B06 - Left side | 523 | 203 | 12 | 1 | Machine * |
| P13 | B07 - Right side | 523 | 203 | 12 | 1 | Machine * |
| P14 | B08 - Front wall | 453 | 203 | 12 | 1 | Machine * |
| P15 | B09 - Back wall | 453 | 203 | 12 | 1 | Machine * |
| P16 | B10 - Bottom panel | 511 | 465 | 12 | 1 | Blank |
| P17 | B11 - Applied drawer face | 711.2 | 469.9 | 12 | 1 | Blank |

*** Additional machining required: dados, holes or other material removal detected.**


Machining sizes are not extracted. Use source drawings / model for positions, depths and drilling setups.

# Sheet 1.1 / 12 mm plywood

5x5 ft stock / 1524 x 1524 mm / 16 saw cuts

## CUTTING LAYOUT

P = part ID C = saw cut Grey = remaining stock

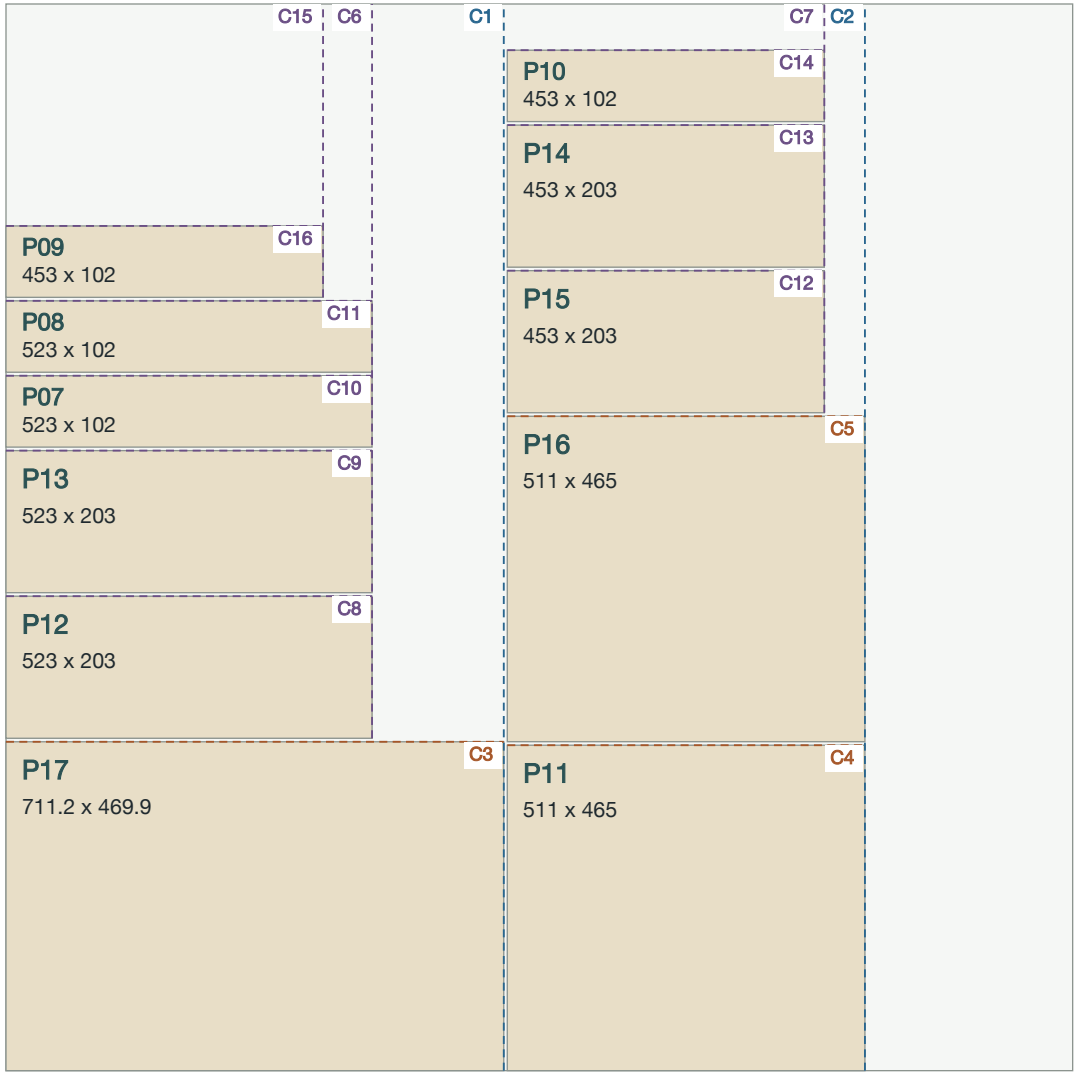


## SAW ORDER / KEEP LEFT

Label both sides CnL / CnR. P = finished blank.

| CUT | FROM | AXIS | KEEP LEFT | LEFT PIECE |
|---|---|---|---|---|
| C1 | S1 | V | 711.2 | C1L |
| C2 | C1R | V | 511 | C2L |
| C3 | C1L | H | 469.9 | P17 / C3L |
| C4 | C2L | H | 465 | P11 / C4L |
| C5 | C4R | H | 465 | P16 / C5L |
| C6 | C3R | V | 523 | C6L |
| C7 | C5R | V | 453 | C7L |
| C8 | C6L | H | 203 | P12 / C8L |
| C9 | C8R | H | 203 | P13 / C9L |
| C10 | C9R | H | 102 | P07 / C10L |
| C11 | C10R | H | 102 | P08 / C11L |
| C12 | C7L | H | 203 | P15 / C12L |
| C13 | C12R | H | 203 | P14 / C13L |
| C14 | C13R | H | 102 | P10 / C14L |
| C15 | C11R | V | 453 | C15L |
| C16 | C15L | H | 102 | P09 / C16L |

V: left edge on left. H: turn bottom edge to left.

Measure afresh to the blade's kept-side edge.


Max kerf 5 mm. See cutting guide.

# Sheet 2.1 / 18 mm plywood

5x5 ft stock / 1524 x 1524 mm / 8 saw cuts

## CUTTING LAYOUT

P = part ID C = saw cut Grey = remaining stock

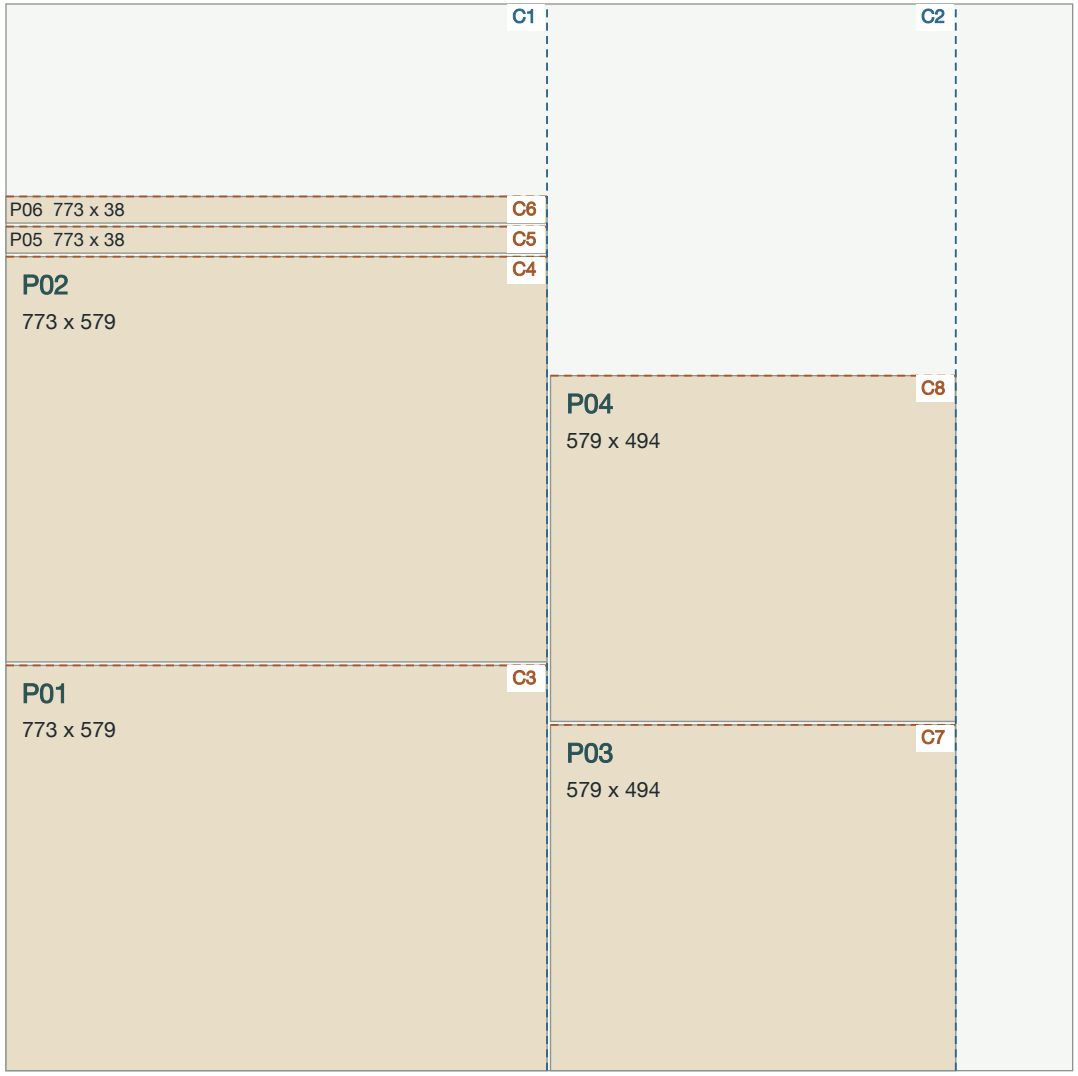


## SAW ORDER / KEEP LEFT

Label both sides CnL / CnR. P = finished blank.

| CUT | FROM | AXIS | KEEP LEFT | LEFT PIECE |
|---|---|---|---|---|
| C1 | S1 | V | 773 | C1L |
| C2 | C1R | V | 579 | C2L |
| C3 | C1L | H | 579 | P01 / C3L |
| C4 | C3R | H | 579 | P02 / C4L |
| C5 | C4R | H | 38 | P05 / C5L |
| C6 | C5R | H | 38 | P06 / C6L |
| C7 | C2L | H | 494 | P03 / C7L |
| C8 | C7R | H | 494 | P04 / C8L |

V: left edge on left. H: turn bottom edge to left.

Measure afresh to the blade's kept-side edge.

Max kerf 5 mm. See cutting guide.