Minitab Exercise 4 Binomial and Hypergeometric Probabilities

Rev 09 17

In this session you will

- Generate random data of the binomial distribution
- Better understand the concept of binomial distributions
- Calculate probabilities using binomial distribution
- Calculate probabilities using hypergeometric distribution
- Approximate hypergeometric probabilities using the binomial distribution

Open a new Minitab project.

Step 1 Generating binomial random data.

Assume we have an automatic spot welding machine that welds hundreds of spots each day. We will inspect a number of these welds each day. Our probability of getting a bad weld is 20% (this is a really bad process). We want to know how many bad welds we can expect to get if we take samples of size 5 or samples of size 100.

In statistical terms, we say were are going to generate two sets of data taken from the same population (all the welds), where the probability of success (bad weld) is p=0.20. In one we will take samples of size 5. In the other we will take samples of size 100

Label columns C1 and C2 as n5 and n100.

Calc>Random Data>Binomial

Number of rows of data to generate: **1000**

Store in column: **n5**Number of trials: **5**Event probability: **0.2**

Click OK.

What appears in the worksheet is a column of data with numbers between 0 and 5. These numbers are the numbers of successes (defective welds) that were in the sample of size 5.

Now generate 1000 rows of data for n100 with 100 trials, keeping the event probability at 0.2.

Step 2. Generating a percent histogram

Now we want to take a closer look at the distribution of n5. Let's look at the shape of the distribution with a histogram.

Graph>Histogram

select **Simple**Graph variable: **n5**

Choose Scale>Y scale type>Percent Click OK twice.

The graph will show the five possible outcomes of the trials (x=0 successes, 1 success, 2, 3, 4, or 5* successes on the x axis. On the y axis, you can read the probability of obtaining x successes, given a sample size of n=5 and probability of success of 20%. * Explanation to come as to why 5 may not be in the data.

Step 3 Understanding Binomial Distribution

Since your "experiment" was repeated 1000 times, each of the bars on the histogram should be close to the theoretical probability.

Recall from the lecture for the binomial distribution

The probability of exactly *x* occurrences in n trials in an event

has a constant probability of occurrence

$$p(x) = \binom{n}{x} p^x (1-p)^{n-x}$$

where p = probability of success

n = the number of trials

x = the number successes

and
$$\binom{n}{x} = \frac{n!}{x!(n-x)!}$$

with $n! = (n)(n-1)(n-2)(n-2)(\dots(1))$

Work the following by hand – show your work.

Calculate the theoretical probability in our problem where p=.2 and n=5 for x=0 successes.

Does your calculation look close to the graph percentage?

What is the probability getting 5 bad welds in your sample?

You probably did not get any observations of x=5 in your data, this should explain why.

What is the probability of getting less than three bad welds? (Add the probabilities of getting 0, 1 and 2 bad welds - looking for $P(x \le 2)$.)

Step 4. Generating binomial probabilities with Minitab

Check your work above with Minitab

To find the theoretical probability in our problem where p=.2 and n=5 for x=0 successes:

Calc> Probability Distributions>Binomial

Choose **Probability**Number of trials: 5
Event probability: 0.2
Input constant: 0

Click OK

Verify that your answer matches your previous calculation. Follow the same steps to check you answer for x=5 by changing the input constant to 5.

To find $P(x \le X)$, the probability of x or fewer successes, use the **cumulative probability**.

For the problem: What is the probability of getting less than three bad welds? (Add the probabilities of getting 0, 1 and 2 bad welds, looking for $P(x \le 2)$. You can check your answer as follows:

Calc> Probability Distributions>Binomial

Choose Cumulative probability

Number of trials: 5 Event probability: 0.2 Input constant: 2

Click OK

The **inverse cumulative probability** is used when you want to find a value of x for a given cumulative probability. For example, to determine the number of defects we would get 90% of the time:

Calc> Probability Distributions>Binomial

Choose Inverse cumulative probability

Number of trials: 5 Event probability: 0.2 Input constant: 0.9

Click OK


Because binomial is a discrete distribution and x must be a whole number, it gives us the two values of x between which the 90% would fall.

Step 5. Binomial Practice

Work the following problems by hand (show all work), then you can check your work in Minitab.			
Ten percent of the items in a large lot are defective. A sample of 8 items is drawn from the lot.			
a)	What is the probability that none of the sampled items are defective?		
b)	What is the probability that one or more of the items are defective?		
-1	Militaria de a consta bilitar de accordo 2 afaba itanza que dafa ativa 2		
c)	What is the probability that exactly 2 of the items are defective?		
d)	What is the probability that fewer than two items are defective?		

Step 6. Binomial problems with Minitab

You can use Minitab to help work the following problems. Write the inputs, answers, and any computations that Mintab did not do for you in the space. (The type of information needed is given in part a, provide similar information for the other parts.)

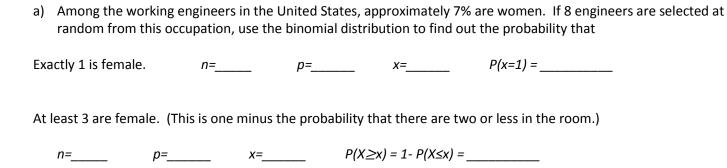

b)	A microchip plant purchases large lots of silicon wafers. 200 are taken from the lot a of defective wafers is greater than 14, the lot is rejected. Find the approximate prob the proportion of the defective wafers in the lot is 5%	•		
c)	The vendor in b) wants the inspection criteria changed so that there lots are accepte probability of x or less defectives is greater than 0.95). If the sample size is still 200 a still 5%, how many defective parts in the lot does the vendor want set as the accepta	and the proportion defective is		
Step 7.	. Binomial Mean and Variance			
•				
	our original problem: Assume we have an automatic spot welding machine that welds ll inspect a number of these welds each day. Our probability of getting a bad weld is 2	· · · · · · · · · · · · · · · · · · ·		
Use Minitab to determine:				
With a	sample of size n= 100, what is the probability that we will get exactly 18 defects in the	e sample.		
With th	he sample size of n=100, what is the probability that the number of defects will be 18 of	or less?		
Recall f	from the lecture:			
	For a process following a binomial distribution, if repeated samples of size n are to the process where the probability of success is p, the average number of successes sample, and the variance in the number of success are as follows			
	Mean: $\mu = np$ Variance: $\sigma^2 = np(1-p)$			
	Mean: $\mu = np$ Variance: $\sigma^2 = np(1-p)$			
	e process where p=.20 and we take a sample size n=100, what are the theoretical mean mber of successes we would observe.	n and standard deviation of		
	μ = σ =			
	one, we simulated an experiment where we took samples of size n=100 many times. e n100 column, calculate the descriptive statistics (Stat>Basic Statistics>Display Descr	iptive Statistics,)		
Look in	n the session window to find your descriptive statistics for the n100 data.			
What is	is the mean? Standard Deviation? (to 3	3 decimal places)		
How does this compare to your calculations?				

Step 8. Hypergeometric Practice

Work the following problems by hand using "hypergeometric without formulas". Then the Minitab instructions can be used to check your work.

- a) In a group of 30 students, 4 did not complete an appropriate prerequisite for an engineering course. The accreditation evaluator requests a random sample of 5 transcripts for review.
 - i. What is the probability that exactly one of the transcripts reviewed contains a prerequisite violation?

ii. What is the probability that none of the transcripts evaluated contains a prerequisite violation?

iii. What is the probability that less than 2 transcripts contain a prerequisite violation?

To check your answer with Minitab For part i.

Calc> Probability Distributions>Hypergeometric

Choose **Probability**

Population size (N): 30
Event count in population (M): 4
Sample size (n): 5
Input constant: 0

Click OK

Verify that your answer matches your previous calculation. Follow the same steps to check you answer for x=1 by changing the input constant to 1.

For part iii, less than 2 is P(0) plus P(1) or the cumulative probability to 1. In Minitab, you would use **Cumulative Probability** with the input constant of 1 to work this.

b)	Three people were exposed to a very bad, contagious disease on a plane on the way to a conference. They contracted the disease but were not aware of it. In the first session of the conference attendees were randomly assigned 5 other attendees to interview. There were 40 people (including those from the plane) along with you in the session. What is the probability that you were assigned to interview at least 1 of the infected attendees?
	(Work by hand, then check work with Minitab.)
Step 9.	Binomial approximation of hypergeometric.
	n generally get a reasonable approximation of hypergeometric probabilities using binomial if the lot size is large and uple size is less than 10% of the lot size.
	A lot of 400 resistors is presented for inspection. There are 25 bad resistors in the lot. A sample of size 30 is taken from the lot. A lot is accepted if there is less than 4 defective in the sample. What is the probability that the lot will be accepted?
a)	Work the above problem in Minitab using hypergeometric.
	$P(x \le 3) = $ using hypergeometric (Exact probability)
b)	The percent defective in the lot is This will be p for the binomial approximation. Work the above problem in Minitab using binomial.
	$P(x \le 3) = \underline{\qquad}$ using binomial. (Approximation)
	(For more binomial practice, you can work this by hand to see if you get the same answer.)