

Stress and strain:

Euler angle과 좌표변환법

강의명: 소성가공 (MSA0026)

정영웅



창원대학교 신소재공학부

YJEONG@CHANGWON.AC.KR

연구실: #52-212 전화: 055-213-3694

Homepage: [HTTP://YOUNGUNG.GITHUB.IO](http://YOUNGUNG.GITHUB.IO)

Euler angles

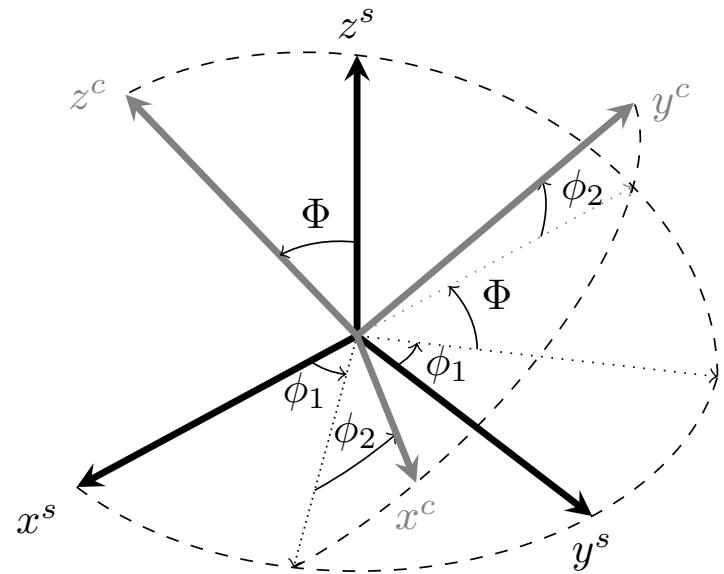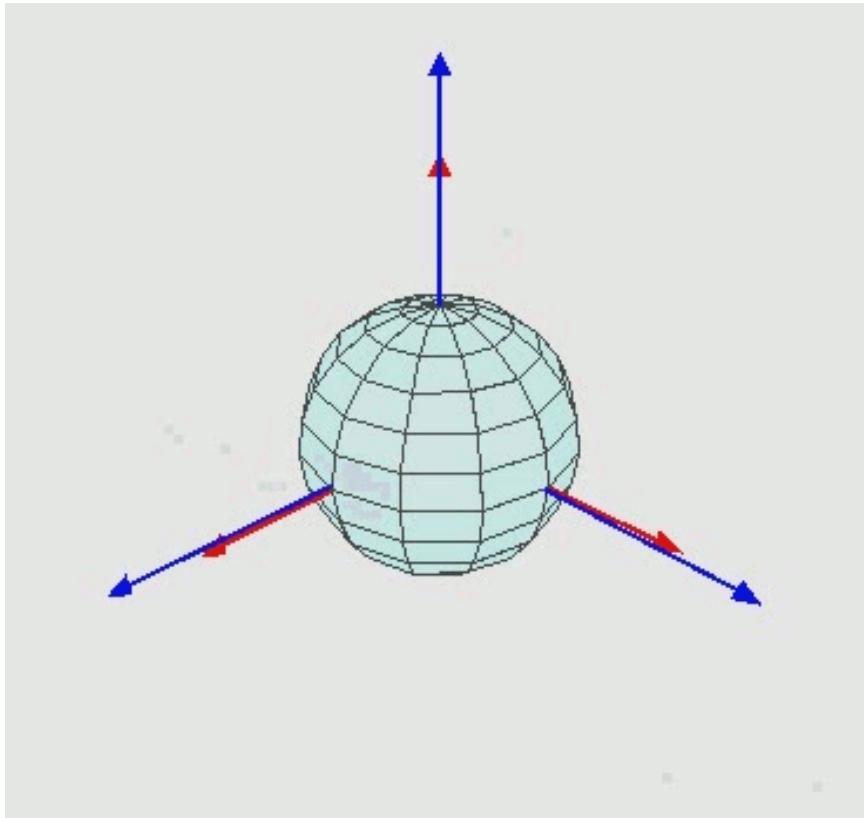

References:

https://en.wikipedia.org/wiki/Euler_angles

<https://youngung.github.io/euler/>

Euler angle을 이용한 3차원 좌표 변환

- 두 삼차원 좌표계간의 관계를 표현하는 방법
- 여러 방법 중 Euler angle를 사용하는 방법이 MSE에서 자주 쓰인다.

1. 한 3차원 좌표에 e_3 축 (z-axis)을 바라보며 시계 반대방향으로 ϕ_1 만큼 회전
2. 다음으로 1.로 인해 회전된 좌표계의 e_1 축을 바라보며 시계 반대방향으로 Φ 만큼 회전
3. 다음으로 1-2.로 인해 회전된 좌표계를 다시 e_3 축을 바라보며 시계 반대방향으로 ϕ_2 만큼 회전

$$R^{\phi_1} = \begin{bmatrix} \cos \phi_1 & \sin \phi_1 & 0 \\ -\sin \phi_1 & \cos \phi_1 & 0 \\ 0 & 0 & 1 \end{bmatrix}$$

$$R^\Phi = \begin{bmatrix} 1 & 0 & 0 \\ 0 & \cos \Phi & \sin \Phi \\ 0 & -\sin \Phi & \cos \Phi \end{bmatrix}$$

$$R^{\phi_2} = \begin{bmatrix} \cos \phi_2 & \sin \phi_2 & 0 \\ -\sin \phi_2 & \cos \phi_2 & 0 \\ 0 & 0 & 1 \end{bmatrix}$$

위의 일련의 세 회전을 설명하는 '하나의' 좌표 변환 matrix를 다음을 통해 만들 수 있다.

$$R_{ij} = R_{ik}^c R_{kl}^b R_{lj}^a$$

$$R = R^c \cdot R^b \cdot R^a$$

$$R \cdot v = [R^c \cdot \{R^b \cdot (R^a \cdot v)\}]$$

Recap: Einstein
summation convention

Let's practice #1

- Follow this link
 - <http://youngung.github.io/euler2ndtensor/>
 - You'll find two links – one to open Google sheet another to download the sheet.

input	output								
This excell sheet proves a means of coordinate system transformation									
	angle	radian							
	phi1	45	0.785						
Three Euler angles	Phi	0	0.000						
	phi2	0	0.000						
transformation matrix R									
삼각 함수 값들			(transformation matrix) ^t = R ^t =R ⁻¹						
cos(phi1)	0.707	sin(phi1)	0.707	0.707	0.707	0.000	0.707	-0.707	0.000
cos(phi)	1.000	sin(Phi)	0.000	-0.707	0.707	0.000	0.707	0.707	0.000
cos(phi2)	1.000	sin(phi2)	0.000	0.000	0.000	1.000	0.000	0.000	1.000
2nd rank tensor in matrix form				R.T		R ^t .R.T	2nd rank tensor after coordinate transformation		
1	0	0		0.707	0.000	0.000	0.500	-0.500	0.000
0	0	0		-0.707	0.000	0.000	-0.500	0.500	0.000
0	0	0		0.000	0.000	0.000	0.000	0.000	0.000
1st rank tensor (i.e., vector) in array form				R.v 1st rank tensor (vector) after coordinate transformation					
1	0	0		0.70710678	-0.7071068	0			

Let's practice #2

- At the bottom of the spread sheet you'll find three separate matrices, which denote the three sequential rotation matrices.

$$\mathbf{R}^a = \begin{bmatrix} \cos \phi_1 & \sin \phi_1 & 0 \\ -\sin \phi_1 & \cos \phi_1 & 0 \\ 0 & 0 & 1 \end{bmatrix} \quad \mathbf{R}^b = \begin{bmatrix} 1 & 0 & 0 \\ 0 & \cos \Phi & \sin \Phi \\ 0 & -\sin \Phi & \cos \Phi \end{bmatrix} \quad \mathbf{R}^c = \begin{bmatrix} \cos \phi_2 & \sin \phi_2 & 0 \\ -\sin \phi_2 & \cos \phi_2 & 0 \\ 0 & 0 & 1 \end{bmatrix}$$

Below is to obtain the transformation matrix by multiplying the three sequential simpler rotation matrices.

g1	g2			g3		
0.707	0.707	0.000		1.000	0.000	0.000
-0.707	0.707	0.000		0.000	1.000	0.000
0.000	0.000	1.000		0.000	0.000	1.000
g3 g2			g3g2g1			
1.000	0.000	0.000		0.707	0.707	0.000
0.000	1.000	0.000		-0.707	0.707	0.000
0.000	0.000	1.000		0.000	0.000	1.000

- Of course, these are functions of phi1, Phi, phi2 values available at the top.

input	output	
This excell sheet proves a means of coordinate system transformation		
	angle	radian
Three Euler angles	phi1	45
	Phi	0
	phi2	0
		transformation mati

Let's practice #3

- Follow this link:
- <http://youngung.github.io/tensors/>

$$\begin{aligned} a'_i &= R_{ij}a_j \\ \sigma'_{ij} &= R_{ik}\sigma_{kl}R_{jl} \end{aligned}$$

$$\mathbb{M}'_{ijkl} = R_{im}R_{jn}\mathbb{M}_{mnop}R_{ko}R_{lp}$$

- Tensor transformation rule is implemented into a Fortran code

Let's practice #3 (Fortran)

```
program transform_vector
implicit none

dimension r(3,3), velocity_old(3), stress(3,3), velocity_new(3)
real*8 r, velocity_old, stress, th, velocity_new
integer i,j,k

!! the transformation matrix:
write(*,*) 'Type: Rotation angle [in degree]:'
read(*,*) th
th = th * 3.141592 / 180. !! convert the degree to radian

r(:,:)=0.
r(1,1)=cos(th)
r(1,2)=sin(th)
r(2,1)=-sin(th)
r(2,2)=cos(th)
r(3,3)=1.

!! velocity
velocity_old(1)=30.
velocity_old(2)=0.
velocity_old(3)=0.

!! let's transform the velocity v`_i = r_ij v_j
do i=1,3
    velocity_new(i)=0.
    do j=1,3
        velocity_new(i)=velocity_new(i)+r(i,j)*velocity_old(j)
    enddo
enddo

!! print out the new velocity
write(*,*) 'old velocity'
write(*,'(3f5.1)') (velocity_old(i),i=1,3)
write(*,*) 'new velocity'
write(*,'(3f5.1)') (velocity_new(i),i=1,3)

end program transform_vector
```

변수 선언.

- E.g., R(3,3) is 'real' 실수, 그리고 (3,3) shape – 3x3 array

입력

- 'th'라는 변수에 user가 각도를 입력하면 radian 값으로 변환한다.

Transformation matrix

- 'th'라는 변수를 사용하여 3축을 잡고 ccw 회전시키는 transformation matrix를 만들어 변수 r에 저장

Velocity_old 변수 설정

- Old coordinate system에 참조된 알고 있는 1차 텐서 velocity_old 변수를 설정 [30,0,0] array로 저장; ***1차 텐서는 벡터다.**

위 tensor를 변환하여 새로운 array에 저장

- 아래의 formula를 실행하여 1차 랭크 텐서 변환

$$v'_i = R_{ij} v_j$$

v 와 v`을 화면에 출력

Let's take a close look at the loop

```
do i=1,3
    velocity_new(i)=0.
do j=1,3
    velocity_new(i)=velocity_new(i)+r(i,j)*velocity_old(j)
enddo
enddo
```

1. In the above, each do-enddo pair

```
DO  
ENDDO
```

allows you to form a loop:
where integer i increases
from 1 to 3, for each of
which j increases from 1 to 3.

2. For instance, while i=1,
you repeat

```
DO j=1,3
ENDDO
```

That means you perform

$$v_1^{new} = \sum_j^3 R_{1j} v_j^{old}$$

3. If you repeat Step 2 for i=2
and i=3 as well, you actually
perform:

$$v_i^{new} = \sum_i^3 \sum_j^3 R_{ij} v_j^{old}$$

Remember that the above
summation can be written
short:

$$v_i^{new} = R_{ij} v_j^{old}$$

If you extend that idea for 2nd order tensor?

- Let's take an inverse approach for the 2nd order tensor transformation.
- We learned that the 2nd rank tensor transformation is done following the below rule:

$$\sigma'_{ij} = R_{ik}\sigma_{kl}R_{jl}$$

- The above can be implemented to a FORTRAN code such that

```
do i=1,3
do j=1,3
    s_new(i,j)=0.
do k=1,3
do l=1,3
    s_new(i,j)=s_new(i,j) + r(i,k)*s_old(k,l)*r(j,l)
enddo
enddo
enddo
enddo
```

- You might be able to find certain rules that are applicable when you implement the tensor transformation. Also, you might have found the Einstein convention is very useful particularly when the formula is translated into FORTRAN code.
- FORTRAN** actually means '**FORMULA TRANSLATION**'

Q. Extend that idea for 4th rank tensor

- Within elastic region, metal follows Hooke's law which writes as below:
 - $\sigma_{ij} = E_{ijkl}\varepsilon_{kl}$
- (For advanced students) Can you write a short FORTRAN **DO-ENDDO loop** for the above operations?

Let's practice #3 (Python)

```
import numpy as np
velocity_old=np.zeros(3)
velocity_new=np.zeros(3)
r=np.zeros((3,3))
velocity_old[0]=30.

th=raw_input('Type angle [in degree]: ')
th=np.pi*float(th)/180.

r[0,0]=np.cos(th)
r[0,1]=np.sin(th)
r[1,0]=-np.sin(th)
r[1,1]=np.cos(th)
r[2,2]=1.

## Apply v`_i = r_ij v_j
for i in xrange(3):
    for j in xrange(3):
        velocity_new[i]=velocity_new[i]+ \
            r[i,j]*velocity_old[j]

print 'old velocity'
print velocity_old
print 'new velocity'
print velocity_new
```

변수 선언.

- E.g., velocity_old와 velocity_new는 사이즈 3x1의 array
- R: 3x3 array;
- velocity_old 변수의 첫번째(0) element에 30 입력

입력

- 'th' 각도 입력한후 Radian값으로 변환

Transformation matrix

- 'th'라는 변수를 사용하여 3축을 잡고 ccw 회전시키는 transformation matrix를 만들어 변수 r에 저장

위 tensor를 변환하여 새로운 array에 저장

- 아래의 formula를 실행하여 1차 랭크 텐서 변환
- $v'_i = R_{ij}v_j$

v 와 v'을 화면에 출력

Tensor and coordinate transformation


- Tensor is a method to represent physical quantities (and also some material properties).
- Physical quantities should **remain the same** even if you transform them to another coordinate system; The physical quantities should not be affected by the chosen coordinate system.
- But when you change the coordinate system, the values pertaining to individual components of the tensor may change.
- The values of components that are changing w.r.t. coordinate system are used when you need quantification of associated physical quantity (or material property). That's one of the reasons why you should learn how to apply the coordinate transformation to tensors.

Example: pure shear

- Pure shear is a term referring to a stress (or strain) state where **only shear components are non-zero**.

$$\begin{bmatrix} 1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & 0 & 0 \end{bmatrix}$$

I found the left is a simple shear state. Anything wrong with me?

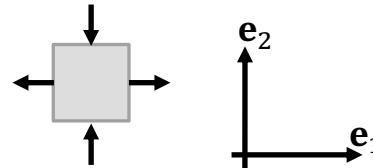

Let's check by using the spread sheet.


- Put the given stress state value

$$\begin{bmatrix} 1 & 0 & 0 \\ 0 & -1 & 0 \\ 0 & 0 & 0 \end{bmatrix}$$

- Put $\phi_1 = 45^\circ$
To obtain

input	output
This excell sheet proves a means of coordinate system transformation	
Three Euler angles	angle radian
phi1	45 0.785
Phi	0 0.000
phi2	0 0.000
삼각 함수 값들	
cos(phi1)	0.707 sin(phi1)
cos(Phi)	0.000 sin(phi)
cos(phi2)	1.000 sin(phi2)
2nd rank tensor in matrix form	
1 0 0 0 0 0 0 0 0	
1st rank tensor (i.e., vector) in array form	
1 0 0	
transformation matrix R	(transformation matrix) ^t =R ^t =R ⁻¹
0.707 0.707 0.000 -0.707 0.707 0.000 0.000 0.000 1.000	0.707 -0.707 0.000 0.707 0.707 0.000 0.000 0.000 1.000
R.T	R ^t .R.T 2nd rank tensor after coordinate transformation
0.707 0.000 0.000 -0.707 0.000 0.000 0.000 0.000 0.000	0.500 -0.500 0.000 -0.500 0.500 0.000 0.000 0.000 0.000
R.v 1st rank tensor (vector) after coordinate transformation	
0.70710678 -0.7071068	

- Check the new tensor component values referred to the new coordinate system

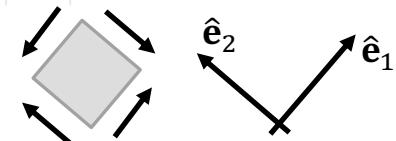

- 새로운 좌표계에서는 pure shear state로 표현됨을 알 수 있다.


Q. 응력이 바뀐 것인가?

Advanced Example (기출)

- Elastic modulus (\mathbb{E}) is a 4th rank tensor and correlates the stress (σ) and strain (ϵ) in the elastic regime through
 - $\sigma = \mathbb{E} : \epsilon$
- Note that the colon symbol in the above denotes the **double inner dot operation** such that
 - $\sigma_{ij} = \mathbb{E}_{ijkl}\epsilon_{kl}$
- Q1. Express σ_{23} in the function of \mathbb{E} and ϵ by explicitly denoting the indices of the associated tensors; Do not contract the expression by using Einstein's summation convention; Do not use the summation symbol.
- Q2. How many separate equations are hidden?

Where coordinate system transformation is required?



- Stretch bending test
- The failure criterion is usually written in terms of strain (or stress) state referred to the coordinate that is attached to the plane of the sheet metal.
- Here, as you can see, the region of specimen that eventually fractures, flows over the roller, during which it bends and 'rotates'.
- Therefore, you would want to 'transform' the stress state that was once referred to the global coordinate to the local coordinate system that 'rotates' together with the material.

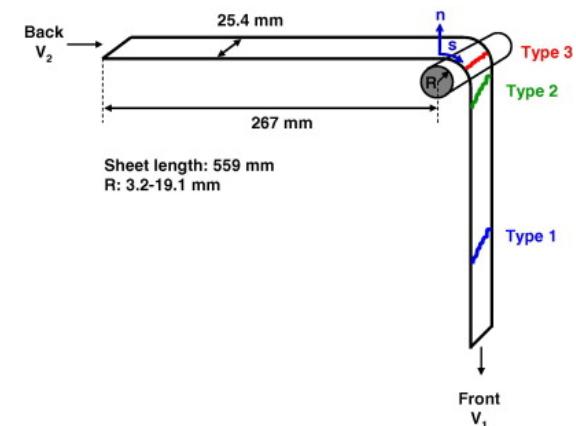

Where coordinate system transformation is required?


Critical Resolved Shear Stress

Atom position when maximum repulsive force occurs

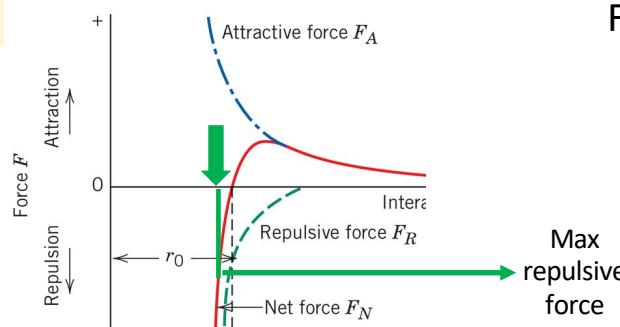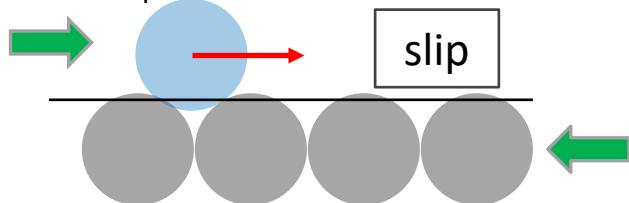

For dislocation to slip, this max. force should be overcome.

Max. repulsive force is closely related with the CRSS

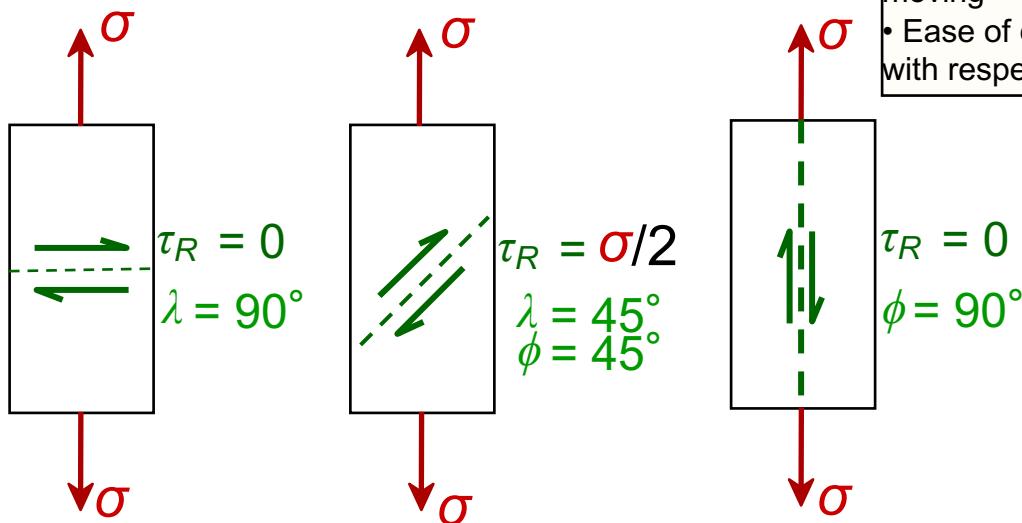

- Condition for dislocation motion (= condition for plastic yielding): If RSS reaches a certain (critical) value, the dislocation will start moving
- Ease of dislocation motion depends on crystallographic orientation with respect to the external loading direction

$$\tau_{RSS} = \sigma \cos \lambda \cos \phi$$

$\cos \lambda \cos \phi$: Schmid's (orientation) factor

Dislocation slip condition (\approx atomic yield condition)

$$\tau_{RSS} \geq \tau_{CRSS}$$


Example: yield of single crystal

- a) Will the single crystal yield?
- b) If not, what stress is needed?

$$\tau_{RSS} = \sigma \cos \lambda \cos \phi$$

We learned this equation that correlates the external loading (σ) and the orientation of slip system (λ, ϕ).

Condition 1. External load of 45 MPa

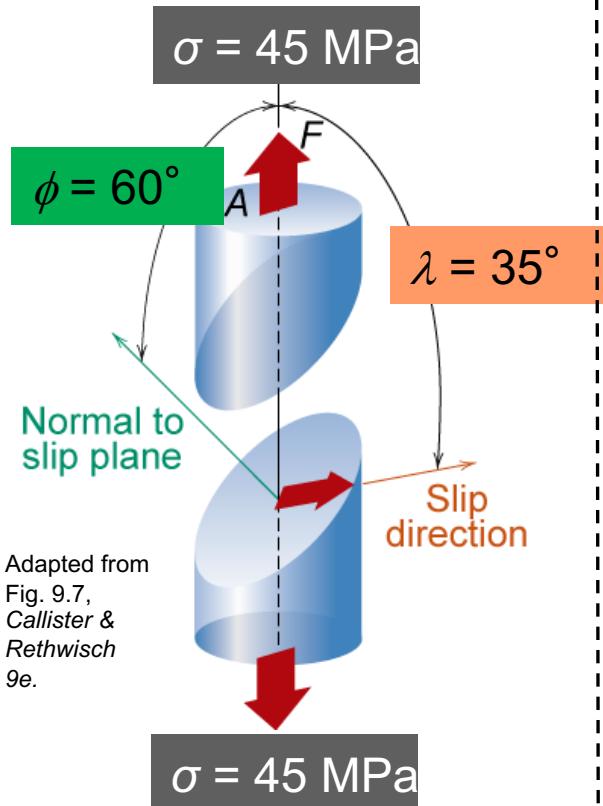

Condition 2. Slip system characterized by $\lambda = 35^\circ, \phi = 60^\circ$

Adapted from
Fig. 9.7,
*Callister &
Rethwisch
9e.*

Condition for dislocation to slip?

$$\tau_{RSS} \geq \tau_{CRSS}$$


Condition 1. $\tau_{CRSS} = 20.7 \text{ MPa}$

Condition 2. $\tau_{RSS} = \sigma \cos \lambda \cos \phi$
 $= 45 \cos 35^\circ \cos 60^\circ \text{ [MPa]}$
 $\approx 45 \times 0.819 \times 0.5 \approx 18.4 \text{ [MPa]}$


Check $\tau_{RSS} \geq \tau_{CRSS}$

45 MPa is not sufficient enough to cause this slip system ($\lambda = 35^\circ, \phi = 60^\circ$) to slip (yield)

Transformation for CRSS

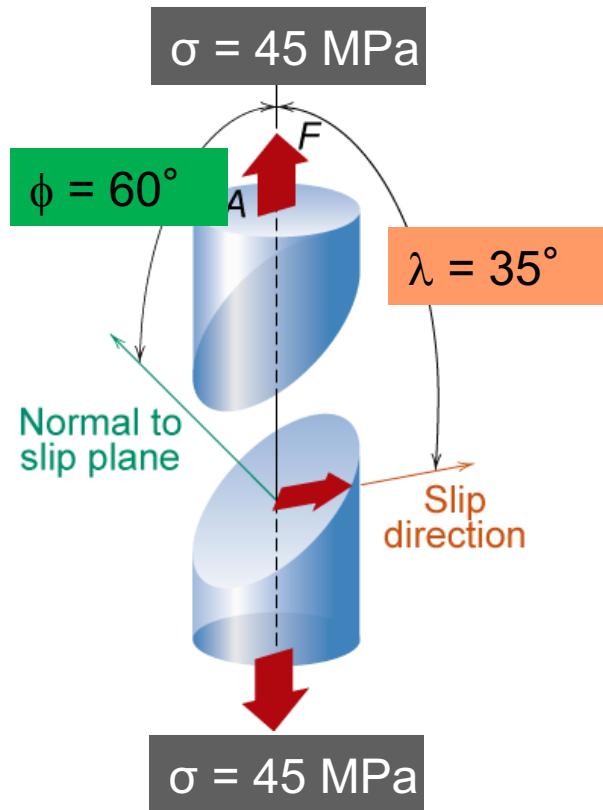

$$\phi_1 = 25^\circ, \Phi = 60^\circ, \phi_2 = 19^\circ$$

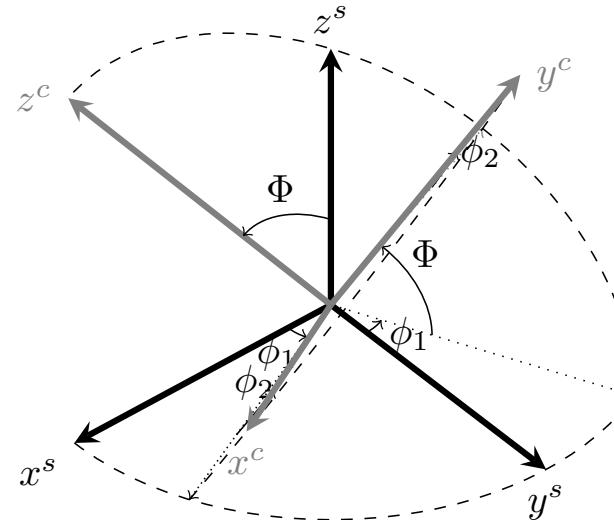

Transformation matrix that connects the loading axes to slip system axes.

This gives the transformation matrix like:

0.788	0.547	0.282
-0.495	0.291	0.819
0.366	-0.785	0.500

If you transform

0	0	0
0	0	0
0	0	45

You'll get

3.577	10.389	6.344
10.389	30.173	18.424
6.344	18.424	11.250

예제(hydrostatic pressure)

- 다음의 2차 응력 텐서를 주어진 좌표변환 matrix를 사용하여 변환된 후의 값을 매트릭스 형태로 표현하여라.
- 현재 좌표계에서의 응력 텐서는 다음과 같은 형태로 보임:

100	0	0
0	100	0
0	0	100

- 좌표 변환 matrix는

0.788	0.547	0.282
-0.495	0.291	0.819
0.366	-0.785	0.500

예제 (기출 문제)

- 단결정 알루미늄 재료에 $[100N, 0N, 0N]$ 의 힘으로 한쪽 축으로 당겨지고 있다. 이때, 아래와 같은 조건이 주어진 결정면에서 작용하는 수직 응력을 찾아보자.
 - 해당 결정면은 (111) 면으로써, 그 수직 방향이 $[3, 4, 5]$ 방향 벡터와 평행한 방향으로 놓여있다.
 - 결정면의 단면적이 1um^2 이다.

풀이

- 1. 수직방향 $[3, 4, 5]$ 의 normal vector를 찾아라.
- 2. 다음으로 수직 normal vector와 힘사이에 dot-product를 한다 – 내적.
 - 이를 통해, normal vector로 프로젝트된 량 만큼의 힘 벡터를 구할 수 있다.
- 3. 내적을 통해 얻어진 값에 다시 한번 normal vector 값을 dot-product 하라.
 - 이를 통해, 해당 면에 작용하는 힘의 값을 알 수 있다 (scalar value).
- 3. 얻어진 힘의 값을 단면적으로 나누어라.
 - 이를 통해 실제 결정면의 수직 방향으로 작용하는 수직 응력 값을 구할 수 있다.

예제

- 단결정 알루미늄 재료에 $[30N, 5N, 0N]$ 의 힘이 작용하고 있다. 이때, 아래와 같은 조건이 주어진 결정면에서 특정 방향으로 작용하는 전단 응력을 찾아보자.
 - 해당 결정면은 (111) 면으로써, 그 수직 방향이 $[2, 1, 1]$ 방향 벡터와 평행한 방향으로 놓여있다.
 - 해당 결정면에서 $[-1, 1, 1]$ 방향으로의 전단 응력을 구해보자.
 - 결정면의 단면적이 1um^2 이다.

풀이

- 1. 수직방향 $[2, 1, 1]$ 의 normal vector를 찾아라.
- 2. 다음으로 수직 normal vector와 힘사이에 dot-produc를 한다 – 내적.
 - 이를 통해, normal vector로 프로젝트된 양 만큼의 힘 벡터를 구할 수 있다.
- 3. 내적을 통해 얻어진 값에 다시 한번 전단력 방향인 $[-1, 1, 1]$ 벡터와 dot-product 하라.
 - 이를 통해, 해당 면에 작용하는 전단 방향의 힘의 값을 알 수 있다 (scalar value).
- 3. 얻어진 힘의 값을 단면적으로 나누어라.
 - 이를 통해 실제 결정면의 수직 방향으로 작용하는 수직 응력 값을 구할 수 있다.

예제 – 좌표 변환을 사용한 예제.

- 한 알루미늄 시편의 응력상태가 한 좌표계에서 응력 텐서를 사용하여 $[[1,2,3],[4,5,6],[7,8,9]]$ 로 주어져 있다.
- 알루미늄 시편의 (111) 결정면과 [1-10] 방향으로 RSS가 궁금하다.
- 만약 단결정의 결정좌표계(crystal coordinate system)와 응력텐서가 참조된 실험실좌표계(lab coordinate system)의 관계가 다음과 같은 transformation matrix로 주어진다면, RSS값은 얼마인가? Transformation matrix는 결정좌표계를 실험실 좌표계로 옮겨주는 것에 유의하라.
 - 0.996 -0.087 0.006
 - 0.086 0.981 -0.174
 - 0.009 0.173 0.985